Accessibility Survey



Town of Tisbury School

40 West Williams Street Vineyard Haven, MA 02568

Date of Inspection 5/6/2019

Path of Travel - 1st Floor : Path Of Travel , Walking Surfaces

1st Floor Main Entrance

Step

Finding

There is a step or curb on the path of travel preventing access.

On-Site Finding Item Found

Recommendation

Provide a ramp or other means of vertical access.

Recommendation See Recommendation

Costing Info (Estimated)

Provide a ramp or other means of \$3,500 vertical access

Code Reference MA 20.1, ADA 303, 403.4

Record Number 53771

Path Of Travel , Walking Surfaces : Stairs or Steps Obstruction



Stairs - 1st Floor : Stairway , Handrail

1st Floor Stairs Next to 221

Run 1 Right Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 53930

Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to 221

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.50 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528


Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53931

Stairway , Handrail : Handrail Bottom Extension





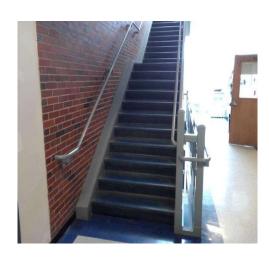

Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to 221

Run 2 Right Handrail

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 7.00 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Costing Info (Estimated)


Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53927

Stairway , Handrails : Handrail Extension Length

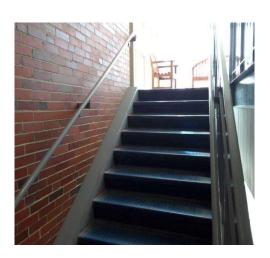

Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to 221

Run 2 Right Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53928

Stairway , Handrails : Handrail Extension not Parallel



Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to 221

Run 2 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.50 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53929

Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to Main Entrance

Run 1 Left Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.3,

504.6

Record Number 53982

Stairway , Handrails : Handrail Height



Stairway , Handrails $\,:\,$ No Bottom Handrail Extension



Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to Main Entrance Run 1 Left Handrail

Finding

The ends of the handrails are not rounded or returned smoothly to the wall or post.

On-Site Finding None Found

Recommendation

Install handrail extensions that are rounded or returned smoothly to the wall post.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant handrail \$1,916

Code Reference MA 27.4.8, ADA 504, 504.6, 505.10

Record Number 53983

Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to Main Entrance Run 1 Left Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53984

Stairway , Handrails : Handrail Extension



Stairway , Handrails : Handrail Extension not Parallel $\,\,$



Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to Main EntranceRun 1 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 30.50 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53985

Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to Main EntranceRun 1 Right Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.3,

504.6

Record Number 53976

Stairway , Handrails : Handrail Height



Stairway , Handrails : No Bottom Handrail Extension



Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to Main Entrance Run 1 Right Handrail

Finding

The distance between the handrail and the wall on the stairway is less than required.

On-Site Finding 0.50 inches

Recommendation

Remount the handrails on the stairway so that the distance from the handrail to the adjacent wall is compliant.

Recommendation At least 1.50 inches

Costing Info (Estimated)

Add compliant handrail \$1,916

Code Reference MA 27.4.7, ADA 504, 505.5, 504.6

Record Number 53977

Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to Main EntranceRun 1 Right Handrail

Finding

The ends of the handrails are not rounded or returned smoothly to the wall or post.

On-Site Finding None Found

Recommendation

Install handrail extensions that are rounded or returned smoothly to the wall post.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant handrail \$1,916

Code Reference MA 27.4.8, ADA 504, 504.6, 505.10

Record Number 53978

Stairway , Handrails : Handrail Distance From Wall



Stairway , Handrails : Handrail Extension



Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to Main EntranceRun 1 Right Handrail

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 11.00 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53979

Stairway , Handrails : Handrail Extension Length



Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to Main Entrance Run 1 Right Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53980

Stairway , Handrails : Handrail Extension not Parallel



Stairs - 1st Floor : Stairway , Handrails

1st Floor Stairs Next to Main Entrance Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 32.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53981

Stairs - 1st Floor : Stairway

1st Floor Stairs Next to Main Entrance

Finding

Stairway is marked as primary access. There is no other means of vertical access.

On-Site Finding No Access

Recommendation

Provide a compliant means of vertical access.

Recommendation See Recommendation

Costing Info (Estimated)

Modify stairway \$4,816

Code Reference MA 20.12.3, ADA 210, 504, 206.2,

402.2

Record Number 53975

Stairway , Handrails : Handrail Height





Stairway

Doors - 1st Floor : Door , Hardware

1st Floor 201

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52662

Doors - 1st Floor: Door

1st Floor 201

Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)

Remove door stop \$50

Code Reference ADA 404, 404.2.10

Record Number 52663

Door , Hardware : Door Lock



Door : Door Hardware



Doors - 1st Floor : Door , Hardware

1st Floor 202

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52756

Doors - 1st Floor: Door

1st Floor 202

Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)


Remove door stop \$50

Code Reference ADA 404, 404.2.10

Record Number 52757

Door, Hardware: Door Lock



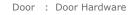



Doors - 1st Floor: Door, Clear Floor Space

1st Floor 202

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 32.75 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Cabinet Obstructs Clear Floor Space Length.

Record Number 52758

Doors - 1st Floor : Door , Hardware

1st Floor 203

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52767

Door , Clear Floor Space : Front Approach Clear Floor Space Length



Door , Hardware : Door Lock



Doors - 1st Floor : Door , Hardware

1st Floor 203 from 201

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 53037

Doors - 1st Floor : Door , Latch Side Clearance

1st Floor 203 from 201

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 1.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches


Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Cabinet Obstructs Latch Side Clearance.

Record Number 53038

Door, Hardware: Door Lock

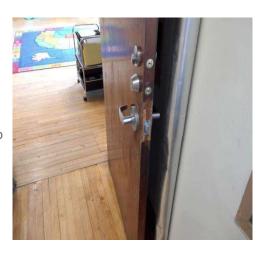

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - 1st Floor : Door , Hardware

1st Floor 204

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52877

Doors - 1st Floor : Door , Hardware

1st Floor 204 from 202

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation


Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 52867

Door, Hardware: Door Lock

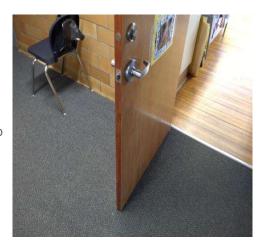

 ${\sf Door\ ,\ Hardware\ :\ Door\ Lock}$



Doors - 1st Floor : Door , Latch Side Clearance

1st Floor 204 from 202

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 5.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000

Code Reference MA 26.6, ADA 404, 404.2.4

Notes : Cabinet Obstructs Latch Side Clearance. Ventilation Obstructs Clear Floor Space Length.

Record Number 52868

Doors - 1st Floor : Door , Clear Floor Space

1st Floor 204 from 202

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 35.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921

Code Reference MA 26.6, ADA 404, 404.2.4

Notes: Cabinet Obstructs Latch Side Clearance. Ventilation Obstructs Clear Floor Space Length.

Record Number 52870

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Door , Clear Floor Space : Front Approach Clear Floor Space Length



Doors - 1st Floor : Door , Clear Floor Space

1st Floor 204 from 202

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 52869

Doors - 1st Floor : Door , Hardware

1st Floor 211

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 53621

Door , Clear Floor Space : Floor Mat



Door , Hardware : Door Lock



Doors - 1st Floor : Door

1st Floor 211

Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)

Remove door stop \$50

Code Reference ADA 404, 404.2.10

Record Number 53622

Doors - 1st Floor : Door , Threshold

1st Floor 211

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.75 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Provide smooth transition \$436

Code Reference MA 26.10, ADA 404, 404.2.5

Record Number 53623

Door : Door Hardware



 ${\sf Door}\;, {\sf Threshold}\;:\; {\sf Door}\; {\sf Threshold}\;$



Doors - 1st Floor : Door , Latch Side Clearance

1st Floor 211

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 4.50 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** ADA 404, 404.2.4, 404.2.4.1

Record Number 53624

Doors - 1st Floor: Door

1st Floor 213

Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)

Remove door stop \$50

Code Reference ADA 404, 404.2.10

Record Number 54074

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Door : Door Hardware



Doors - 1st Floor : Door , Clear Floor Space

1st Floor 213

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 54075

Doors - 1st Floor : Door , Hardware

1st Floor 213 from Financial Secretary

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 54024

Door , Clear Floor Space : Floor Mat







Doors - 1st Floor: Door

1st Floor 213 from Financial Secretary

Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)

Remove door stop \$50

Code Reference ADA 404, 404.2.10

Record Number 54025

Doors - 1st Floor : Door , Hardware

1st Floor 214

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 52988

Door : Door Hardware



 $\hbox{Door , Hardware }: \hbox{ Door Lock}$



Doors - 1st Floor : Door , Latch Side Clearance

1st Floor 214

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 15.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 52989

Doors - 1st Floor : Door , Clear Floor Space

1st Floor 214

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation


Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 52990

Door , Latch Side Clearance : Front Approach Latch Side Clearance

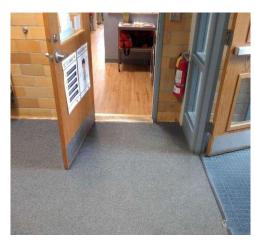





Doors - 1st Floor : Door , Clear Floor Space

1st Floor 214 Next to 213

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 52941

Doors - 1st Floor : Door , Hardware

1st Floor 215

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310


Code Reference ADA 404.2.7, 309.4

Record Number 53072

Door , Clear Floor Space : Floor Mat



Door , Hardware : Door Lock

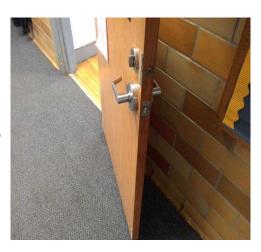

Doors - 1st Floor : Door , Clear Floor Space

1st Floor 215

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 53073

Doors - 1st Floor : Door , Hardware

1st Floor 218

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 53145

Door , Clear Floor Space : Floor Mat







Doors - 1st Floor : Door , Hardware

1st Floor 218

Lever

Door , Hardware : Door Lock

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 53146

Doors - 1st Floor : Door , Hardware

1st Floor 219

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 52891



Door , Hardware : Door Lock



Doors - 1st Floor : Door

1st Floor 221 Library

Push Bar / Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)

Remove door stop \$50

Code Reference ADA 404, 404.2.10

Record Number 53713

Doors - 1st Floor: Door, Latch Side Clearance

1st Floor 221 Library

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 0.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** ADA 404, 404.2.4, 404.2.4.1

Notes: Cabinet Obstructs Latch Side Clearance.

Record Number 53714

Door : Door Hardware



Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - 1st Floor : Door , Latch Side Clearance

1st Floor 222 at Library

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 3.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000

Code Reference MA 26.6, ADA 404, 404.2.4

Notes: Refrigerator Obstructs Latch Side Clearance.

Mailbox Obstructs Clear Floor Space Length.

Record Number 53842

Doors - 1st Floor : Door , Clear Floor Space

1st Floor 222 at Library

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 56.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921


Code Reference MA 26.6, ADA 404, 404.2.4

Notes: Refrigerator Obstructs Latch Side Clearance.

Mailbox Obstructs Clear Floor Space Length.

Record Number 53843

Door , Latch Side Clearance : Front Approach Latch Side Clearance

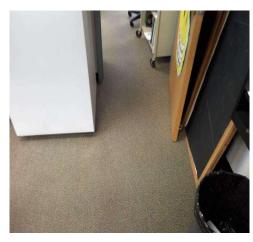

Door , Clear Floor Space : Front Approach Clear Floor Space Length



Doors - 1st Floor : Door , Hardware

1st Floor Administration Entrance

Lever

Door, Hardware: Door Lock

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation


Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 54101

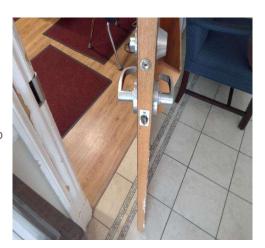

Doors - 1st Floor : Door , Latch Side Clearance

1st Floor Administration Entrance Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 9.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4 Notes: Display Obstructs Latch Side Clearance.

Record Number 54102

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - 1st Floor : Door , Latch Side Clearance

1st Floor Boys Restroom Next to 215 Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 7.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 52645

Doors - 1st Floor : Door , Hardware

1st Floor Boys Restroom Next to 215 Push / Pull

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 13.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 52643

Door , Latch Side Clearance : Front Approach Latch Side Clearance







Doors - 1st Floor : Door , Hardware

1st Floor Boys Restroom Next to 215

Push / Pull

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52644

Doors - 1st Floor : Door , Clear Floor Space

1st Floor Boys Restroom Next to 215 Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface


Code Reference ADA 403.2, 302.1

Record Number 52646

Door, Hardware: Door Lock





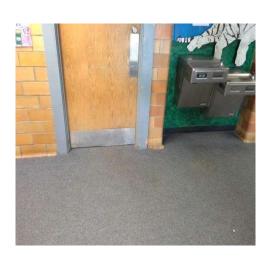

Doors - 1st Floor : Door , Hardware

1st Floor Conference Room Next to Administration EntranceLever

Door , Hardware : Door Lock

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation


Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 54062

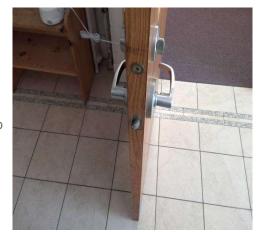

Doors - 1st Floor : Door , Latch Side Clearance

1st Floor Conference Room Next to Administration Entrance Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 16.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Stair Obstructs Latch Side Clearance.

Record Number 54063



Door , Latch Side Clearance : Front Approach

Latch Side Clearance

Doors - 1st Floor : Door , Latch Side Clearance

1st Floor Financial Secretary

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 12.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Desk Obstructs Latch Side Clearance.

Record Number 54069

Doors - 1st Floor : Door , Clear Floor Space

1st Floor Financial Secretary

Pull Side

Finding

There is no level landing at this door.

On-Site Finding 3.20 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Correct slopes \$1,500

Code Reference MA 26.6, ADA 302, 404, 305,

404.2.4.4

Notes: Desk Obstructs Latch Side Clearance.

Record Number 54072

Door , Latch Side Clearance : Front Approach Latch Side Clearance



 ${\bf Door\ ,\ Clear\ Floor\ Space\ :\ Floor\ Surface\ Slope}$



Doors - 1st Floor : Door , Clear Floor Space

1st Floor Financial Secretary

Pull Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Notes: Desk Obstructs Latch Side Clearance.

Record Number 54073

Doors - 1st Floor : Door , Clear Floor Space

1st Floor Financial Secretary

Push Side

Finding

There is no level landing at this door.

On-Site Finding 3.60 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Correct slopes \$1,500

Code Reference MA 26.6, ADA 302, 404, 305,

404.2.4.4

Record Number 54070

Door , Clear Floor Space : Floor Mat



Door , Clear Floor Space : Floor Surface Slope



Doors - 1st Floor : Door , Latch Side Clearance

1st Floor Girls Restroom Next to 204 Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 8.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 52750

Doors - 1st Floor : Door , Hardware

1st Floor Girls Restroom Next to 204

Push / Pull

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 11.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 52748

Door , Latch Side Clearance : Front Approach Latch Side Clearance







Doors - 1st Floor : Door , Hardware

1st Floor Girls Restroom Next to 204

Push / Pull

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52749

Doors - 1st Floor : Door , Clear Floor Space

1st Floor Girls Restroom Next to 204

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)


Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 52751 Door, Hardware: Door Lock



Door , Clear Floor Space : Floor Mat

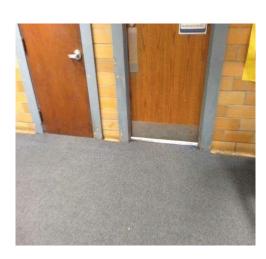

Doors - 1st Floor : Door , Hardware

1st Floor Guidance Office

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52936

Doors - 1st Floor: Door

1st Floor Guidance Office

Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)

Remove door stop \$50


Code Reference ADA 404, 404.2.10

Record Number 52937

Door, Hardware: Door Lock



Door : Door Hardware

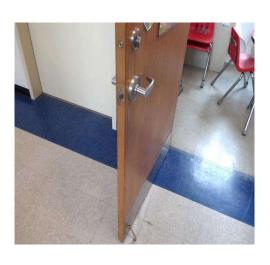

Doors - 1st Floor: Door, Clear Floor Space

1st Floor Guidance Office

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.


Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 52938

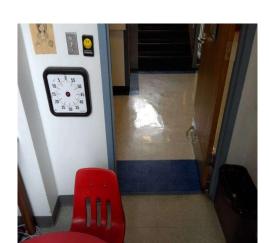

Door, Clear Floor Space: Floor Mat

Doors - 1st Floor : Door , Latch Side Clearance

1st Floor Hallway from 211 Next to 213 Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 16.75 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Counter Obstructs Latch Side Clearance.

Record Number 53953

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - 1st Floor : Door , Clear Floor Space

1st Floor Hallway from 211 Next to 213 Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 43.50 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Desk Obstructs Clear Floor Space Length.

Record Number 53954

Doors - 1st Floor: Door, Clear Floor Space

1st Floor Hallway from 211 Next to 213 Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Notes: Desk Obstructs Clear Floor Space Length.

Record Number 53955

Door , Clear Floor Space : Front Approach Clear Floor Space Length



 ${\sf Door\ ,\ Clear\ Floor\ Space\ :\ Floor\ Mat}$



Doors - 1st Floor : Door , Hardware

1st Floor Hallway Next to 216

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 53807

Doors - 1st Floor : Door , Hardware

1st Floor Hallway Next to 216

Push Bar / Lever

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 53808

Door, Hardware: Door Opening Pressure



Door , Hardware : Bottom Door Panel



Doors - 1st Floor : Door , Hardware

1st Floor Hallway Next to Guidance OfficePush Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 52678

Doors - 1st Floor : Door , Hardware

1st Floor Hallway Next to Guidance OfficePush Bar / Lever

Push bar / Lever

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 52679

Door , Hardware : Door Opening Pressure



Door , Hardware : Bottom Door Panel



Doors - 1st Floor : Door , Hardware

1st Floor Main Entrance

Door , Hardware : Bottom Door Panel Height

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding 7.00 inches

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation At least 10.00 inches

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 53957

Doors - 1st Floor: Door, Clear Floor Space

1st Floor Main Entrance

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 18.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Step Obstructs Clear Floor Space Length.



 $\label{eq:continuous} \mbox{Door , Clear Floor Space} \ : \ \mbox{Front Approach Clear Floor Space Length}$



Doors - 1st Floor: Door, Clear Floor Space

1st Floor Main Entrance

Pull Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Notes: Step Obstructs Clear Floor Space Length.

Record Number 53960



Door , Clear Floor Space : Floor Mat

Doors - 1st Floor : Door , Clear Floor Space

1st Floor Main Entrance

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 53958

Door , Clear Floor Space : Floor Mat



Doors - 1st Floor : Door

1st Floor Main Entrance

Door : Door Opening Width

Finding

The clear opening width of the door is less than required.

On-Site Finding 27.00 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Costing Info (Estimated)

Widen existing door and add \$1,750

accessible hardware

Code Reference MA 26.5, ADA 404, 404.2.3

Record Number 53956



1st Floor Main Entrance at Hallway

Push Bar / D Handle

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 14.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9







Doors - 1st Floor : Door , Hardware

1st Floor Main Entrance at Hallway

Door , Hardware : Bottom Door Panel Height

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding 7.00 inches

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation At least 10.00 inches

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 54061



1st Floor Staff Unisex Restroom Next to 215Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 9.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Lavatory Obstructs Clear Floor Space Length.

Record Number 52901



Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - 1st Floor : Door , Clear Floor Space

1st Floor Staff Unisex Restroom Next to 215Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 30.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Lavatory Obstructs Clear Floor Space Length.

Record Number 52903

Doors - 1st Floor : Door

1st Floor Staff Unisex Restroom Next to 215

Finding

The clear opening width of the door is less than required.

On-Site Finding 29.50 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches


Costing Info (Estimated)

Widen existing door and add \$1,750 accessible hardware

Code Reference MA 26.5, ADA 404, 404.2.3

Record Number 55920

Door , Clear Floor Space : Front Approach Clear Floor Space Length

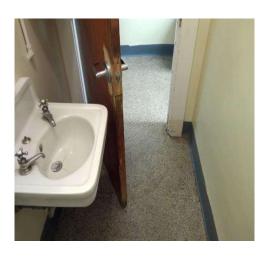



Door : Door Opening Width

Doors - 1st Floor : Door , Hardware

1st Floor Unisex Restroom in 214

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 52821

Doors - 1st Floor : Door , Clear Floor Space

1st Floor Unisex Restroom in 214 Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 47.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Lavatory Obstructs Clear Floor Space Length.

Record Number 52823

Door , Hardware : Door Opening Pressure







Counters - 1st Floor : Counter

1st Floor Sign in

Finding

The height of the counter or desk does not comply with height requirements. No equivalent facilitation is provided in the area.

On-Site Finding 39.75 inches

Recommendation

Provide a portion of counter at the compliant height.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant counter \$3,500

Code Reference MA 35.6,MA 7.2, ADA 902, 904

Record Number 54014

Signage - 1st Floor : Signage

1st Floor 201

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 61.50 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52813



Counter : Counter Height

Signage : Highest Tactile Character Height



Signage - 1st Floor : Signage

1st Floor 202

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 62.00 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Notes: Signage Vandalized at Time of Inspection.

Record Number 53143

Signage - 1st Floor : Signage

1st Floor 203

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 61.62 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52778



Signage : Highest Tactile Character Height

Signage : Highest Tactile Character Height



Signage - 1st Floor : Signage

1st Floor 203 from 201

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52649

Signage - 1st Floor : Signage

1st Floor 204

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53179



Signage : No Room Identification



Signage - 1st Floor : Signage

1st Floor 204 from 202

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52969

Signage - 1st Floor : Signage

1st Floor 213 from Financial Secretary

There is no room identification signage.

On-Site Finding None Found

Recommendation

Finding

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2



Signage : No Room Identification



Signage - 1st Floor : Signage

1st Floor 214

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52859

Signage - 1st Floor : Signage

1st Floor 214 Next to 213

There is no room identification signage.

On-Site Finding None Found

Recommendation

Finding

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2







Signage - 1st Floor : Signage

1st Floor 215

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 63.00 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52885

Signage - 1st Floor : Signage

1st Floor 221 Library

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 64.75 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 53841



Signage : Highest Tactile Character Height

Signage : Highest Tactile Character Height



Signage - 1st Floor : Signage

1st Floor 222

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 61.12 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 53619

Signage - 1st Floor : Signage

1st Floor 222 at Library

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 54086



Signage : Highest Tactile Character Height

Signage : No Room Identification



Signage - 1st Floor : Signage

1st Floor Administration Entrance

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53799

Signage - 1st Floor : Signage , Signage

1st Floor Administration Entrance - Door Bell

Signage , Signage : No Information Signage



There is no informational signage.

On-Site Finding Not Found

Recommendation

Install informational signage to each accessible element or room or location.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 216.3, 703.5





Signage - 1st Floor : Signage

1st Floor Conference Room Next to Administration Entrance

Signage: No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 54049

Signage - 1st Floor : Signage

1st Floor Financial Secretary

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 54038



Signage $\,:\,$ No Room Identification



Signage - 1st Floor : Signage

1st Floor Guidance Office

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53033

Signage - 1st Floor : Signage

1st Floor Hallway from 211 Next to 213

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2





Signage - 1st Floor : Signage

1st Floor Hallway Next to 216

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53918

Signage - 1st Floor : Signage

1st Floor Hallway Next to Guidance Office

There is no room identification signage.

On-Site Finding None Found

Recommendation

Finding

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52752



Signage : No Room Identification

Signage : No Room Identification



Signage - 1st Floor : Signage

1st Floor Library Reception

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53639

Signage - 1st Floor: Signage

1st Floor Main Entrance

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2





Restrooms - 1st Floor: Restroom, Dispensers

1st Floor Adult Restroom Next to Administration Feminine Products

Restroom , Dispensers : Dispenser Operation

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 39.5, ADA 309, 205, 309.4

Record Number 53902

Restrooms - 1st Floor: Restroom, Lavatory

1st Floor Adult Restroom Next to Administration

Lavatory

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 23.50 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.9.3, ADA 213, 606, 606.2,

306.3.1

Record Number 53903





Restroom , Lavatory : Lavatory Knee Clearance

Restrooms - 1st Floor: Restroom, Lavatory

1st Floor Adult Restroom Next to Administration Lavatory

Finding

There is not sufficient clear floor space provided to allow an accessible forward approach.

On-Site Finding 47.25 inches

Recommendation

Relocate the lavatory to provide clear floor space.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install new sink, faucet and handles \$2,261

Code Reference MA 6.4.1, ADA 213, 606, 606.2,

305.3

Record Number 53904

Restrooms - 1st Floor : Restroom , Lavatory

1st Floor Adult Restroom Next to Administration Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 53905

Restroom , Lavatory : Lavatory Clear Floor Space Length







Restrooms - 1st Floor : Restroom , Lavatory

1st Floor Adult Restroom Next to Administration Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap supply lines \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 53906

Restrooms - 1st Floor : Restroom , Wall Signage

1st Floor Adult Restroom Next to AdministrationWall Sign

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.8

Record Number 53907

Restroom , Lavatory : Lavatory - Supply Lines not wrapped





Restroom , Wall Signage : No Wall Signage

Restrooms - 1st Floor : Restroom , Toilet Compartment

1st Floor Adult Restroom Next to Administration

Restroom , Toilet Compartment : Toilet Paper Dispenser Distance From Seat

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 2.00 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.7.6, ADA 603, 604.7

Record Number 53966



Restrooms - 1st Floor : Restroom , Toilet Compartment

1st Floor Adult Restroom Next to Administration

Restroom , Toilet Compartment : Toilet Paper Dispenser Interferes with Grab Bar

Finding

The toilet paper dispenser interferes with the use of the grab bar.

On-Site Finding Interferes

Recommendation

Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.7.6, ADA 603, 609.3



Restrooms - 1st Floor: Restroom

1st Floor Adult Restroom Next to Administration

Restroom : No Door Privacy Lock and Occupied

Indicator

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Costing Info (Estimated)

Replace existing lock set with lever \$804 handled lock set

Code Reference ADA 213, 213.2.1

Notes: Lavatory Obstructs Turning Space Diameter.

Record Number 53900

Restrooms - 1st Floor: Restroom

1st Floor Adult Restroom Next to Administration

Restroom : Circular Turning Space Diameter

Finding

There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.

On-Site Finding 47.25 inches

Recommendation

Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install single-use toilet room \$14,000

Code Reference ADA 603, 304, 304.3.1, 603.2.1,

304.3

Notes: Lavatory Obstructs Turning Space Diameter.





Restrooms - 1st Floor : Restroom , Toilet Compartment

1st Floor Adult Restroom Next to Administration

Restroom , Toilet Compartment : No Coat Hook

Available

Finding

There is no required coat hook.

On-Site Finding None Found

Recommendation

Install a coat hook at the recommended height.

Recommendation See Recommendation

Costing Info (Estimated)

Install coat hook \$34

Code Reference MA 30.6.1,MA 30.6.2

Record Number 53964

Restrooms - 1st Floor : Restroom , Lavatory

1st Floor Boys Restroom Next to 215

Lavatory

Finding

The height of the counter surface of the lavatory designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 31.50 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation Up to 30.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.16.2, ADA 213, 606, 606.2

Record Number 52846



Restroom , Lavatory : Lavatory Surface Height



Restrooms - 1st Floor : Restroom , Lavatory

1st Floor Boys Restroom Next to 215 Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 52847

Restrooms - 1st Floor : Restroom , Lavatory

1st Floor Boys Restroom Next to 215 Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap supply lines \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 52848

Restroom , Lavatory : Lavatory Pipes Not Wrapped



Restroom , Lavatory : Lavatory - Supply Lines not wrapped



Restrooms - 1st Floor: Restroom, Dispensers

1st Floor Boys Restroom Next to 215

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 45.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 52844



Restroom , Dispensers : Dispenser Height

Restrooms - 1st Floor : Restroom , Dispensers

1st Floor Boys Restroom Next to 215Paper Towel

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 39.5, ADA 309, 205, 309.4

Record Number 52845



Restroom , Dispensers : Dispenser Operation

Restrooms - 1st Floor: Restroom, Dispensers

1st Floor Boys Restroom Next to 215

Soap

Restroom , Dispensers : Dispenser Height

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 43.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 52843

Restrooms - 1st Floor: Restroom, Mirror

1st Floor Boys Restroom Next to 215

Restroom , Mirror : Mirror Bottom Edge Height

Finding

The bottom edge of the reflective surface of the mirror in the restroom is is not at a compliant height for the primary age group.

On-Site Finding 38.37 inches

Recommendation

Lower the mirror in the restroom so that the bottom edge of the reflective surface is no higher than recommended above the finish floor.

Recommendation Up to 31.00 inches

Costing Info (Estimated)

Lower mirror \$291

Code Reference MA 30.18, ADA 603, 213, 603.3





Restrooms - 1st Floor: Restroom, Urinal

1st Floor Boys Restroom Next to 215

Restroom , Urinal : Urinal Rim Height

Finding

The height of the urinal rim in the restroom is greater than the allowed maximum height for use by the primary age group.

On-Site Finding 17.00 inches

Recommendation

Lower the urinal designated to be accessible in the restroom so that the rim height is not more than the allowed maximum height for use by the primary age group.

Recommendation Up to 15.00 inches

Costing Info (Estimated)

Lower urinal \$1,397

Code Reference MA 30.17.1, ADA 605, 605.2

Record Number 52850

Restrooms - 1st Floor : Restroom , Wall Signage

1st Floor Boys Restroom Next to 215

Wall Sign

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.


Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.8



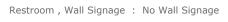



Restrooms - 1st Floor: Restroom, Toilet

1st Floor Boys Restroom Next to 215

Restroom , Toilet : Toilet Seat Height

Finding

The height of the toilet seat in the restroom is greater than the allowed maximum height for use by the primary age group.

On-Site Finding 18.00 inches

Recommendation

Adjust or modify the height of the toilet seat in the restroom to the required height for use by the primary age group.

Recommendation 11.00 - 17.00 inches

Costing Info (Estimated)

Modify fixture \$1,707

Code Reference MA 30.14.3, ADA 603, 604.9.3

Record Number 53012

Restrooms - 1st Floor : Restroom , Toilet

1st Floor Boys Restroom Next to 215

Finding

The distance from the center line of the toilet to the nearest side wall in the restroom is not at the required distance.

On-Site Finding 18.75 inches on center

Recommendation

Relocate the toilet to provide a distance from the center line of the toilet to the nearest side that meets the required distance for use by the primary age group.

Recommendation 11.00 - 18.00 inches on

center

Costing Info (Estimated)

Relocate fixture \$1,143

Code Reference MA 30.14.2, ADA 603, 604.9.1

Record Number 53013



Restroom , Toilet $\,:\,$ Toilet Distance From Wall



Restrooms - 1st Floor: Restroom, Toilet

1st Floor Boys Restroom Next to 215

Restroom , Toilet : Toilet Clear Floor Space

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 38.50 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 42.00 inches

Costing Info (Estimated)

Modify space \$3,500

Code Reference MA 30.6.1,MA 30.7.1, ADA 603

Record Number 53015

Restrooms - 1st Floor : Restroom , Grab Bars

1st Floor Boys Restroom Next to 215

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 52.00 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.


Recommendation At least 54.00 inches

Costing Info (Estimated)

Provide compliant grab bar \$267

Code Reference MA 30.8, ADA 603, 609, 604.5.1

Record Number 53016

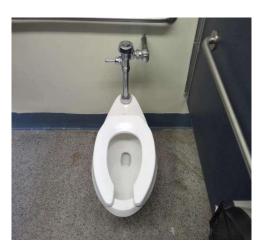

Restroom , Grab Bars $\,:\,$ Distance from Back Wall to Front of Grab Bar



Restrooms - 1st Floor : Restroom , Grab Bars

1st Floor Boys Restroom Next to 215

Restroom , Grab Bars : Side Grab Bar Height

Finding

The height of the side grab bar in the compartment designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 34.50 inches

Recommendation

Remount the side grab bar in the compartment designated to be accessible in the restroom at to the required height for use by the primary age group.

Recommendation 25.00 inches

Costing Info (Estimated)

Adjust grab bar height \$78

Code Reference MA 30.15.1, ADA 609, 604.9, 609.4

Record Number 53017

Restrooms - 1st Floor : Restroom , Grab Bars

1st Floor Boys Restroom Next to 215

Restroom , Grab Bars : Restroom - Grab Bar Height

Finding

The grab bar on the rear wall is not at the correct height.

On-Site Finding 34.50 inches

Recommendation

Remount the rear grab bar in the compartment designated to be accessible so the height of the gripping surface is at the correct height.

Recommendation 20.00 - 25.00 inches

Costing Info (Estimated)

Provide compliant grab bars \$231 **Code Reference** ADA 213, 604, 604.9



Restrooms - 1st Floor: Restroom, Compartment Door

1st Floor Boys Restroom Next to 215

Restroom , Compartment Door : Compartment Door Handle

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Costing Info (Estimated)

Install accessible handle on stall door \$250

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 604.8.1.2, 604.8

Record Number 53019

Restrooms - 1st Floor: Restroom

1st Floor Boys Restroom Next to 215

Finding

The compartment door is located in front of the water closet.

On-Site Finding Not Located

Recommendation

Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.

Recommendation See Recommendation

Costing Info (Estimated)

\$4,000

Code Reference ADA 604.8.1.2







Restrooms - 1st Floor : Restroom , Compartment Door

1st Floor Boys Restroom Next to 215

Finding

The door to the compartment swings inward into the minimum required compartment area.

On-Site Finding Swings In

Recommendation

Modify the swing of the door so that it does not swing into the minimum required compartment area.

Recommendation See Recommendation

Costing Info (Estimated)

Modify door swing \$269

Code Reference MA 30.6.1, MA 30.6.2, ADA 603,

604.8, 304.4

Record Number 53021



1st Floor Boys Restroom Next to 215

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Finding

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

604.8.1.2, 604.8

Record Number 53022

Restroom , Compartment Door : Compartment Door Swings In





Restroom, Compartment Door: Compartment

Restrooms - 1st Floor: Restroom, Compartment Door

1st Floor Boys Restroom Next to 215

Finding

The compartment door hardware is not at a compliant height.

On-Site Finding 41.50 inches

Recommendation

Remove and relocate the door hardware.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 404.2.7, 604.8

Record Number 53023



1st Floor Boys Restroom Next to 215

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 54.00 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 16.00 - 36.00 inches

Costing Info (Estimated)

Move coat hook \$50

Code Reference MA 30.20, ADA 308, 308.1

Record Number 53024

Restroom , Compartment Door : Compartment Door Handle Height







Restrooms - 1st Floor : Restroom , Toilet Compartment

1st Floor Boys Restroom Next to 215

Finding

The location of the toilet paper dispenser in the restroom primarily used by children is not within recommended values of the front edge of the toilet seat.

On-Site Finding 4.00 inches

Recommendation

Remount the toilet paper dispenser in the restroom so that it is within the recommended values from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.14.5, ADA 603, 604.9.6

Record Number 53025

Restrooms - 1st Floor : Restroom , Toilet Compartment

1st Floor Boys Restroom Next to 215

Finding

The toilet paper dispenser interferes with the use of the grab bar.

On-Site Finding Interferes

Recommendation

Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277 **Code Reference** MA 30.7.6, ADA 603, 609.3

Record Number 53026

Restroom , Toilet Compartment : Toilet Paper Dispenser Distance From Seat



Restroom , Toilet Compartment : Toilet Paper Dispenser Interferes with Grab Bar $\,$



Restrooms - 1st Floor : Restroom , Toilet Compartment

1st Floor Boys Restroom Next to 215

Restroom , Toilet Compartment : Toilet Compartment Length

Finding

There is insufficient clear floor space in the compartment.

On-Site Finding 71.50 inches

Recommendation

Modify or replace the compartment to provide adequate clear floor space.

Recommendation At least 72.00 inches

Costing Info (Estimated)

Install accessible stall \$4,000

Code Reference MA 30.6.1, ADA 603, 213, 604,

604.8.1.1

Record Number 53011



1st Floor Girls Restroom Next to 204 Lavatory

Finding

The height of the counter surface of the lavatory designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 31.12 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation Up to 30.00 inches


Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.16.2, ADA 213, 606, 606.2

Record Number 52763



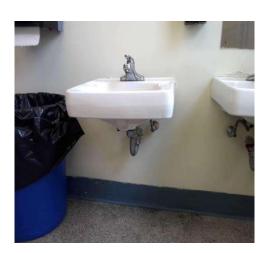

Restroom , Lavatory : Lavatory Surface Height

Restrooms - 1st Floor : Restroom , Lavatory

1st Floor Girls Restroom Next to 204 Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 52764

Restrooms - 1st Floor : Restroom , Lavatory

1st Floor Girls Restroom Next to 204 Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap supply lines \$149


Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 52765

Restroom , Lavatory : Lavatory Pipes Not Wrapped



Restroom , Lavatory : Lavatory - Supply Lines not wrapped

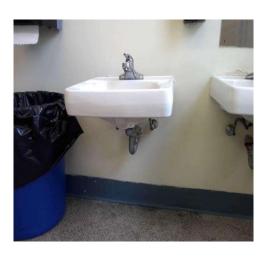

Restrooms - 1st Floor : Restroom , Dispensers

1st Floor Girls Restroom Next to 204

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 44.50 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 52761



Restroom , Dispensers : Dispenser Height

Restrooms - 1st Floor : Restroom , Dispensers

1st Floor Girls Restroom Next to 204Paper Towel

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 39.5, ADA 309, 205, 309.4

Record Number 52762



Restroom , Dispensers : Dispenser Operation

Restrooms - 1st Floor: Restroom, Dispensers

1st Floor Girls Restroom Next to 204

Soap

Restroom , Dispensers : Dispenser Height

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 43.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 52760

Restrooms - 1st Floor : Restroom , Mirror

1st Floor Girls Restroom Next to 204

Restroom , Mirror : Mirror Bottom Edge Height

Finding

The bottom edge of the reflective surface of the mirror in the restroom is is not at a compliant height for the primary age group.

On-Site Finding 37.25 inches

Recommendation

Lower the mirror in the restroom so that the bottom edge of the reflective surface is no higher than recommended above the finish floor.

Recommendation Up to 31.00 inches

Costing Info (Estimated)

Lower mirror \$291

Code Reference MA 30.18, ADA 603, 213, 603.3



Restrooms - 1st Floor: Restroom, Toilet

1st Floor Girls Restroom Next to 204

Restroom , Toilet : Toilet Seat Height

Finding

The height of the toilet seat in the restroom is greater than the allowed maximum height for use by the primary age group.

On-Site Finding 18.00 inches

Recommendation

Adjust or modify the height of the toilet seat in the restroom to the required height for use by the primary age group.

Recommendation 11.00 - 17.00 inches

Costing Info (Estimated)

Modify fixture \$1,707

Code Reference MA 30.14.3, ADA 603, 604.9.3

Record Number 52992

Restrooms - 1st Floor : Restroom , Toilet

1st Floor Girls Restroom Next to 204

Restroom , Toilet : Toilet Distance From Wall

Finding

The distance from the center line of the toilet to the nearest side wall in the restroom is not at the required distance.

On-Site Finding 18.50 inches on center

Recommendation

Relocate the toilet to provide a distance from the center line of the toilet to the nearest side that meets the required distance for use by the primary age group.

Recommendation 11.00 - 18.00 inches on

center

Costing Info (Estimated)

Relocate fixture \$1,143

Code Reference MA 30.14.2, ADA 603, 604.9.1





Restrooms - 1st Floor: Restroom, Toilet

1st Floor Girls Restroom Next to 204

Finding

The flush control on the toilet is not on the wide (approach) side of the toilet.

On-Site Finding Wrong Side of Toilet

Recommendation

Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be handoperated or automatic mechanisms.

Recommendation See Recommendation

Costing Info (Estimated)

Relocate flush valve \$127

Code Reference MA 30.7.5, ADA 603, 604.6

Record Number 52995

Restrooms - 1st Floor : Restroom , Toilet

1st Floor Girls Restroom Next to 204

There is less than the required minimum space in front of the toilet.

On-Site Finding 40.00 inches

Recommendation

Finding

Create the required minimum clear space in front of the toilet.

Recommendation At least 42,00 inches

Costing Info (Estimated)

Modify space \$3,500

Code Reference MA 30.6.1, MA 30.7.1, ADA 603

Record Number 52996 Restroom , Toilet : Toilet Flush Control not on Wide Side





Restroom , Toilet : Toilet Clear Floor Space



Restrooms - 1st Floor : Restroom , Grab Bars

1st Floor Girls Restroom Next to 204

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 49.50 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Costing Info (Estimated)

Provide compliant grab bar \$267

Code Reference MA 30.8, ADA 603, 609, 604.5.1

Record Number 52997

Restrooms - 1st Floor: Restroom, Grab Bars

1st Floor Girls Restroom Next to 204

Finding

The height of the side grab bar in the compartment designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 35.25 inches

Recommendation

Remount the side grab bar in the compartment designated to be accessible in the restroom at to the required height for use by the primary age group.

Recommendation 25.00 inches

Costing Info (Estimated)

Adjust grab bar height \$78

Code Reference MA 30.15.1, ADA 609, 604.9, 609.4

Record Number 52998

Restroom , Grab Bars : Distance from Back Wall to Front of Grab Bar







Restroom , Grab Bars : Side Grab Bar Height

Restrooms - 1st Floor: Restroom, Grab Bars

1st Floor Girls Restroom Next to 204

Restroom , Grab Bars : Restroom - Grab Bar Height

Finding

The grab bar on the rear wall is not at the correct height.

On-Site Finding 35.00 inches

Recommendation

Remount the rear grab bar in the compartment designated to be accessible so the height of the gripping surface is at the correct height.

Recommendation 20.00 - 25.00 inches

Costing Info (Estimated)

Provide compliant grab bars \$231 **Code Reference** ADA 213, 604, 604.9

Record Number 52999



Restrooms - 1st Floor : Restroom , Compartment Door

1st Floor Girls Restroom Next to 204

Restroom , Compartment Door : Compartment Door Handle

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Costing Info (Estimated)

Install accessible handle on stall door \$250

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 604.8.1.2, 604.8



Restrooms - 1st Floor: Restroom

1st Floor Girls Restroom Next to 204

Restroom: Toilet Compartment Door

Finding

The compartment door is located in front of the water closet.

On-Site Finding Not Located

Recommendation

Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.

Recommendation See Recommendation

Costing Info (Estimated)

\$4,000

Restrooms - 1st Floor: Restroom, Compartment Door

Code Reference ADA 604.8.1.2

Record Number 53001

1st Floor Girls Restroom Next to 204

Finding

The door to the compartment swings inward into the minimum required compartment area.

On-Site Finding Swings In

Recommendation

Modify the swing of the door so that it does not swing into the minimum required compartment area.

Recommendation See Recommendation

Costing Info (Estimated)

Modify door swing \$269

Code Reference MA 30.6.1, MA 30.6.2, ADA 603,

604.8, 304.4

Record Number 53002





Restroom , Compartment Door : Compartment

Door Swings In

Restrooms - 1st Floor : Restroom , Compartment Door

1st Floor Girls Restroom Next to 204

Restroom , Compartment Door : Compartment Door

Finding

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

604.8.1.2, 604.8

Record Number 53003

Restrooms - 1st Floor: Restroom, Compartment Door

1st Floor Girls Restroom Next to 204

Finding

The compartment door hardware is not at a compliant height.

On-Site Finding 41.25 inches

Recommendation

Remove and relocate the door hardware.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 404.2.7, 604.8







Restrooms - 1st Floor : Restroom , Toilet Compartment

1st Floor Girls Restroom Next to 204

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 54.25 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 16.00 - 36.00 inches

Costing Info (Estimated)

Move coat hook \$50

Code Reference MA 30.20, ADA 308, 308.1

Record Number 53005

 $\mbox{Restroom , Toilet Compartment} \ : \ \mbox{Coat Hook} \ \mbox{Height}$



Restrooms - 1st Floor : Restroom , Toilet Compartment

1st Floor Girls Restroom Next to 204

Finding

The location of the toilet paper dispenser in the restroom primarily used by children is not within recommended values of the front edge of the toilet seat.

On-Site Finding 3.00 inches

Recommendation

Remount the toilet paper dispenser in the restroom so that it is within the recommended values from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches


Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.14.5, ADA 603, 604.9.6

Record Number 53006

Restroom , Toilet Compartment : Toilet Paper Dispenser Distance From Seat

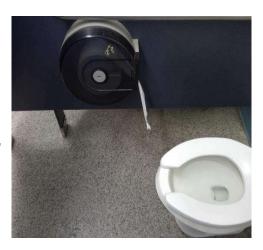

Restrooms - 1st Floor : Restroom , Lavatory

1st Floor Staff Unisex Restroom Next to 215Lavatory

Restroom , Lavatory : Lavatory Control Type

Finding

The faucet controls on the lavatory require tight grasping, pinching, or twisting of the wrist and are not accessible.

On-Site Finding Not Accessible

Recommendation

Install accessible faucet controls. Lever-operated, pushtype, touch-type or electronically controlled mechanisms are acceptable elements. If self-closing valves are used the faucet shall remain open for at least 10 seconds.

Recommendation See Recommendation

Costing Info (Estimated)

Replace knob faucets with paddle \$392

faucets

Code Reference MA 30.9.6, ADA 213, 606, 309.4

Record Number 52806

Restrooms - 1st Floor : Restroom , Lavatory

1st Floor Staff Unisex Restroom Next to 215Lavatory

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 22.75 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.9.3, ADA 213, 606, 606.2,

306.3.1

Record Number 52807



Restroom , Lavatory : Lavatory Knee Clearance



Restrooms - 1st Floor : Restroom , Lavatory

1st Floor Staff Unisex Restroom Next to 215Lavatory

Finding

There is not sufficient clear floor space provided to allow an accessible forward approach.

On-Site Finding 27.00 inches

Recommendation

Relocate the lavatory to provide clear floor space.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install new sink, faucet and handles \$2,261

Code Reference MA 6.4.1, ADA 213, 606, 606.2,

305.3

Record Number 52808

Restrooms - 1st Floor : Restroom , Lavatory

1st Floor Staff Unisex Restroom Next to 215 Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 52809

Restroom , Lavatory : Lavatory Clear Floor Space Length



Restroom , Lavatory : Lavatory Pipes Not Wrapped



Restrooms - 1st Floor : Restroom , Lavatory

1st Floor Staff Unisex Restroom Next to 215Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap supply lines \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 52810

Restrooms - 1st Floor : Restroom , Dispensers

1st Floor Staff Unisex Restroom Next to 215

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 53.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation 15.00 - 48.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 6.5, ADA 309, 205, 308, 606,

308.1

Record Number 52803

Restroom , Lavatory : Lavatory - Supply Lines not wrapped





Restroom , Dispensers : Dispenser Height

Restrooms - 1st Floor : Restroom , Dispensers

1st Floor Staff Unisex Restroom Next to 215 **Paper Towel**

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 39.5, ADA 309, 205, 309.4

Record Number 52804



Restroom , Dispensers : Dispenser Operation

Restrooms - 1st Floor : Restroom , Dispensers

1st Floor Staff Unisex Restroom Next to 215Soap

Restroom , Dispensers : Dispenser Operation

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 39.5, ADA 309, 205, 309.4



Restrooms - 1st Floor: Restroom, Mirror

1st Floor Staff Unisex Restroom Next to 215

Restroom , Mirror : Mirror Bottom Edge Height

Finding

The bottom edge of the reflective surface of the mirror is not at the correct height.

On-Site Finding 56.37 inches

Recommendation

Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.

Recommendation Up to 40.00 inches

Costing Info (Estimated)

Lower mirror \$300

Code Reference MA 30.11, ADA 603, 213, 603.3

Record Number 52811

Restrooms - 1st Floor: Restroom, Wall Signage

1st Floor Staff Unisex Restroom Next to 215 Wall Sign

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.8

Record Number 52812





Restroom , Wall Signage : No Wall Signage

Restrooms - 1st Floor : Restroom , Toilet

1st Floor Staff Unisex Restroom Next to 215

Restroom , Toilet : Toilet Distance From Wall

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 14.50 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 16.00 - 18.00 inches

Costing Info (Estimated)

Relocate fixture \$2,500 **Code Reference** MA 30.7.2, ADA 603, 604.2

Record Number 52921

Restrooms - 1st Floor: Restroom, Toilet

1st Floor Staff Unisex Restroom Next to 215

Restroom , Toilet : Toilet Seat Height



The height of the toilet seat is not at the required height.

On-Site Finding 14.75 inches


Recommendation

Adjust or modify the toilet so the seat height is at the required accessible height.

Recommendation 17.00 - 19.00 inches

Costing Info (Estimated)

Modify fixture \$1,707 **Code Reference** MA 30.7.3, ADA 603, 604.4

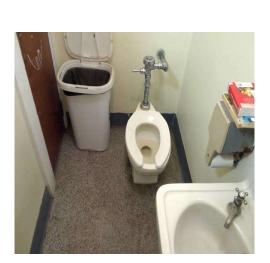

Restrooms - 1st Floor : Restroom , Toilet

1st Floor Staff Unisex Restroom Next to 215

Restroom , Toilet : Toilet Minimum Distance From Any fixture

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 31.25 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Costing Info (Estimated)

Relocate fixture \$2,500 **Code Reference** MA 30.7.2, ADA 603, 604.2

Record Number 52924



Restrooms - 1st Floor : Restroom , Toilet Compartment

1st Floor Staff Unisex Restroom Next to 215

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 68.75 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 15.00 - 48.00 inches

Costing Info (Estimated)

Move coat hook \$50

Code Reference MA 30.6.1, MA 30.6.2, ADA 308,

603.4, 308.1

Record Number 52925



Restroom , Toilet Compartment : Coat Hook

Height

Restrooms - 1st Floor : Restroom , Toilet Compartment

1st Floor Staff Unisex Restroom Next to 215

Restroom , Toilet Compartment : Toilet Paper Dispenser Distance From Seat

Finding

The location of the toilet paper dispenser is not within the required distance from the front edge of the toilet seat.

On-Site Finding 10.00 inches

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and shall not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.7.6, ADA 603, 604.7

Record Number 52926

Restrooms - 1st Floor: Restroom

1st Floor Staff Unisex Restroom Next to 215

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Costing Info (Estimated)

Replace existing lock set with lever \$804 handled lock set

Code Reference ADA 213, 213.2.1

Record Number 52801



 $\mbox{Restroom} \quad : \quad \mbox{No Door Privacy Lock and Occupied } \\ \mbox{Indicator} \quad$



Restrooms - 1st Floor: Restroom

1st Floor Staff Unisex Restroom Next to 215

Restroom : Circular Turning Space Diameter

Finding

There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.

On-Site Finding 27.00 inches

Recommendation

Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install single-use toilet room \$14,000

Code Reference ADA 603, 304, 304.3.1, 603.2.1,

304.3

Record Number 52802



Restrooms - 1st Floor : Restroom , Toilet Compartment

1st Floor Staff Unisex Restroom Next to 215

Restroom , Toilet Compartment : Toilet Clear Floor Space Width

Finding

There is not a minimum of 60 inches of clearance around the water closet measured perpendicular from the side wall.

On-Site Finding 45.50 inches

Recommendation

Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Modify fixture \$1,707 **Code Reference** ADA 603, 502.4, 604.3.1



Restrooms - 1st Floor: Restroom, Grab Bars

1st Floor Staff Unisex Restroom Next to 215

Restroom , Grab Bars : No Grab Bars

Finding

There are no grab bars.

On-Site Finding None Found

Recommendation

Install the required grab bars in the toilet compartment.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant grab bar \$267

Code Reference MA 30.8, ADA 603, 609, 604.5

Record Number 52920

Restrooms - 1st Floor: Restroom, Lavatory

1st Floor Unisex Restroom in 214

Lavatory

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 22.50 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.9.3, ADA 213, 606, 606.2,

306.3.1

Record Number 52656



Restroom , Lavatory : Lavatory Knee Clearance



Restrooms - 1st Floor : Restroom , Lavatory

1st Floor Unisex Restroom in 214 Lavatory

Finding

There is not sufficient clear floor space provided to allow an accessible forward approach.

On-Site Finding 47.00 inches

Recommendation

Relocate the lavatory to provide clear floor space.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install new sink, faucet and handles \$2,261

Code Reference MA 6.4.1, ADA 213, 606, 606.2,

305.3

Record Number 52657

Restrooms - 1st Floor: Restroom, Toilet

1st Floor Unisex Restroom in 214

Finding

The distance from the center of the toilet to the nearest side wall does not meet the required distance.

On-Site Finding 18.50 inches on center

Recommendation

Relocate the toilet so the distance from the center line of the toilet to the nearest side wall meets the required distance.

Recommendation 16.00 - 18.00 inches

Costing Info (Estimated)

Relocate fixture \$2,500 **Code Reference** MA 30.7.2, ADA 603, 604.2

Record Number 53008

Restroom , Lavatory : Lavatory Clear Floor Space Length



 $Restroom\ ,\ Toilet\ :\ Toilet\ Distance\ From\ Wall$



Restrooms - 1st Floor : Restroom , Toilet Compartment

1st Floor Unisex Restroom in 214

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 63.00 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 15.00 - 48.00 inches

Costing Info (Estimated)

Move coat hook \$50

Code Reference MA 30.6.1, MA 30.6.2, ADA 308,

603.4, 308.1

Record Number 53010

Restrooms - 1st Floor: Restroom

1st Floor Unisex Restroom in 214

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Costing Info (Estimated)

Replace existing lock set with lever \$804 handled lock set

Code Reference ADA 213, 213.2.1

Notes: Lavatory Obstructs Turning Space Diameter.

Record Number 52654

Restroom , Toilet Compartment : Coat Hook Height



Restroom $\,:\,$ No Door Privacy Lock and Occupied Indicator



Restrooms - 1st Floor: Restroom

1st Floor Unisex Restroom in 214

Restroom : Circular Turning Space Diameter

Finding

There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.

On-Site Finding 47.00 inches

Recommendation

Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install single-use toilet room \$14,000

Code Reference ADA 603, 304, 304.3.1, 603.2.1,

304.3

Notes: Lavatory Obstructs Turning Space Diameter.

Record Number 52655



Drinking Fountains - 1st Floor: Drinking Fountain

Drinking Fountain Next to 1st Floor Boys Restroom

Drinking Fountain : Alcove Depth

Finding

The drinking fountain protrudes more than 4 inches outside of the alcove.

On-Site Finding See Above

Recommendation

Provide an alcove that will contain the entire depth of the drinking fountain.

Recommendation See Recommendation

Costing Info (Estimated)

Install wing walls or relocate object \$640

Code Reference MA 6.4.2, ADA 305, 307.2, 602.1



Libraries - 1st Floor : Library , Checkout Counter

Library

Checkout

Finding

The height of the checkout counter is greater than 30 inches for use primarily by children.

On-Site Finding 34.00 inches

Recommendation

Make sure a portion of the counter is within compliant height ranges to accommodate age group requirements for children.

Recommendation 26.00 - 30.00 inches

Costing Info (Estimated)

Provide compliant counter \$545 **Code Reference** ADA 904, 227, 902.4.2

Record Number 53885

Library , Checkout Counter : Check Out Counter Height



Libraries - 1st Floor : Library , Computer Station

Library

Computer Station

Finding

The knee clearance height at the computer station for use primarily by children is not compliant.

On-Site Finding 23.75 inches

Recommendation

Provide a compliant computer station for use primarily by children.

Recommendation At least 24.00 inches

Costing Info (Estimated)

Adjust/Replace Table \$174

Code Reference ADA 403, 306, 902, 226, 221, 225,

902.4.1

Record Number 53886

Library , Computer Station : Computer Station Knee Clearance



Libraries - 1st Floor : Library , Aisles

Library

End/Side

Finding

The width of side and end aisles is less than 36 inches.

On-Site Finding 32.00 inches

Recommendation

Move the book stacks to provide the required access width between the aisles.

Recommendation At least 36.00 inches

Costing Info (Estimated)

Provide compliant shelves \$1,080

Code Reference MA 12.2.6, ADA 403, 403.5.1

Record Number 53884



Library , Aisles : End Aisle Width

Break/Conference Room - 1st Floor : Break Room

1st Floor Conference Room Next to Administration EntranceTable

Break Room : Tables - Knee Depth

Finding

The table knee depth does not meet required standards.

On-Site Finding 14.50 inches

Recommendation

Provide compliant tables.

Recommendation At least 19.00 inches

Costing Info (Estimated)

Provide compliant seating \$2,174

Code Reference ADA 309, 205, 308, 228, 306.3.3



Sinks - 1st Floor: Sink

1st Floor Sink in Library

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Record Number 53796

Sinks - 1st Floor : Sink

1st Floor Sink in Library

Finding

The toe kick for the sink is not removed.

On-Site Finding Toe Kick Exists

Recommendation

Make sure there is no toe kick at the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Remove toe kick \$420

Code Reference ADA 305, 306, 606.2

Record Number 53797



Sink : Pipes not Wrapped

Sink : Toe Kick Not Removed



Sinks - 1st Floor: Sink

1st Floor Sink in Library

Sink : Supply Lines

Finding

Supply lines are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Record Number 53798



Reach Ranges - 1st Floor : Reach Range , Element Highest Point of Operation

1st Floor Next to Administration Entrance

Door Bell - Other

Finding

The highest point of operation for the element is not compliant.

On-Site Finding 55.00 inches

Recommendation

Make sure that the highest point of operation is within the recommended value.

Recommendation 15.00 - 48.00 inches

Costing Info (Estimated)

Readjust element height \$50

Code Reference ADA 309, 308

Record Number 53917

Reach Range , Element Highest Point of Operation : Element Highest Point of Operation



Doors - 2nd Floor : Door , Hardware

2nd Floor 301

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 53776

Doors - 2nd Floor : Door , Hardware

2nd Floor 302

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 52894

Door, Hardware: Door Lock







Doors - 2nd Floor : Door , Hardware

2nd Floor 302 from 304

Lever

Door , Hardware : Door Lock

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52841

Doors - 2nd Floor : Door , Hardware

2nd Floor 303

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 53898



 ${\tt Door\ ,\ Hardware\ :\ Door\ Lock}$



Doors - 2nd Floor : Door , Hardware

2nd Floor 303 from 301

Lever

Door , Hardware : Door Lock

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 53961

53961

Doors - 2nd Floor: Door, Latch Side Clearance

2nd Floor 303 from 301

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 3.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Shelf Obstructs Clear Floor Space Length.

Record Number 53962





Doors - 2nd Floor: Door, Clear Floor Space

2nd Floor 303 from 301

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 37.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Shelf Obstructs Clear Floor Space Length.

Record Number 53963

Doors - 2nd Floor : Door , Hardware

2nd Floor 304

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 53075

Door , Clear Floor Space : Front Approach Clear Floor Space Length



Door , Hardware : Door Lock



Doors - 2nd Floor : Door , Hardware Height

2nd Floor 304 from 308

Lever

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 57.25 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 48.00 inches

Costing Info (Estimated)

Replace door hardware \$280

Code Reference ADA 404, 404.2.7

Record Number 52861

Doors - 2nd Floor : Door , Hardware

2nd Floor 304 from 308

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 52862

Door , Hardware Height : Height



 $\hbox{Door , Hardware }: \hbox{ Door Lock}$



Doors - 2nd Floor: Door, Clear Floor Space

2nd Floor 304 from 308

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 4.25 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Cabinet Obstructs Clear Floor Space Length.

Record Number 52863

Doors - 2nd Floor : Door , Hardware

2nd Floor 308

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310


Code Reference ADA 404.2.7, 309.4

Record Number 52814

Door , Clear Floor Space : Front Approach Clear Floor Space Length



Door , Hardware : Door Lock

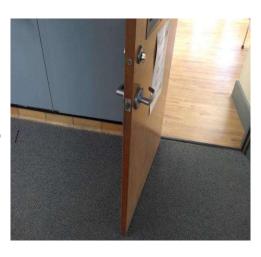

Doors - 2nd Floor : Door , Hardware

2nd Floor 309

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52661

Doors - 2nd Floor : Door , Hardware

2nd Floor 311

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 52940

Door, Hardware: Door Lock







Doors - 2nd Floor : Door , Hardware

2nd Floor 312

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 52640

Doors - 2nd Floor : Door , Hardware

2nd Floor 312

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation


Costing Info (Estimated)

Provide door lock \$310


Code Reference ADA 404.2.7, 309.4

Record Number 52641

Door, Hardware: Door Opening Pressure

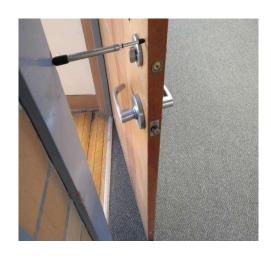



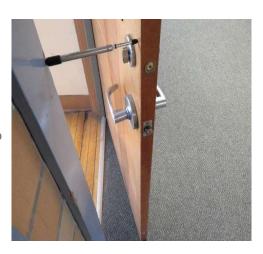

Doors - 2nd Floor: Door, Latch Side Clearance

2nd Floor 312

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 3.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** ADA 404, 404.2.4, 404.2.4.1

Record Number 52642

Doors - 2nd Floor : Door , Hardware Height

2nd Floor 312 Office

Lever

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 49.00 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 48.00 inches


Costing Info (Estimated)

Replace door hardware \$280

Code Reference ADA 404, 404.2.7

Record Number 52650

Door , Latch Side Clearance : Front Approach Latch Side Clearance

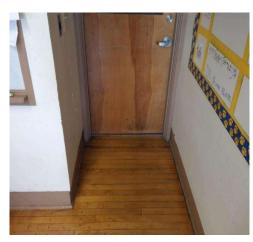





Doors - 2nd Floor : Door , Hardware

2nd Floor 312 Office

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52651

Doors - 2nd Floor : Door , Hardware

2nd Floor 313

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310


Code Reference ADA 404.2.7, 309.4

Record Number 53715

Door, Hardware: Door Lock



 ${\sf Door}\;,\,{\sf Hardware}\;:\;{\sf Door}\;{\sf Lock}$

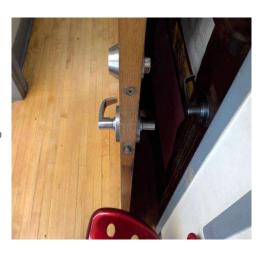

Doors - 2nd Floor: Door, Latch Side Clearance

2nd Floor 313

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 5.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** ADA 404, 404.2.4, 404.2.4.1

Record Number 53716

Doors - 2nd Floor : Door , Hardware

2nd Floor 314

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 53040

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Door , Hardware : Door Lock



Doors - 2nd Floor: Door, Latch Side Clearance

2nd Floor 314

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 14.75 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53042

Doors - 2nd Floor : Door , Latch Side Clearance

2nd Floor 314

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 4.50 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** ADA 404, 404.2.4, 404.2.4.1

Record Number 53041

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - 2nd Floor: Door, Clear Floor Space

2nd Floor 314

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 32.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53043

Doors - 2nd Floor : Door , Hardware

2nd Floor 315

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 54050

Door , Clear Floor Space : Front Approach Clear Floor Space Length



Door , Hardware : Door Lock



Doors - 2nd Floor: Door, Threshold

2nd Floor 315

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.75 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Provide smooth transition \$436

Code Reference MA 26.10, ADA 404, 404.2.5

Record Number 54051

Doors - 2nd Floor : Door , Hardware

2nd Floor 316

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310


Code Reference ADA 404.2.7, 309.4

Record Number 53924



Door , Threshold : Door Threshold



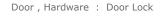



Doors - 2nd Floor: Door, Threshold

2nd Floor 316

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.75 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Provide smooth transition \$436

Code Reference MA 26.10, ADA 404, 404.2.5

Record Number 53925

Doors - 2nd Floor : Door , Hardware

2nd Floor 318

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 11.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 53068









Doors - 2nd Floor : Door , Hardware

2nd Floor 318

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 53069

Doors - 2nd Floor: Door

2nd Floor 318

Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)

Remove door stop \$50

Code Reference ADA 404, 404.2.10

Record Number 53070

Door , Hardware : Door Lock



Door : Door Hardware



Doors - 2nd Floor: Door, Latch Side Clearance

2nd Floor 318

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 4.50 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921

Code Reference ADA 404, 404.2.4, 404.2.4.1

Notes: Shelf Obstructs Latch Side Clearance.

Record Number 53071

Doors - 2nd Floor : Door , Hardware

2nd Floor 319

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 52790

Door , Latch Side Clearance : Front Approach Latch Side Clearance







Doors - 2nd Floor: Door

2nd Floor 319

Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)

Remove door stop \$50

Code Reference ADA 404, 404.2.10

Record Number 52791

Doors - 2nd Floor: Door, Latch Side Clearance

2nd Floor 319 Lab

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 9.25 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Refrigerator Obstructs Latch Side Clearance.

Record Number 52726

Door : Door Hardware







Doors - 2nd Floor: Door, Latch Side Clearance

2nd Floor Boys Restroom

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 8.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53873

Doors - 2nd Floor : Door , Hardware

2nd Floor Boys Restroom

Push / Pull

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 53871

Door , Latch Side Clearance : Front Approach Latch Side Clearance







Doors - 2nd Floor : Door , Hardware

2nd Floor Boys Restroom

Push / Pull

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 53872

Doors - 2nd Floor: Door, Latch Side Clearance

2nd Floor Girls Restroom

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 9.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53891

Door, Hardware: Door Lock







Doors - 2nd Floor : Door , Hardware

2nd Floor Girls Restroom

Push / Pull

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 53888

Doors - 2nd Floor : Door , Hardware Height

2nd Floor Girls Restroom

Push / Pull

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 49.50 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 48.00 inches

Costing Info (Estimated)

Replace door hardware \$280

Code Reference ADA 404, 404.2.7

Record Number 53889









Doors - 2nd Floor : Door , Hardware

2nd Floor Girls Restroom

Push / Pull

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 53890

Doors - 2nd Floor : Door , Hardware

2nd Floor Hallway Next to 302

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 53933

Door, Hardware: Door Lock







Doors - 2nd Floor : Door , Hardware

2nd Floor Hallway Next to 302

Push Bar / Lever

Door, Hardware: Bottom Door Panel

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 53934



2nd Floor Hallway Next to 313

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.


Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 54087

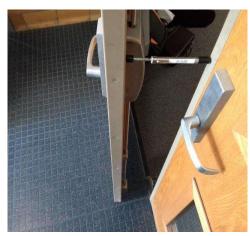

Door , Hardware : Door Opening Pressure



Doors - 2nd Floor : Door , Hardware

2nd Floor Hallway Next to 313

Push Bar / Lever

Door, Hardware: Bottom Door Panel

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.


Recommendation See Recommendation

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 54088

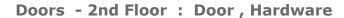

2nd Floor Hallway Next to 317

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 11.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)


Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 53711



Door , Hardware : Door Opening Pressure

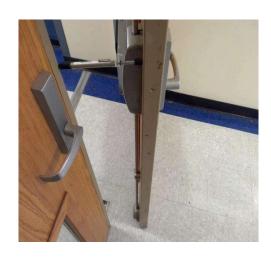

Doors - 2nd Floor : Door , Hardware

2nd Floor Hallway Next to 317

Push Bar / Lever

Door, Hardware: Bottom Door Panel

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 53712

Doors - 2nd Floor : Door , Hardware

2nd Floor Staff Unisex Restroom

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 53728



Door , Hardware : Door Lock



Doors - 2nd Floor: Door, Latch Side Clearance

2nd Floor Staff Unisex Restroom Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 13.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53729

Doors - 2nd Floor : Door , Clear Floor Space

2nd Floor Staff Unisex Restroom Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 51.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53730

Door , Latch Side Clearance : Front Approach Latch Side Clearance



 $\label{eq:continuous} \mbox{Door , Clear Floor Space} \ : \ \mbox{Front Approach Clear Floor Space Length}$



Doors - 2nd Floor: Door

2nd Floor Staff Unisex Restroom

Door : Door Opening Width

Finding

The clear opening width of the door is less than required.

On-Site Finding 29.25 inches

Recommendation

Widen the door opening and install a door that provides at least the minimum clear width with the door open 90 degrees.

Recommendation At least 32.00 inches

Costing Info (Estimated)

Widen existing door and add \$1,750

accessible hardware

Code Reference MA 26.5, ADA 404, 404.2.3

Record Number 53727

Signage - 2nd Floor: Signage

2nd Floor 301

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 63.00 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 53795







Signage - 2nd Floor: Signage

2nd Floor 302

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 61.75 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52825

Signage - 2nd Floor : Signage

2nd Floor 302 from 304

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52860



Signage : Highest Tactile Character Height

Signage : No Room Identification



Signage - 2nd Floor: Signage

2nd Floor 303

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 60.37 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 54064

Signage - 2nd Floor: Signage

2nd Floor 303 from 301

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 54048



Signage : Highest Tactile Character Height





Signage : No Room Identification

Signage - 2nd Floor: Signage

2nd Floor 304

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 63.25 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 53039

Signage - 2nd Floor: Signage

2nd Floor 304 from 308

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53131



Signage : Highest Tactile Character Height





Signage - 2nd Floor: Signage

2nd Floor 309

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 62.12 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52713

Signage - 2nd Floor: Signage

2nd Floor 311

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52797



Signage : Highest Tactile Character Height

Signage $\,:\,$ No Room Identification



Signage - 2nd Floor: Signage

2nd Floor 311 Office

Signage : Highest Tactile Character Height

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 60.25 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52944

Signage - 2nd Floor: Signage

2nd Floor 312

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52674





Signage - 2nd Floor: Signage

2nd Floor 312 Office

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52795

Signage - 2nd Floor: Signage

2nd Floor 313 Open Doorway

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 62.50 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 53128



Signage : Highest Tactile Character Height



Signage - 2nd Floor: Signage

2nd Floor 314 Open Doorway

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 61.62 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52866

Signage - 2nd Floor : Signage

2nd Floor 318

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 61.00 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52770



Signage : Highest Tactile Character Height

Signage : Highest Tactile Character Height



Signage - 2nd Floor: Signage

2nd Floor 318 Lab

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53007

Signage - 2nd Floor: Signage

2nd Floor 319

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 60.75 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 53144



Signage : Highest Tactile Character Height



Signage - 2nd Floor: Signage

2nd Floor 319 Lab

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52942

Signage - 2nd Floor : Signage

2nd Floor Hallway Next to 302

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 54037



Signage : No Room Identification



Signage - 2nd Floor: Signage

2nd Floor Hallway Next to 313

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53654

Signage - 2nd Floor : Signage

2nd Floor Hallway Next to 317

There is no room identification signage.

On-Site Finding None Found

Recommendation

Finding

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53899



Signage : No Room Identification

Signage $\,:\,$ No Room Identification



Restrooms - 2nd Floor: Restroom, Lavatory

2nd Floor Boys Restroom

Lavatory

Finding

The height of the counter surface of the lavatory designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 31.25 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation Up to 30.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.16.2, ADA 213, 606, 606.2

Record Number 53628

Restrooms - 2nd Floor : Restroom , Lavatory

2nd Floor Boys Restroom

Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 53629

Restroom , Lavatory : Lavatory Surface Height



Restroom , Lavatory : Lavatory Pipes Not Wrapped



Restrooms - 2nd Floor: Restroom, Lavatory

2nd Floor Boys Restroom

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap supply lines \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 53630

Restrooms - 2nd Floor: Restroom, Dispensers

2nd Floor Boys Restroom

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 55.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 53625

Restroom , Lavatory : Lavatory - Supply Lines not wrapped





Restroom , Dispensers : Dispenser Height

Restrooms - 2nd Floor : Restroom , Dispensers

2nd Floor Boys Restroom

Paper Towel

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 39.5, ADA 309, 205, 309.4

Record Number 53626



Restroom , Dispensers : Dispenser Operation

Restrooms - 2nd Floor : Restroom , Dispensers

2nd Floor Boys Restroom

Soap

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 41.50 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 53627



Restroom , Dispensers : Dispenser Height

Restrooms - 2nd Floor: Restroom, Mirror

2nd Floor Boys Restroom

Restroom , Mirror : Mirror Bottom Edge Height

Finding

The bottom edge of the reflective surface of the mirror in the restroom is is not at a compliant height for the primary age group.

On-Site Finding 54.00 inches

Recommendation

Lower the mirror in the restroom so that the bottom edge of the reflective surface is no higher than recommended above the finish floor.

Recommendation Up to 31.00 inches

Costing Info (Estimated)

Lower mirror \$291

Code Reference MA 30.18, ADA 603, 213, 603.3

Record Number 53631

Restrooms - 2nd Floor: Restroom, Wall Signage

2nd Floor Boys Restroom

Wall Sign

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation


Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.8

Record Number 53632



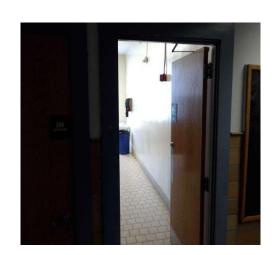

Restroom , Wall Signage : No Wall Signage

Restrooms - 2nd Floor: Restroom, Toilet

2nd Floor Boys Restroom

Restroom , Toilet : Toilet Seat Height

Finding

The height of the toilet seat in the restroom is greater than the allowed maximum height for use by the primary age group.

On-Site Finding 18.50 inches

Recommendation

Adjust or modify the height of the toilet seat in the restroom to the required height for use by the primary age group.

Recommendation 11.00 - 17.00 inches

Costing Info (Estimated)

Modify fixture \$1,707

Code Reference MA 30.14.3, ADA 603, 604.9.3

Record Number 53673

Restrooms - 2nd Floor: Restroom, Toilet

2nd Floor Boys Restroom

Finding

The flush control on the toilet is not on the wide (approach) side of the toilet.

On-Site Finding Wrong Side of Toilet

Recommendation

Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be handoperated or automatic mechanisms.

Recommendation See Recommendation

Costing Info (Estimated)

Relocate flush valve \$127 **Code Reference** MA 30.7.5, ADA 603, 604.6

Record Number 53675



Restroom , Toilet $\,:\,$ Toilet Flush Control not on Wide Side



Restrooms - 2nd Floor: Restroom, Toilet

2nd Floor Boys Restroom

Restroom , Toilet : Toilet Clear Floor Space

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 40.25 inches

Recommendation

Create the required minimum clear space in front of the toilet.


Recommendation At least 42.00 inches

Costing Info (Estimated)

Modify space \$3,500

Code Reference MA 30.6.1, MA 30.7.1, ADA 603

Record Number 53676

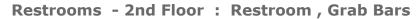

2nd Floor Boys Restroom

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 48.00 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Costing Info (Estimated)

Provide compliant grab bar \$267

Code Reference MA 30.8, ADA 603, 609, 604.5.1

Record Number 53677



Restroom , Grab Bars $\,:\,$ Distance from Back Wall to Front of Grab Bar



Restrooms - 2nd Floor: Restroom, Grab Bars

2nd Floor Boys Restroom

Restroom , Grab Bars : Side Grab Bar Height

Finding

The height of the side grab bar in the compartment designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 33.87 inches

Recommendation

Remount the side grab bar in the compartment designated to be accessible in the restroom at to the required height for use by the primary age group.

Recommendation 25.00 inches

Costing Info (Estimated)

Adjust grab bar height \$78

Code Reference MA 30.15.1, ADA 609, 604.9, 609.4

Record Number 53678

Restrooms - 2nd Floor: Restroom, Grab Bars

2nd Floor Boys Restroom

Restroom , Grab Bars : Restroom - Grab Bar Height

Finding

The grab bar on the rear wall is not at the correct height.

On-Site Finding 34.25 inches

Recommendation

Remount the rear grab bar in the compartment designated to be accessible so the height of the gripping surface is at the correct height.

Recommendation 20.00 - 25.00 inches

Costing Info (Estimated)

Provide compliant grab bars \$231 **Code Reference** ADA 213, 604, 604.9

Record Number 53679



Restrooms - 2nd Floor : Restroom , Compartment Door

2nd Floor Boys Restroom

Restroom , Compartment Door : Compartment Door Handle

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Costing Info (Estimated)

Install accessible handle on stall door \$250

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 604.8.1.2, 604.8

Record Number 53680

Restrooms - 2nd Floor: Restroom

2nd Floor Boys Restroom

Finding

The compartment door is located in front of the water closet.

On-Site Finding Not Located

Recommendation

Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.

Recommendation See Recommendation

Costing Info (Estimated)

\$4,000

Code Reference ADA 604.8.1.2

Record Number 53681



Restroom : Toilet Compartment Door



Restrooms - 2nd Floor: Restroom, Compartment Door

2nd Floor Boys Restroom

Finding

The door to the compartment swings inward into the minimum required compartment area.

On-Site Finding Swings In

Recommendation

Modify the swing of the door so that it does not swing into the minimum required compartment area.

Recommendation See Recommendation

Costing Info (Estimated)

Modify door swing \$269

Code Reference MA 30.6.1, MA 30.6.2, ADA 603,

604.8, 304.4

Record Number 53682

Restrooms - 2nd Floor: Restroom, Compartment Door

2nd Floor Boys Restroom

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Finding

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

604.8.1.2, 604.8

Record Number 53683

Restroom , Compartment Door : Compartment Door Swings In





Restroom, Compartment Door: Compartment

Restrooms - 2nd Floor: Restroom, Compartment Door

2nd Floor Boys Restroom

Finding

The compartment door hardware is not at a compliant height.

On-Site Finding 40.50 inches

Recommendation

Remove and relocate the door hardware.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 404.2.7, 604.8

Record Number 53684

Restrooms - 2nd Floor: Restroom, Toilet Compartment

2nd Floor Boys Restroom

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 54.00 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 16.00 - 36.00 inches

Costing Info (Estimated)

Move coat hook \$50

Code Reference MA 30.20, ADA 308, 308.1

Record Number 53685



Restroom , Compartment Door : Compartment

Door Handle Height

Restroom , Toilet Compartment : Coat Hook Height



Restrooms - 2nd Floor: Restroom, Toilet Compartment

2nd Floor Boys Restroom

Finding

The location of the toilet paper dispenser in the restroom primarily used by children is not within recommended values of the front edge of the toilet seat.

On-Site Finding 2.00 inches

Recommendation

Remount the toilet paper dispenser in the restroom so that it is within the recommended values from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.14.5, ADA 603, 604.9.6

Record Number 53686

Restrooms - 2nd Floor: Restroom, Toilet Compartment

2nd Floor Boys Restroom

Finding

There is insufficient clear floor space in the compartment.

On-Site Finding 71.50 inches

Recommendation

Modify or replace the compartment to provide adequate clear floor space.

Recommendation At least 72.00 inches

Costing Info (Estimated)

Install accessible stall \$4,000

Code Reference MA 30.6.1, ADA 603, 213, 604,

604.8.1.1

Record Number 53672

Restroom , Toilet Compartment : Toilet Paper Dispenser Distance From Seat





Restroom, Toilet Compartment: Toilet

Compartment Length

Page 157 of 544

Restrooms - 2nd Floor: Restroom, Toilet

2nd Floor Girls Restroom

Restroom , Toilet : Toilet Seat Height

Finding

The height of the toilet seat in the restroom is greater than the allowed maximum height for use by the primary age group.

On-Site Finding 18.50 inches

Recommendation

Adjust or modify the height of the toilet seat in the restroom to the required height for use by the primary age group.

Recommendation 11.00 - 17.00 inches

Costing Info (Estimated)

Modify fixture \$1,707

Code Reference MA 30.14.3, ADA 603, 604.9.3

Record Number 53828

Restrooms - 2nd Floor: Restroom, Toilet

2nd Floor Girls Restroom

Restroom , Toilet : Toilet Clear Floor Space

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 35.75 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 42.00 inches

Costing Info (Estimated)

Modify space \$3,500

Code Reference MA 30.6.1, MA 30.7.1, ADA 603

Record Number 53830





Restrooms - 2nd Floor: Restroom, Grab Bars

2nd Floor Girls Restroom

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 50.00 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Costing Info (Estimated)

Provide compliant grab bar \$267

Code Reference MA 30.8, ADA 603, 609, 604.5.1

Record Number 53831

Restrooms - 2nd Floor: Restroom, Grab Bars

2nd Floor Girls Restroom

The height of the side grab bar in the compartment designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 34.00 inches

Recommendation

Finding

Remount the side grab bar in the compartment designated to be accessible in the restroom at to the required height for use by the primary age group.

Recommendation 25.00 inches

Costing Info (Estimated)

Adjust grab bar height \$78

Code Reference MA 30.15.1, ADA 609, 604.9, 609.4

Record Number 53832

Restroom , Grab Bars : Distance from Back Wall to Front of Grab Bar







Restroom , Grab Bars : Side Grab Bar Height

Restrooms - 2nd Floor: Restroom, Grab Bar

2nd Floor Girls Restroom

Restroom , Grab Bar : Rear Grab Bar Location

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Costing Info (Estimated)

Provide a compliant back grab bar. \$267

Code Reference ADA 604.5.2

Record Number 53833



2nd Floor Girls Restroom

Restroom , Grab Bars : Restroom - Grab Bar Height

Finding

The grab bar on the rear wall is not at the correct height.

On-Site Finding 34.50 inches

Recommendation

Remount the rear grab bar in the compartment designated to be accessible so the height of the gripping surface is at the correct height.

Recommendation 20.00 - 25.00 inches

Costing Info (Estimated)

Provide compliant grab bars \$231 **Code Reference** ADA 213, 604, 604.9

Record Number 53834



Restrooms - 2nd Floor: Restroom

2nd Floor Girls Restroom

Finding

The compartment door is located in front of the water closet.

On-Site Finding Not Located

Recommendation

Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.

Recommendation See Recommendation

Costing Info (Estimated)

\$4,000

Code Reference ADA 604.8.1.2

Record Number 53835

Restrooms - 2nd Floor : Restroom , Compartment Door

2nd Floor Girls Restroom

Finding

The door to the compartment swings inward into the minimum required compartment area.

On-Site Finding Swings In

Recommendation

Modify the swing of the door so that it does not swing into the minimum required compartment area.

Recommendation See Recommendation

Costing Info (Estimated)

Modify door swing \$269

Code Reference MA 30.6.1, MA 30.6.2, ADA 603,

604.8, 304.4

Record Number 53836



Restroom: Toilet Compartment Door

Restroom , Compartment Door : Compartment Door Swings In



Restrooms - 2nd Floor: Restroom, Compartment Door

2nd Floor Girls Restroom

Restroom , Compartment Door : Compartment

Finding

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation


Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

604.8.1.2, 604.8

Record Number 53837

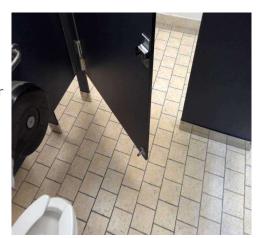

Restrooms - 2nd Floor: Restroom, Compartment Door

2nd Floor Girls Restroom

Finding

The compartment door hardware is not at a compliant height.

On-Site Finding 41.00 inches

Recommendation

Remove and relocate the door hardware.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1,MA 30.6.2, ADA 404,

213, 604, 404.2.7, 604.8

Record Number 53838

Restroom , Compartment Door : Compartment Door Handle Height



Restrooms - 2nd Floor: Restroom, Toilet Compartment

2nd Floor Girls Restroom

Restroom , Toilet Compartment : Coat Hook Height

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 53.62 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 16.00 - 36.00 inches

Costing Info (Estimated)

Move coat hook \$50

Code Reference MA 30.20, ADA 308, 308.1

Record Number 53839



Restrooms - 2nd Floor: Restroom, Toilet Compartment

2nd Floor Girls Restroom

Finding

The location of the toilet paper dispenser in the restroom primarily used by children is not within recommended values of the front edge of the toilet seat.

On-Site Finding 1.00 inches

Recommendation

Remount the toilet paper dispenser in the restroom so that it is within the recommended values from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.14.5, ADA 603, 604.9.6

Record Number 53840

Restroom , Toilet Compartment : Toilet Paper Dispenser Distance From Seat



Restrooms - 2nd Floor: Restroom, Lavatory

2nd Floor Girls Restroom

Lavatory

Finding

The height of the counter surface of the lavatory designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 30.75 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation Up to 30.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.16.2, ADA 213, 606, 606.2

Record Number 54055

Restrooms - 2nd Floor : Restroom , Lavatory

2nd Floor Girls Restroom

Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 54056

Restroom , Lavatory : Lavatory Surface Height



 $\mbox{Restroom , Lavatory} \ : \ \mbox{Lavatory Pipes Not} \\ \mbox{Wrapped}$



Restrooms - 2nd Floor: Restroom, Lavatory

2nd Floor Girls Restroom

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap supply lines \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 54057

Restrooms - 2nd Floor: Restroom, Dispensers

2nd Floor Girls Restroom

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 45.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 54052

Restroom , Lavatory : Lavatory - Supply Lines not wrapped





Restroom , Dispensers : Dispenser Height

Page 165 of 544

Restrooms - 2nd Floor: Restroom, Dispensers

2nd Floor Girls Restroom

Paper Towel

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 39.5, ADA 309, 205, 309.4

Record Number 54053



Restroom , Dispensers : Dispenser Operation

Restrooms - 2nd Floor : Restroom , Dispensers

2nd Floor Girls Restroom

Soap

Restroom , Dispensers : Dispenser Height

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 45.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 54054



Restrooms - 2nd Floor: Restroom, Mirror

2nd Floor Girls Restroom

Restroom , Mirror : Mirror Bottom Edge Height

Finding

The bottom edge of the reflective surface of the mirror in the restroom is is not at a compliant height for the primary age group.

On-Site Finding 48.00 inches

Recommendation

Lower the mirror in the restroom so that the bottom edge of the reflective surface is no higher than recommended above the finish floor.

Recommendation Up to 31.00 inches

Costing Info (Estimated)

Lower mirror \$291

Code Reference MA 30.18, ADA 603, 213, 603.3

Record Number 54058

Restrooms - 2nd Floor: Restroom, Wall Signage

2nd Floor Girls Restroom

Wall Sign

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.8

Record Number 54059





Restroom , Wall Signage : No Wall Signage



Restrooms - 2nd Floor: Restroom, Toilet Compartment

2nd Floor Girls Restroom

Restroom , Toilet Compartment : Toilet Compartment Length

Finding

There is insufficient clear floor space in the compartment.

On-Site Finding 70.00 inches

Recommendation

Modify or replace the compartment to provide adequate clear floor space.

Recommendation At least 72.00 inches

Costing Info (Estimated)

Install accessible stall \$4,000

Code Reference MA 30.6.1, ADA 603, 213, 604,

604.8.1.1

Record Number 53827

Restrooms - 2nd Floor: Restroom, Toilet

2nd Floor Staff Unisex Restroom

Restroom , Toilet : Toilet Seat Height

Finding

The height of the toilet seat is not at the required height.

On-Site Finding 16.00 inches

Recommendation


Adjust or modify the toilet so the seat height is at the required accessible height.

Recommendation 17.00 - 19.00 inches

Costing Info (Estimated)

Modify fixture \$1,707 **Code Reference** MA 30.7.3, ADA 603, 604.4

Record Number 53864

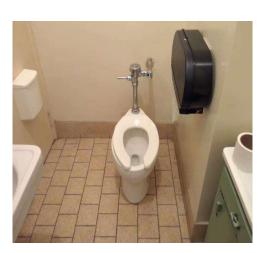

Restrooms - 2nd Floor: Restroom, Toilet

2nd Floor Staff Unisex Restroom

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 34.50 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Costing Info (Estimated)

Relocate fixture \$2,500 **Code Reference** MA 30.7.2, ADA 603, 604.2

Record Number 53866



Restroom , Paper Dispenser : Located Behind

Front of Seat

Restrooms - 2nd Floor : Restroom , Paper Dispenser

2nd Floor Staff Unisex Restroom

Finding

The paper dispenser is located behind the front of toilet

On-Site Finding See Above

Recommendation

Remount the toilet paper dispenser so it is within the required distance from the front edge of the toilet seat.

Recommendation See Recommendation

Costing Info (Estimated)

\$78

Code Reference ADA 304, 604.7

Record Number 53867



Restroom , Toilet : Toilet Minimum Distance

From Any fixture

Restrooms - 2nd Floor: Restroom, Lavatory

2nd Floor Staff Unisex Restroom

Lavatory

Restroom , Lavatory : Lavatory Control Type

Finding

The faucet controls on the lavatory require tight grasping, pinching, or twisting of the wrist and are not accessible.

On-Site Finding Not Accessible

Recommendation

Install accessible faucet controls. Lever-operated, pushtype, touch-type or electronically controlled mechanisms are acceptable elements. If self-closing valves are used the faucet shall remain open for at least 10 seconds.

Recommendation See Recommendation

Costing Info (Estimated)

Replace knob faucets with paddle \$392

faucets

Code Reference MA 30.9.6, ADA 213, 606, 309.4

Record Number 53990

Restrooms - 2nd Floor: Restroom, Lavatory

2nd Floor Staff Unisex Restroom

Lavatory

Finding

The knee clearance space under the lavatory is less than the required minimum height.

On-Site Finding 24.00 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation At least 27.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.9.3, ADA 213, 606, 606.2,

306.3.1

Record Number 53991



Restroom , Lavatory : Lavatory Knee Clearance



Restrooms - 2nd Floor: Restroom, Lavatory

2nd Floor Staff Unisex Restroom

Lavatory

Finding

There is not sufficient clear floor space provided to allow an accessible forward approach.

On-Site Finding 32.50 inches

Recommendation

Relocate the lavatory to provide clear floor space.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install new sink, faucet and handles \$2,261

Code Reference MA 6.4.1, ADA 213, 606, 606.2,

305.3

Record Number 53992

Restroom , Lavatory : Lavatory Clear Floor Space Length



Restrooms - 2nd Floor: Restroom, Lavatory

2nd Floor Staff Unisex Restroom

Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 53993

 $\mbox{Restroom , Lavatory} \ : \ \mbox{Lavatory Pipes Not} \\ \mbox{Wrapped}$



Restrooms - 2nd Floor: Restroom, Lavatory

2nd Floor Staff Unisex Restroom

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap supply lines \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 53994

Restrooms - 2nd Floor : Restroom , Dispensers

2nd Floor Staff Unisex Restroom

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 51.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation 15.00 - 48.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 6.5, ADA 309, 205, 308, 606,

308.1

Record Number 53988

Restroom , Lavatory : Lavatory - Supply Lines not wrapped





Restroom , Dispensers : Dispenser Height

Page 173 of 544

Restrooms - 2nd Floor : Restroom , Dispensers

2nd Floor Staff Unisex Restroom

Paper Towel

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 39.5, ADA 309, 205, 309.4

Record Number 53989

Restrooms - 2nd Floor: Restroom, Wall Mounted Mirror

2nd Floor Staff Unisex Restroom

Finding

The bottom edge of the reflective surface of the mirror is not at the correct height.

On-Site Finding 52.00 inches

Recommendation

Lower the mirror so the bottom edge of the reflective surface is no higher than recommended above the finished floor.

Recommendation Up to 35.00 inches

Costing Info (Estimated)

Lower mirror \$300

Code Reference ADA 603.3

Record Number 53995

Restroom , Dispensers : Dispenser Operation







Restrooms - 2nd Floor: Restroom, Wall Signage

2nd Floor Staff Unisex Restroom

Wall Sign

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.8

Record Number 53996



Restroom, Wall Signage: No Wall Signage

Restrooms - 2nd Floor: Restroom, Toilet Compartment

2nd Floor Staff Unisex Restroom

Finding

There is not a minimum of 60 inches of clearance around the water closet measured perpendicular from the side wall.

On-Site Finding 50.75 inches

Recommendation

Clearance around a water closet shall be 60 inches (1525 mm) minimum measured perpendicular from the side wall and 56 inches (1420 mm) minimum measured perpendicular from the rear wall.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Modify fixture \$1,707 **Code Reference** ADA 603, 502.4, 604.3.1

Record Number 53861

Restroom , Toilet Compartment : Toilet Clear Floor Space Width



Restrooms - 2nd Floor: Restroom, Grab Bars

2nd Floor Staff Unisex Restroom

Restroom , Grab Bars : No Grab Bars

Finding

There are no grab bars.

On-Site Finding None Found

Recommendation

Install the required grab bars in the toilet compartment.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant grab bar \$267

Code Reference MA 30.8, ADA 603, 609, 604.5

Record Number 53862



Restrooms - 2nd Floor: Restroom, Toilet Compartment

2nd Floor Staff Unisex Restroom

Finding

There is no required coat hook.

On-Site Finding None Found

Recommendation

Install a coat hook at the recommended height.

Recommendation See Recommendation

Costing Info (Estimated)

Install coat hook \$34 **Code Reference** MA 30.6.1,MA 30.6.2

Record Number 53863

Restroom , Toilet Compartment : No Coat Hook Available



Restrooms - 2nd Floor: Restroom

2nd Floor Staff Unisex Restroom

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Costing Info (Estimated)

Replace existing lock set with lever \$804 handled lock set

Code Reference ADA 213, 213.2.1

Notes: Lavatory Obstructs Turning Space Diameter.

Record Number 53986

Restrooms - 2nd Floor: Restroom

2nd Floor Staff Unisex Restroom

Finding

There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.

On-Site Finding 50.00 inches

Recommendation

Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

At least 60.00 inches Recommendation

Costing Info (Estimated)

Install single-use toilet room \$14,000

Code Reference ADA 603, 304, 304.3.1, 603.2.1,

304.3

Notes: Lavatory Obstructs Turning Space Diameter.

Record Number 53987 Restroom : No Door Privacy Lock and Occupied

Indicator





Restroom: Circular Turning Space Diameter



Drinking Fountains - 2nd Floor: Drinking Fountain

Drinking Fountain Next to 306

Finding

The provided drinking fountain is not a Hi-Low fountain.

On-Site Finding Fountain Not Compliant

Recommendation

Replace the drinking fountain with a compliant Hi-Low fountain.

Recommendation See Recommendation

Costing Info (Estimated)

Install new high/low fountain \$2,500

Code Reference ADA 305, 602, 211.2

Record Number 54020

Drinking Fountain : Fountain Type

Drinking Fountains - 2nd Floor: Drinking Fountain

Drinking Fountain Next to 306

Finding

The spout height is greater than the required maximum height for the primary age group.

On-Site Finding 34.00 inches

Recommendation

The height of the spout outlet shall not exceed the maximum height for the primary age group.


Recommendation Up to 30.00 inches

Costing Info (Estimated)

Lower existing fountain \$627

Code Reference ADA 305, 306, 211, 602, 602.2

Record Number 54021

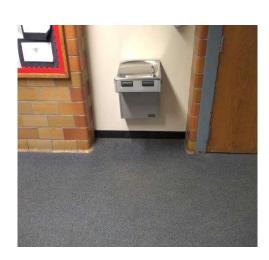

Drinking Fountain : Spout Height

Drinking Fountains - 2nd Floor: Drinking Fountain

Drinking Fountain Next to 306

Finding

The height of the water stream is less than required.

On-Site Finding 3.00 inches

Recommendation

Insure that the spout directs the water flow to the required height and in a trajectory that is parallel or nearly parallel to the front of the drinking fountain.

Recommendation At least 4.00 inches

Costing Info (Estimated)

Install new high/low fountain \$2,500

Code Reference MA 36.3, ADA 211, 602, 602.6

Record Number 54022



Drinking Fountain : Stream Height

Drinking Fountains - 2nd Floor: Drinking Fountain

Drinking Fountain Next to 306

Finding

The drinking fountain protrudes more than 4 inches outside of the alcove.

On-Site Finding See Above

Recommendation

Provide an alcove that will contain the entire depth of the drinking fountain.

Recommendation See Recommendation

Costing Info (Estimated)

Install wing walls or relocate object \$640

Code Reference MA 6.4.2, ADA 305, 307.2, 602.1

Record Number 54023



Drinking Fountain : Alcove Depth

Break/Conference Room - 2nd Floor: Break Room, Appliance

2nd Floor 319 Lab

Refrigerator - Appliance

Finding

Appliance Reach Height in the break/conference room is not compliant.

On-Site Finding 50.00 inches

Recommendation

Make sure that the specified appliance reach height is compliant.

Recommendation Up to 48.00 inches

Costing Info (Estimated)

Adjust appliance height \$1,200

Code Reference ADA 309, 205, 308

Record Number 52950



Break Room , Appliance : Reach Height

Break/Conference Room - 2nd Floor : Break Room

2nd Floor 319 Lab

Sink

Finding

Sink controls needs twisting to operate.

On-Site Finding Not Compliant

Recommendation

Provide compliant controls for the sink in break/conference room.

Recommendation See Recommendation

Costing Info (Estimated)

Replace knob faucets with paddle \$392 faucets

Code Reference ADA 309, 205, 308, 228

Record Number 52945



Break Room : Sink - Control Type

Break/Conference Room - 2nd Floor: Break Room

2nd Floor 319 Lab

Sink

Break Room : Sink - Counter Height

Finding

Sink counter height does not meet the standards.

On-Site Finding 36.62 inches

Recommendation

Provide compliant sink.

Recommendation Up to 34.00 inches

Costing Info (Estimated)

Provide compliant sink \$1,800

Code Reference ADA 606.3

Record Number 52946



Break/Conference Room - 2nd Floor : Break Room

2nd Floor 319 Lab

Sink

Break Room : Pipes not Wrapped

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5



Break/Conference Room - 2nd Floor: Break Room

2nd Floor 319 Lab

Sink

Break Room : Toe Kick Not Removed

Finding

The toe kick for the sink in break/conference room is not removed.

On-Site Finding Not Removed

Recommendation

Remove the toe kick for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

\$612

Code Reference ADA 305, 306, 606.2

Record Number 52948



Break/Conference Room - 2nd Floor : Break Room , Sink

2nd Floor 319 Lab

Sink

Break Room , Sink : Supply Lines

Finding

Supply lines are not wrapped for the break/conference room sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5



Sinks - 2nd Floor: Sink

2nd Floor 318 Lab

Paper Towel

Sink : Sink

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 58.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 48.00 inches

Costing Info (Estimated)

Replace dispenser \$180

Code Reference MA 6.5, ADA 309, 205, 308, 606

Record Number 53173

Sinks - 2nd Floor: Sink

2nd Floor 318 Lab

Paper Towel

Sink : Sink

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding None Found

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Replace dispenser \$980

Code Reference MA 39.5, ADA 309



Sinks - 2nd Floor: Sink

2nd Floor 318 Lab

Sink : Sink - Control Type

Finding

Twist controls are present on the sink.

On-Site Finding Needs Twisting

Recommendation

Provide compliant controls for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Replace knob faucets with paddle \$392

faucets

Code Reference ADA 309, 205, 308, 228, 212, 606.4

Record Number 53168

Sinks - 2nd Floor : Sink

2nd Floor 318 Lab

Sink : Sink - Counter Height

Finding

Sink counter height is not compliant.

On-Site Finding 34.25 inches

Recommendation

Provide compliant sink.

Recommendation Up to 34.00 inches

Costing Info (Estimated)

Provide compliant sink \$1,800

Code Reference ADA 606.3





Sinks - 2nd Floor: Sink

2nd Floor 318 Lab

Sink : Pipes not Wrapped

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Record Number 53170

Sinks - 2nd Floor : Sink

2nd Floor 318 Lab

Finding

The toe kick for the sink is not removed.

On-Site Finding Toe Kick Exists

Recommendation

Make sure there is no toe kick at the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Remove toe kick \$420

Code Reference ADA 305, 306, 606.2

Record Number 53171



Sink : Toe Kick Not Removed



Sinks - 2nd Floor: Sink

2nd Floor 318 Lab

Sink : Supply Lines

Finding

Supply lines are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Record Number 53172

Sinks - 2nd Floor: Sink

2nd Floor 319 Staff Sink - Twist

Finding

Twist controls are present on the sink.

On-Site Finding Needs Twisting

Recommendation

Provide compliant controls for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Replace knob faucets with paddle \$392

faucets

Code Reference ADA 309, 205, 308, 228, 212, 606.4

Record Number 52721



Sink : Sink - Control Type



Sinks - 2nd Floor: Sink

2nd Floor 319 Staff Sink - Twist

Finding

Sink knee clearance does not meet the standards.

On-Site Finding 24.75 inches

Recommendation

Provide compliant sink.

Recommendation At least 27.00 inches

Costing Info (Estimated)

Provide compliant sink \$1,800

Code Reference ADA 309, 205, 308, 606, 228

Record Number 52722

Sinks - 2nd Floor: Sink

2nd Floor 319 Staff Sink - Twist

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Record Number 52723

Sink : Sink - Knee Clearance



Sink : Pipes not Wrapped



Sinks - 2nd Floor: Sink

2nd Floor 319 Staff Sink - Twist

Finding

There is not enough clear floor space at the sink.

On-Site Finding 37.25 inches

Recommendation

Provide enough clear floor space at the location.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unknown scope \$900

52724

Code Reference ADA 606.2

Sinks - 2nd Floor: Sink

2nd Floor 319 Staff Sink - Twist

Record Number

Finding

Supply lines are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Record Number 52725

Sink : Clear Floor Space Length



Sink : Supply Lines



Sinks - 2nd Floor: Sink

2nd Floor 319

Student Sink - Lever

Finding

Sink counter height is not compliant.

On-Site Finding 34.00 inches

Recommendation

Provide compliant sink.

Recommendation Up to 29.00 inches

Costing Info (Estimated)

Provide compliant sink \$1,800 **Code Reference** ADA 309, 205, 308, 228

Record Number 52718

Sinks - 2nd Floor: Sink

2nd Floor 319

Student Sink - Lever

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Record Number 52719

Sink : Sink - Counter Height



Sink : Pipes not Wrapped



Sinks - 2nd Floor: Sink

2nd Floor 319

Student Sink - Lever

Finding

Supply lines are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Record Number 52720

Lockers - 2nd Floor: Lockers

2nd Floor Lockers Next to 314

Finding

No accessible lockers were found.

On-Site Finding Not Available

Recommendation

At least one locker or 5% of the lockers should be accessible.

Recommendation See Recommendation

Costing Info (Estimated)

Requires assembly or design \$1,840

Code Reference ADA 225.2.1, 811

Record Number 53044

Sink : Supply Lines



Lockers : No Accessible Lockers Available



Reach Ranges - 2nd Floor: Reach Range

2nd Floor 304

Computer - Computer Station

Finding

The knee height is not compliant.

On-Site Finding 26.75 inches

Recommendation

Adjust knee height to the recommended value.

Recommendation At least 27.00 inches

Costing Info (Estimated)

Adjust knee height \$500 **Code Reference** ADA 304, 306, 902, 226

Record Number 52981

Reach Range : Knee Height

2nd Floor 319

Eye Wash Station - Eye Washing Station - Side

Reach Ranges - 2nd Floor: Reach Range, Clear Floor Space Width

Finding

The clear floor space width is not compliant.

On-Site Finding 0.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 30.00 inches

Costing Info (Estimated)

Redesign space \$500

Code Reference ADA 304, 305.3

Record Number 52716

Reach Range , Clear Floor Space Width : Clear Floor Space Width



Reach Ranges - 2nd Floor: Reach Range, Clear Floor Space Length

2nd Floor 319

Eye Wash Station - Eye Washing Station - Side

Finding

The clear floor space length is not compliant.

On-Site Finding 0.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Redesign space \$500

Code Reference ADA 304, 305.3

Record Number 52717

Reach Range , Clear Floor Space Length : Clear Floor Space Length



Reach Ranges - 2nd Floor: Reach Range, Clear Floor Space Length

2nd Floor 319

Student Work Station - Work Station - Side

Finding

The clear floor space length is not compliant.

On-Site Finding 35.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Redesign space \$500

Code Reference ADA 304, 305.3

Record Number 52714

Reach Range , Clear Floor Space Length : Clear Floor Space Length



Reach Ranges - 2nd Floor: Reach Range, Element Highest Point of Operation

2nd Floor 319

Student Work Station - Work Station - Side

Finding

The highest point of operation for the element is not compliant.

On-Site Finding 34.37 inches

Recommendation

Make sure that the highest point of operation is within the recommended value.

Recommendation 28.00 - 34.00 inches

Costing Info (Estimated)

Readjust element height \$50

Code Reference ADA 309, 308

Record Number 52715

Ramps - Basement : Ramp , Ramp Run

Basement Ramp in 003

Run 1

Finding

Ramp run does not have enough vertical clearance height.

On-Site Finding 78.75 inches

Recommendation

Provide compliant vertical clearance for the ramp run.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned

Code Reference ADA 307.4

Record Number 53107

Reach Range , Element Highest Point of Operation : Element Highest Point of Operation



 $Ramp\ ,\ Ramp\ Run \quad : \quad Vertical\ Clearance\ Height$



Ramps - Basement : Ramp , Landing

Basement Ramp in 003

Run 1 Bottom Landing

Finding

The slope of the landing is greater than required.

On-Site Finding 3.90 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Modify ramp landing \$2,872 **Code Reference** MA 20.9, ADA 402, 405.7.1

Record Number 53108

Ramps - Basement : Ramp , Handrail

Basement Ramp in 003

Run 1 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 405.9.1, 505.10.1

Record Number 53111

Ramp , Landing : Landing Slope







Ramps - Basement : Ramp , Handrail

Basement Ramp in 003

Run 1 Left Handrail

Finding

The height of the handrails on the ramp is not within the required range above the surface of the ramp.

On-Site Finding 33.50 inches

Recommendation

Modify or replace the handrails on the ramp to provide a gripping surface height within the required range above the ramp surface.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Set hand-forged wrought iron railing \$3,918 in concrete

Code Reference MA 24.5.2, ADA 405, 405.8, 505.4

Record Number 53112



Ramp , Handrail : Handrail Height

Ramps - Basement : Ramp , Handrail

Basement Ramp in 003

Run 1 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 405.9.1, 505.10.1

Record Number 53113

Ramp , Handrail : Handrail Bottom Extension



Ramps - Basement : Ramp , Handrail

Basement Ramp in 003

Run 1 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 10.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53114

Ramp , Handrail : Handrail Extension Length



Ramps - Basement : Ramp , Handrail

Basement Ramp in 003

Run 1 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 405.9.1, 505.10.1

Record Number 53110

Ramp , Handrail : Handrail Bottom Extension



Ramps - Basement : Ramp , Handrail

Basement Ramp in 003

Run 1 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 405.9.1, 505.10.1

Record Number 53115



Ramp , Handrail : Handrail Bottom Extension

Ramps - Basement : Ramp , Handrail

Basement Ramp in 003

Run 1 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 10.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53116

Ramp , Handrail : Handrail Extension Length



Ramps - Basement : Ramp , Landing

Basement Ramp in 003

Run 1 Top Landing

Finding

The distance between the latch side of the door and the edge of the landing does not meet the required minimum distance.

On-Site Finding 25.00 inches

Recommendation

Modify or replace the top landing on the ramp to provide a top landing with a level surface and provides the required minimum distance from the latch side of the door the edge of the landing.

Recommendation At least 42.00 inches

Costing Info (Estimated)

Modify ramp landing \$3,168 **Code Reference** MA 24.4.6, ADA 404, 405

Record Number 53109

Ramps - Basement : Ramp , Ramp Run

Basement Ramp in Gymnasium

Run 1

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding None Found

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation See Recommendation

Costing Info (Estimated)

Install edge protection on ramp \$470 **Code Reference** MA 24.8, ADA 405, 405.9

Record Number 53119

Ramp , Landing : Landing Edge to Door Clearance - Side Approach



Ramp , Ramp Run : Ramp Run Edge Protection



Ramps - Basement : Ramp , Ramp Run

Basement Ramp in Gymnasium

Run 1

Ramp, Ramp Run: Ramp Run Slope

Finding

The slope of the ramp is greater than the allowed slope.

On-Site Finding 13.10 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Correct ramp slope \$3,600 **Code Reference** MA 24.2, ADA 405, 405.2

Record Number 53120

Ramps - Basement : Ramp , Handrail

Basement Ramp in Gymnasium

Run 1 Left Handrail

Finding

The gripping surface of the handrails are interrupted by posts, or by a lack of smooth connections.

On-Site Finding Interrupted

Recommendation

Replace the handrails on each side to provide a smooth and continuous gripping surface. The gripping surface shall be smooth and free from interruptions.

Recommendation See Recommendation

Costing Info (Estimated)

Attach pipe railing to wall \$2,320

Code Reference MA 24.5.3, ADA 405, 405.8, 505.6







Ramps - Basement : Ramp , Handrail

Basement Ramp in Gymnasium

Run 1 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 405.9.1, 505.10.1

Record Number 53123

Ramp , Handrail : Handrail Bottom Extension



Ramps - Basement : Ramp , Handrail

Basement Ramp in Gymnasium

Run 1 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 505.10.1

Record Number 53124

Ramp , Handrail : Handrail Top Extension



Ramps - Basement : Ramp , Handrail

Basement Ramp in Gymnasium

Run 1 Right Handrail

Finding

The gripping surface of the handrails are interrupted by posts, or by a lack of smooth connections.

On-Site Finding Interrupted

Recommendation

Replace the handrails on each side to provide a smooth and continuous gripping surface. The gripping surface shall be smooth and free from interruptions.


Recommendation See Recommendation

Costing Info (Estimated)

Attach pipe railing to wall \$2,320

Code Reference MA 24.5.3, ADA 405, 405.8, 505.6

Record Number 53125

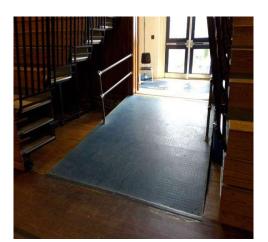

Ramp, Handrail: Handrail Interrupted

Ramps - Basement : Ramp , Handrail

Basement Ramp in Gymnasium

Run 1 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 405.9.1, 505.10.1

Record Number 53126

 $Ramp\ ,\ Handrail\ :\ Handrail\ Bottom\ Extension$



Ramps - Basement : Ramp , Handrail

Basement Ramp in Gymnasium

Run 1 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 505.10.1

Record Number 53127

Ramp , Handrail : Handrail Top Extension



Ramps - Basement : Ramp , Landing

Basement Ramp in Gymnasium Run 1 Top Landing

Finding

The distance between the latch side of the door and the edge of the landing does not meet the required minimum distance.

On-Site Finding 6.00 inches

Recommendation

Modify or replace the top landing on the ramp to provide a top landing with a level surface and provides the required minimum distance from the latch side of the door the edge of the landing.

Recommendation At least 24.00 inches

Costing Info (Estimated)

Modify ramp landing \$2,872 **Code Reference** MA 24.4.6, ADA 404, 405

Record Number 53121

Ramp , Landing : Landing Edge to Door Clearance - Front Approach



Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 1 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 405.9.1, 505.10.1

Record Number 53052



Ramp , Handrail : Handrail Bottom Extension

Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 1 Left Handrail

Ramp , Handrail : Handrail Bottom Extension

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 405.9.1, 505.10.1



Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 1 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 405.9.1, 505.10.1

Record Number 53048



Ramp , Handrail : Handrail Bottom Extension

Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 1 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53049

Ramp , Handrail : Handrail Extension not Parallel



Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 1 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 405.9.1, 505.10.1

Record Number 53050



Ramp , Handrail : Handrail Bottom Extension

Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 2 Left Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400


extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53059

Ramp , Handrail : Handrail Extension not Parallel

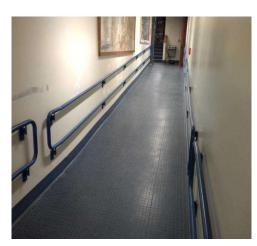

Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 2 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400


extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 505.10.1

Record Number 53060

Ramp , Handrail : Handrail Top Extension

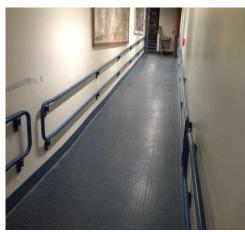

Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 2 Left Handrail

Finding

The height of the handrails on the ramp is not within the required range above the surface of the ramp.

On-Site Finding 33.25 inches

Recommendation

Modify or replace the handrails on the ramp to provide a gripping surface height within the required range above the ramp surface.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Set hand-forged wrought iron railing \$3,918 in concrete

Code Reference MA 24.5.2, ADA 405, 405.8, 505.4

Record Number 53061



Ramp , Handrail : Handrail Height

Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 2 Left Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400 extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53062

Ramp , Handrail : Handrail Extension not Parallel



Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 2 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 505.10.1

Record Number 53063

Ramp , Handrail : Handrail Top Extension

Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 2 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53054

Ramp , Handrail : Handrail Extension not Parallel



Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 2 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)


Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 505.10.1

Record Number 53055

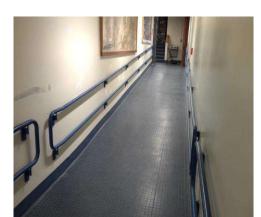

Ramp , Handrail : Handrail Top Extension

Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 2 Right Handrail

Finding

The height of the handrails on the ramp is not within the required range above the surface of the ramp.

On-Site Finding 33.75 inches

Recommendation

Modify or replace the handrails on the ramp to provide a gripping surface height within the required range above the ramp surface.


Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Set hand-forged wrought iron railing \$3,918 in concrete

Code Reference MA 24.5.2, ADA 405, 405.8, 505.4

Record Number 53056

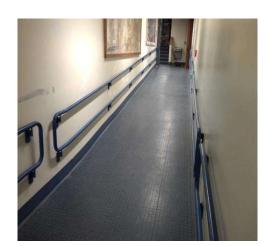

Ramp , Handrail : Handrail Height

Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 2 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400


extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53057

Ramp , Handrail : Handrail Extension not Parallel

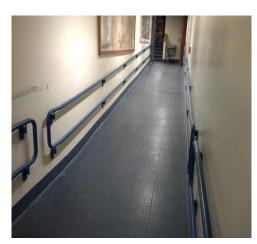

Ramps - Basement : Ramp , Handrail

Basement Ramp Next to 102

Run 2 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)


Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 505.10.1

Record Number 53058

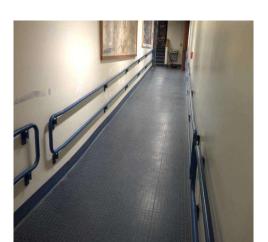

Ramp , Handrail : Handrail Top Extension

Elevators - Basement : Elevator , Door

Gym Stage Elevator

Elevator

Finding

The elevator door reopening device requires direct contact.

On-Site Finding Not Accessible

Recommendation

Contact a certified elevator provider to perform all renovation required.

Recommendation See Recommendation

Costing Info (Estimated)

Install/replace non-compliant doors, \$800 including opening device (5-stop passenger elevator)

Code Reference MA 28.6, ADA 407, 407.3.3.2

Record Number 53177



Elevator, Door: Re-opening Device

Elevators - Basement : Elevator, Door

Gym Stage Elevator

Elevator

Finding

The reopening device for the elevator door does not remain open for the required amount of time.

On-Site Finding Not Accessible

Recommendation

Contact a certified elevator provider to perform all renovation required.

Recommendation See Recommendation

Costing Info (Estimated)

Replace existing elevator panel \$800

Code Reference MA 28.6, ADA 407, 407.3.3.3

Record Number 53178

Elevators - Basement : Elevator

Gym Stage Elevator

Finding

There is no signage at the Elevator indicating the Evacuation Plan.

On-Site Finding None Found

Recommendation

Provide compliant signage indicating Evacuation plan and routes.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$207

Code Reference ADA 302, 407

Record Number 55921

Elevator , Door : Door







Elevators - Basement : Elevator

Gym Stage Elevator

Finding

The elevator provides a side opening door to the elevator car. The width of the elevator car is less than required.

On-Site Finding 53.50 inches

Recommendation

Contact a certified elevator provider to perform all renovation required.

Recommendation At least 68.00 inches

Costing Info (Estimated)

Contact a certified elevator provider Unassigned Code Reference MA 28.7, ADA 407, 407.4.1

Record Number 55922

Elevators - Basement : Elevator

Main Elevator

1st Floor

FindingMain floor is not indicated with a star.

On-Site Finding None Found

Recommendation

Make sure that main floor is indicated with a star.

Recommendation See Recommendation

Costing Info (Estimated)

Provide star \$180

Code Reference MA 28.5, ADA 407

Record Number 53710

JAZZ

Elevator : Car Width

Elevator : Elevator - Jamb Marking



Elevators - Basement : Elevator , Emergency Control Height

Main Elevator

Elevator

Finding

Emergency controls are not located at the compliant height.

On-Site Finding 34.50 inches

Recommendation

Contact a certified elevator provider to perform all renovation required.

Recommendation At least 35.00 inches

Costing Info (Estimated)

Replace existing elevator panel \$800

Code Reference ADA 407.4.6.4

Record Number 53708

Elevators - Basement : Elevator, Door

Main Elevator

Elevator

Finding

The reopening device for the elevator door does not remain open for the required amount of time.

On-Site Finding Not Accessible

Recommendation

Contact a certified elevator provider to perform all renovation required.

Recommendation See Recommendation

Costing Info (Estimated)

Replace existing elevator panel \$800

Code Reference MA 28.6, ADA 407, 407.3.3.3

Record Number 53709

Elevator , Emergency Control Height : Emergency System



Elevator, Door: Door



Elevators - Basement : Elevator

Main Elevator

Elevator : Evacuation Signage

Finding

There is no signage at the Elevator indicating the Evacuation Plan.

On-Site Finding None Found

Recommendation

Provide compliant signage indicating Evacuation plan and routes.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$207

Code Reference ADA 302, 407

Record Number 53707



Stairs - Basement : Stairway , Handrails

Basement Stairs in 003

Run 1

Stairway , Handrails $\,:\,$ No Handrail on One Side

Finding

There is no handrail provided on one side of the stairway.

On-Site Finding None Found

Recommendation

Provide compliant handrails on the stairway.


Recommendation See Recommendation

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4, ADA 504

Record Number 52675

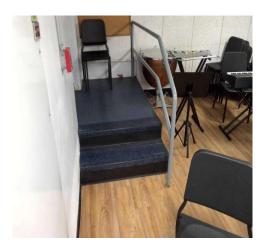

Stairs - Basement : Stairway , Handrail

Basement Stairs in 003

Run 1 Right Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 52676

Stairs - Basement : Stairway , Handrails

Basement Stairs in 003

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 32.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52677







Stairs - Basement : Stairway , Stair Run

Basement Stairs Next to 003

Run 1

Finding

Stair run vertical clearance height is not compliant.

On-Site Finding 78.75 inches

Recommendation

Provide compliant vertical clearance for the stair run.

Recommendation At least 80.00 inches

Costing Info (Estimated)

Unassigned

Code Reference ADA 307.4

Record Number 52916

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 003

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.50 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52917

Stairway , Stair Run : Vertical Clearance Height







Stairs - Basement : Stairway , Handrail

Basement Stairs Next to 003

Run 2 Left Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 52913

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 003

Run 2 Right Handrail

Finding

There are no top handrail extensions provided on the stairway.

On-Site Finding None Found

Recommendation

Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.1,

504.6, 505.10.2

Record Number 52914

Stairway , Handrail : Handrail Bottom Extension



Stairway , Handrails : No Top Handrail Extension



Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 003

Run 2 Right Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.3,

504.6

Record Number 52915

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 110

Run 1 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 30.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53949

Stairway , Handrails : No Bottom Handrail Extension





Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 110

Run 1 Right Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.3,

504.6

Record Number 53950

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 110

Run 1 Right Handrail

Finding

The distance between the handrail and the wall on the stairway is less than required.

On-Site Finding 1.00 inches

Recommendation

Remount the handrails on the stairway so that the distance from the handrail to the adjacent wall is compliant.

Recommendation At least 1.50 inches

Costing Info (Estimated)

Add compliant handrail \$1,916

Code Reference MA 27.4.7, ADA 504, 505.5, 504.6

Record Number 53951

Stairway , Handrails : No Bottom Handrail Extension



Stairway , Handrails : Handrail Distance From Wall



Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 110

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 30.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53952

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 110

Run 2 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 31.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)


Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53935





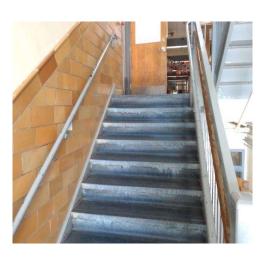

Stairs - Basement : Stairway , Handrail

Basement Stairs Next to 110

Run 2 Right Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 53936

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 110

Run 2 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 32.00 inches

Recommendation

Provide handrails on the stairway at the required height.


Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53937

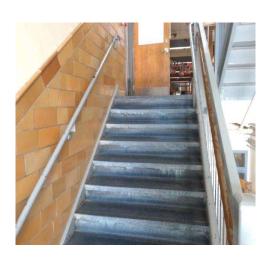





Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 110

Run 3 Left Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53938

Stairs - Basement : Stairway , Handrail

Basement Stairs Next to 110

Run 3 Left Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation


Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 53939

Stairway , Handrails : Handrail Extension not Parallel

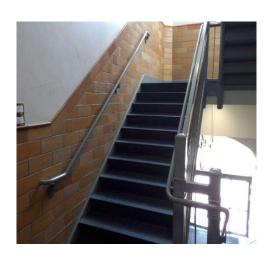



Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 110

Run 3 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53940

Stairs - Basement : Stairway , Handrail

Basement Stairs Next to 110

Run 3 Right Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation


Costing Info (Estimated)


Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 53941

Stairway , Handrails : Handrail Height

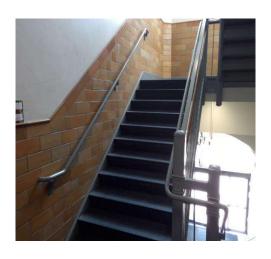

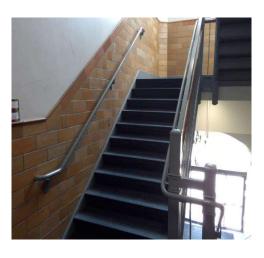

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 110

Run 3 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 32.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53942

Stairs - Basement : Stairway , Risers

Basement Stairs Next to 110

Run 4

Finding

The height of the risers are not uniform.

On-Site Finding Not Uniform

Recommendation

Modify or replace the stairs to provide uniform riser height.


Recommendation See Recommendation


Costing Info (Estimated)

Install stairway \$8,520

Code Reference MA 27.2, ADA 504

Record Number 53943

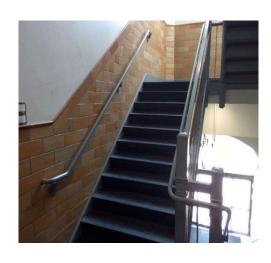

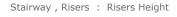



Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 110

Run 4 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 31.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53944

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 110

Run 4 Right Handrail

Finding

The distance between the handrail and the wall on the stairway is less than required.

On-Site Finding 1.00 inches

Recommendation

Remount the handrails on the stairway so that the distance from the handrail to the adjacent wall is compliant.

Recommendation At least 1.50 inches

Costing Info (Estimated)

Add compliant handrail \$1,916

Code Reference MA 27.4.7, ADA 504, 505.5, 504.6

Record Number 53945

Stairway , Handrails : Handrail Height



Stairway , Handrails : Handrail Distance From Wall



Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 110

Run 4 Right Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53946

Stairs - Basement : Stairway , Handrail

Basement Stairs Next to 110

Run 4 Right Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)


Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 53947

Stairway , Handrails : Handrail Extension not Parallel



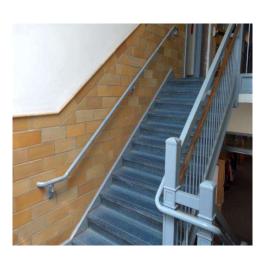

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 110

Run 4 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 32.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53948

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 112

Run 1 Left Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Costing Info (Estimated)


Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.3,

504.6

Record Number 52840

Stairway , Handrails : Handrail Height

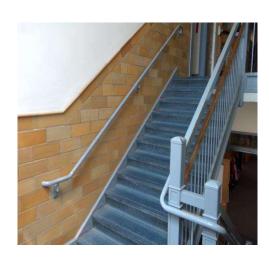

Stairway , Handrails : No Bottom Handrail Extension



Stairs - Basement : Stairway , Handrail

Basement Stairs Next to 112

Run 2 Left Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 52826

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 112

Run 2 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 32.00 inches

Recommendation

Provide handrails on the stairway at the required height.


Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52827

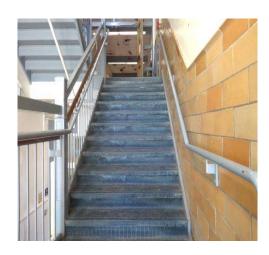





Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 112

Run 2 Right Handrail

Finding

The ends of the handrails are not rounded or returned smoothly to the wall or post.

On-Site Finding None Found

Recommendation

Install handrail extensions that are rounded or returned smoothly to the wall post.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant handrail \$1,916

Code Reference MA 27.4.8, ADA 504, 504.6, 505.10

Record Number 52828

Stairs - Basement : Stairway , Handrail

Basement Stairs Next to 112

Run 2 Right Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 52829







Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 112

Run 2 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 32.50 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52830

Stairs - Basement : Stairway , Handrail

Basement Stairs Next to 112

Run 3 Left Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 52831







Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 112

Run 3 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52832

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 112

Run 3 Right Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation


Costing Info (Estimated)

Add compliant extension to existing \$800 railing


Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 52833

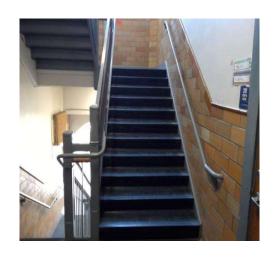



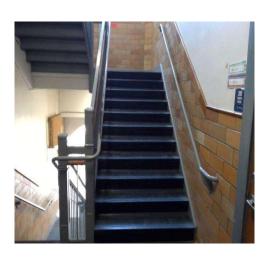

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 112

Run 3 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52834

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 112

Run 4 Left Handrail

Finding

The distance between the handrail and the wall on the stairway is less than required.

On-Site Finding 1.00 inches

Recommendation

Remount the handrails on the stairway so that the distance from the handrail to the adjacent wall is compliant.

Recommendation At least 1.50 inches

Costing Info (Estimated)


Add compliant handrail \$1,916

Code Reference MA 27.4.7, ADA 504, 505.5, 504.6

Record Number 52836



Stairway , Handrails : Handrail Distance From Wall

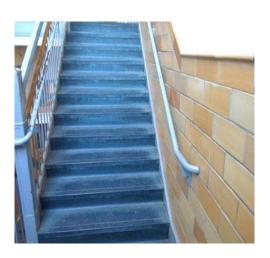

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 112

Run 4 Left Handrail

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 7.00 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 52837

Stairs - Basement : Stairway , Handrail

Basement Stairs Next to 112

Run 4 Left Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 52838

Stairway , Handrails : Handrail Extension Length





Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 112

Run 4 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52839

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 117

Run 1 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)


Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53878





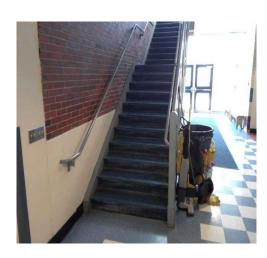

Stairs - Basement : Stairway , Handrail

Basement Stairs Next to 117

Run 1 Right Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 53879

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 117

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.00 inches

Recommendation

Provide handrails on the stairway at the required height.


Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)


Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53880

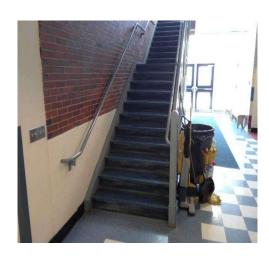



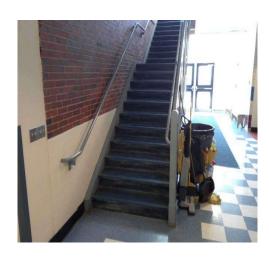

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 117

Run 2 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.50 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53877

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 117

Run 2 Right Handrail

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 8.00 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Costing Info (Estimated)


Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,


505.10.2

Record Number 53874

Stairway , Handrails : Handrail Height

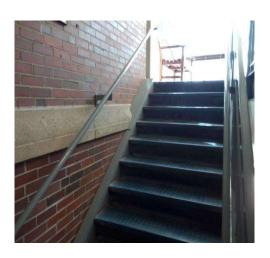

Stairway , Handrails $\,:\,$ Handrail Extension Length

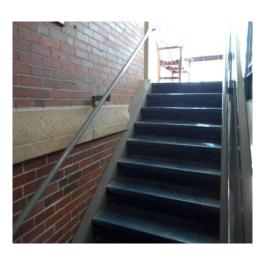

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 117

Run 2 Right Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53875

Stairs - Basement : Stairway , Handrails

Basement Stairs Next to 117

Run 2 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 33.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53876

Stairway , Handrails : Handrail Extension not Parallel







Stairs - Basement : Stairway , Run

Basement Stairs to Gymnasium Stage

Run 1

Finding

The width of the stairway does not meet the minimum required width.

On-Site Finding 33.00 inches

Recommendation

Install a stairway with a minimum width as required.

Recommendation At least 36,00 inches

Costing Info (Estimated)

Modify width \$4,816 Code Reference MA 20.3, ADA 210, 504

Record Number 52683

Stairs - Basement : Stairway , Handrails

Basement Stairs to Gymnasium Stage Run 1 Right Handrail

Finding

The diameter of the handrails is not within the required range.

On-Site Finding 2.50 inches

Recommendation

Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.

Recommendation 1.25 - 2.00 inches

Costing Info (Estimated)

Attach pipe railing to wall \$2,320

Code Reference MA 27.4.4, ADA 505, 504.6,

505.7.1

Record Number 52684 Stairway, Run: Stair Run Width



Stairway , Handrails : Handrail Diameter



Stairs - Basement : Stairway , Handrails

Basement Stairs to Gymnasium Stage Run 1 Right Handrail

Finding

The gripping surface of the handrail is interrupted.

On-Site Finding Interrupted

Recommendation

Remount the handrails so they are not interrupted. Otherwise, replace the handrails with ones that provide a smooth, uninterrupted gripping surface.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant handrail \$1,840

Code Reference MA 27.4.6, ADA 504, 505.6, 504.6

Record Number 52685

Stairs - Basement : Stairway , Handrails

Basement Stairs to Gymnasium Stage Run 1 Right Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.3,

504.6

Record Number 52686

Stairway , Handrails : Handrail Interrupted



Stairway , Handrails : No Bottom Handrail Extension



Stairs - Basement : Stairway , Handrails

Basement Stairs to Gymnasium Stage

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 30.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52687

Doors - Basement : Door , Hardware

Basement 002

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 52824

Stairway , Handrails : Handrail Height



 $\hbox{Door , Hardware }: \hbox{ Door Lock}$



Doors - Basement : Door , Hardware

Basement 003

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52647

Doors - Basement : Door , Clear Floor Space

Basement 003

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 51.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)


Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 52648

Door, Hardware: Door Lock



Door , Clear Floor Space : Front Approach Clear Floor Space Length

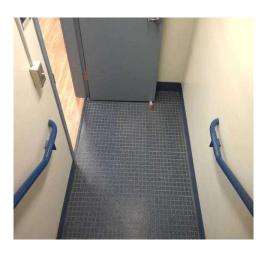

Doors - Basement : Door, Threshold

Basement 003 Exterior Next to Ramp

 ${\tt Door\ , Threshold\ :\ Door\ Threshold\ }$

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.62 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Provide smooth transition \$436

Code Reference MA 26.10, ADA 404, 404.2.5

Record Number 53064



Doors - Basement : Door , Latch Side Clearance

Basement 003 Exterior Next to Ramp

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 12.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 24.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Ramp Obstructs Clear Floor Space Length.

Record Number 53066

Door , Latch Side Clearance : Latch Approach Latch Side Clearance



Doors - Basement : Door , Latch Side Clearance

Basement 003 Exterior Next to Ramp

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 0.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 24.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53065

Doors - Basement : Door , Clear Floor Space

Basement 003 Exterior Next to Ramp Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 36.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53067

Door , Latch Side Clearance : Latch Approach Latch Side Clearance



Door , Clear Floor Space : Latch Approach Clear Floor Space Width



Doors - Basement : Door , Clear Floor Space

Basement 003 Exterior Next to Stairs Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 51.50 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 54.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 52874

Door , Clear Floor Space : Latch Approach Clear Floor Space Width



Doors - Basement : Door , Latch Side Clearance

Basement 003 Exterior Next to Stairs Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 0.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 24.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 52872

Door , Latch Side Clearance : Latch Approach Latch Side Clearance



Doors - Basement : Door , Clear Floor Space

Basement 003 Exterior Next to Stairs Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 36.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 52873

Doors - Basement : Door , Hardware

Basement 004

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 53853

Door , Clear Floor Space : Latch Approach Clear Floor Space Width







Doors - Basement : Door , Latch Side Clearance

Basement 004

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 7.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53854

Doors - Basement : Door , Hardware

Basement 004 Childrens Unisex Restroom Lever

Level

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 53868

Door , Latch Side Clearance : Front Approach Latch Side Clearance



 $\hbox{\tt Door , Hardware : Door Opening Pressure}$



Doors - Basement : Door , Latch Side Clearance

Basement 004 Childrens Unisex Restroom Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 3.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53870

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - Basement : Door , Latch Side Clearance

Basement 004 Childrens Unisex Restroom Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 4.50 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** ADA 404, 404.2.4, 404.2.4.1

Record Number 53869

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - Basement : Door, Threshold

Basement 004 Exterior

Door, Threshold: Door Threshold

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 4.00 inches

Recommendation

Modify or replace the threshold to provide the recommended height.


Recommendation Up to 0.50 inches

Costing Info (Estimated)

Provide smooth transition \$436

Code Reference MA 26.10, ADA 404, 404.2.5

Record Number 53803

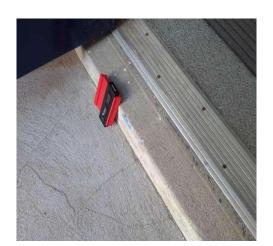

Doors - Basement : Door , Latch Side Clearance

Basement 004 Exterior

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 17.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Stair Obstructs Latch Side Clearance. Stair Obstructs Clear Floor Space Length.

Record Number 53804

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - Basement : Door , Clear Floor Space

Basement 004 Exterior

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 36.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)


Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Stair Obstructs Latch Side Clearance. Stair

Obstructs Clear Floor Space Length.

Record Number 53806

Door , Clear Floor Space : Front Approach Clear Floor Space Length

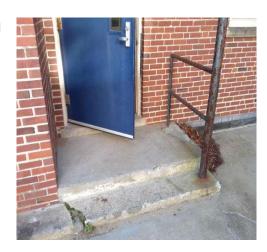

Doors - Basement : Door , Clear Floor Space

Basement 004 Exterior

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation


Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 53805

Door , Clear Floor Space : Floor Mat

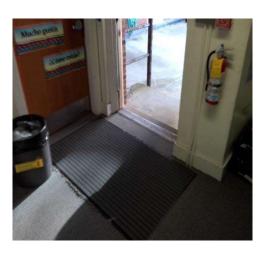

Doors - Basement : Door , Clear Floor Space

Basement 008 Girls Locker Room

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 49.50 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53702

Doors - Basement : Door , Hardware

Basement 008 Girls Locker Room

Push / Pull

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 53699

Door , Clear Floor Space : Front Approach Clear Floor Space Length



 $\hbox{\tt Door , Hardware : Door Opening Pressure}$



Doors - Basement : Door , Hardware

Basement 008 Girls Locker Room

Push / Pull

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 53700

Doors - Basement : Door , Clear Floor Space

Basement 008 Girls Locker Room

Push Side

Finding

There is no level landing at this door.

On-Site Finding 3.30 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Correct slopes \$1,500

Code Reference MA 26.6, ADA 302, 404, 305,

404.2.4.4

Record Number 53701

Door, Hardware: Door Lock







Doors - Basement : Door , Hardware

Basement 009

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 9.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 54089



Door, Hardware: Door Opening Pressure

Doors - Basement : Door , Latch Side Clearance

Basement 009

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 1.50 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** ADA 404, 404.2.4, 404.2.4.1

Record Number 54090

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - Basement : Door , Clear Floor Space

Basement 010 Boys Locker Room

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 41.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53706

Doors - Basement : Door , Hardware

Basement 010 Boys Locker Room

Push / Pull

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 53703

Door , Clear Floor Space : Front Approach Clear Floor Space Length







Doors - Basement : Door , Hardware

Basement 010 Boys Locker Room

Push / Pull

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 53704

Doors - Basement : Door , Clear Floor Space

Basement 010 Boys Locker Room

Push Side

Finding

There is no level landing at this door.

On-Site Finding 3.20 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Correct slopes \$1,500

Code Reference MA 26.6, ADA 302, 404, 305,

404.2.4.4

Record Number 53705

Door, Hardware: Door Lock



 ${\bf Door\ ,\ Clear\ Floor\ Space\ :\ Floor\ Surface\ Slope}$



Doors - Basement : Door , Hardware

Basement 101

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 52780

Doors - Basement : Door , Latch Side Clearance

Basement 101 Exterior

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 5.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 52895

Door, Hardware: Door Lock



Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - Basement : Door , Hardware

Basement 102

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 7.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 53027

Doors - Basement : Door , Hardware

Basement 102

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 53028

Door, Hardware: Door Opening Pressure



Door , Hardware : Door Lock



Doors - Basement : Door

Basement 102

Lever

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)

Remove door stop \$50

Code Reference ADA 404, 404.2.10

Record Number 53029



Door : Door Hardware

Doors - Basement : Door , Latch Side Clearance

Basement 102

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 16.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Cabinet Obstructs Latch Side Clearance.

Record Number 53031

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - Basement : Door , Latch Side Clearance

Basement 102

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 0.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** ADA 404, 404.2.4, 404.2.4.1

Record Number 53030

Doors - Basement : Door, Threshold

Basement 102 Exterior

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.62 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Provide smooth transition \$436

Code Reference MA 26.10, ADA 404, 404.2.5

Record Number 53129

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Door, Threshold: Door Threshold



Doors - Basement : Door , Latch Side Clearance

Basement 102 Exterior

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 2.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53130

Doors - Basement : Door , Hardware

Basement 104

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation


Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 53117

Door , Latch Side Clearance : Front Approach Latch Side Clearance

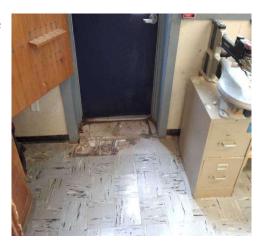

 ${\sf Door}\;,\,{\sf Hardware}\;:\;{\sf Door}\;{\sf Lock}$



Doors - Basement : Door , Latch Side Clearance

Basement 104

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 13.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Lockers Obstructs Latch Side Clearance.

Record Number 53118

Doors - Basement : Door, Hardware Height

Basement 104 from 101

Lever

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 49.00 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 48.00 inches


Costing Info (Estimated)

Replace door hardware \$280

Code Reference ADA 404, 404.2.7

Record Number 52982

Door , Latch Side Clearance : Front Approach Latch Side Clearance

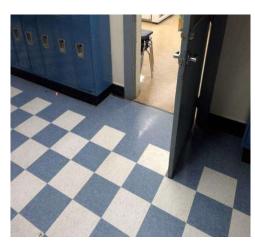

Door , Hardware Height : Height



Doors - Basement : Door , Hardware

Basement 104 from 101

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52983

Doors - Basement : Door , Latch Side Clearance

Basement 104 from 101

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 1.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Sink Obstructs Latch Side Clearance.

Record Number 52984

Door, Hardware: Door Lock



Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - Basement : Door , Hardware

Basement 107 Cafeteria - Left

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52768

Doors - Basement : Door , Latch Side Clearance

Basement 107 Cafeteria - Left

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 10.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Lockers Obstructs Latch Side Clearance.

Record Number 52769

Door, Hardware: Door Lock







Doors - Basement : Door , Hardware

Basement 107 Cafeteria - Right

Lever

Door, Hardware: Door Lock

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52934

Doors - Basement : Door , Hardware Height

Basement 107 from 104

Lever

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 49.00 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 48.00 inches


Costing Info (Estimated)

Replace door hardware \$280

Code Reference ADA 404, 404.2.7

Record Number 52708



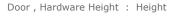



Doors - Basement : Door , Hardware

Basement 107 from 104

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52709

Doors - Basement : Door, Threshold

Basement 107 from 104

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 0.75 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Provide smooth transition \$436

Code Reference MA 26.10, ADA 404, 404.2.5

Record Number 52710

Door, Hardware: Door Lock



 ${\tt Door\ , Threshold\ :\ Door\ Threshold\ }$



Doors - Basement : Door , Latch Side Clearance

Basement 107 from 104

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 1.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Cabinet Obstructs Latch Side Clearance.

Record Number 52711

Doors - Basement : Door , Clear Floor Space

Basement 107 from 104

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 27.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches


Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4


Notes: Table Obstructs Clear Floor Space Length.

Record Number 52712

Door , Latch Side Clearance : Front Approach Latch Side Clearance

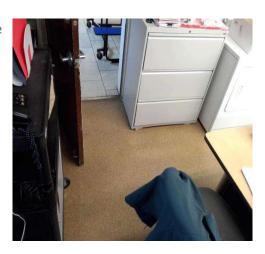

Door , Clear Floor Space : Front Approach Clear Floor Space Length

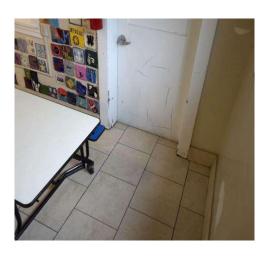

Doors - Basement : Door , Hardware

Basement 111

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 11.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 52798

Doors - Basement : Door , Hardware

Basement 111

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation


Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 52799

Door, Hardware: Door Opening Pressure

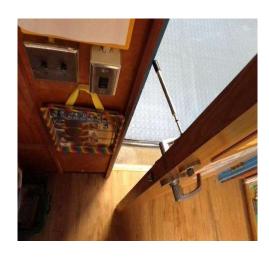





Doors - Basement : Door , Latch Side Clearance

Basement 111

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 13.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4 Notes: Cubbies Obstruct Latch Side Clearance.

Record Number 52800

Doors - Basement : Door , Hardware

Basement 111 Exterior

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding 7.00 inches

Recommendation

Finding

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation At least 10.00 inches


Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 52792

Door , Latch Side Clearance : Front Approach Latch Side Clearance

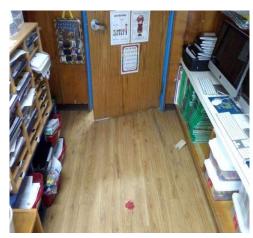

Door , Hardware : Bottom Door Panel Height



Doors - Basement : Door, Threshold

Basement 111 Exterior

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 1.25 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Provide smooth transition \$436

Code Reference MA 26.10, ADA 404, 404.2.5

Record Number 52793



Door, Threshold: Door Threshold

Doors - Basement : Door , Clear Floor Space

Basement 111 Exterior

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 7.50 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Cabinet Obstructs Clear Floor Space Length.

Record Number 52794

Door , Clear Floor Space : Front Approach Clear Floor Space Length $\,$



Doors - Basement : Door , Hardware

Basement 113

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 7.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 52704

Doors - Basement : Door , Hardware

Basement 113

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310


Code Reference ADA 404.2.7, 309.4

Record Number 52705

Door, Hardware: Door Opening Pressure



Door , Hardware : Door Lock

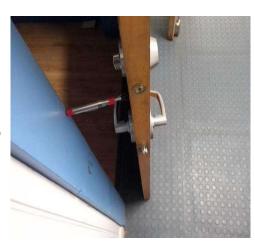

Doors - Basement : Door , Hardware

Basement 117

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 7.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 52878

Doors - Basement : Door , Hardware

Basement 117

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310


Code Reference ADA 404.2.7, 309.4

Record Number 52879

Door, Hardware: Door Opening Pressure



Door , Hardware : Door Lock

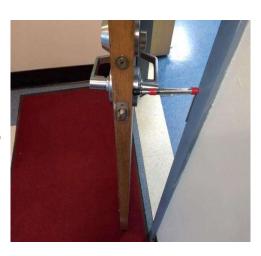

Doors - Basement : Door , Latch Side Clearance

Basement 117

Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 6.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 52881

Doors - Basement : Door , Clear Floor Space

Basement 117

Pull Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 52883

Door , Latch Side Clearance : Front Approach Latch Side Clearance







Doors - Basement : Door , Latch Side Clearance

Basement 117

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 7.50 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921

Code Reference ADA 404, 404.2.4, 404.2.4.1

Notes: Refrigerator Obstructs Clear Floor Space Length.

Record Number 52880

Doors - Basement : Door , Clear Floor Space

Basement 117

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 42.00 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Refrigerator Obstructs Clear Floor Space Length.

Record Number 52882

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Door , Clear Floor Space : Front Approach Clear Floor Space Length



Doors - Basement : Door , Clear Floor Space

Basement 117 Childrens Unisex Restroom Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 49.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Lavatory Obstructs Clear Floor Space Length.

Record Number 52876

Doors - Basement : Door , Hardware

Basement 117 Exterior

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding 7.00 inches

Recommendation

Finding

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation At least 10.00 inches

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 53094

Door , Clear Floor Space : Front Approach Clear Floor Space Length



Door , Hardware : Bottom Door Panel Height



Doors - Basement : Door , Hardware

Basement 118

Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 52739

Doors - Basement : Door , Hardware

Basement 118

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 52740

Door, Hardware: Door Opening Pressure



Door , Hardware : Door Lock



Doors - Basement : Door , Clear Floor Space

Basement 118

Pull Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 52744

Door, Clear Floor Space: Floor Mat

Doors - Basement : Door , Latch Side Clearance

Basement 118

Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 7.50 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** ADA 404, 404.2.4, 404.2.4.1

Notes: Refrigerator Obstructs Clear Floor Space Length.

Record Number 52741

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - Basement : Door , Clear Floor Space

Basement 118

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 41.50 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Refrigerator Obstructs Clear Floor Space Length.

Record Number 52743

Doors - Basement : Door , Clear Floor Space

Basement 118 Childrens Unisex Restroom Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 47.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921

Code Reference MA 26.6, ADA 404, 404.2.4

Notes: Lavatory Obstructs Clear Floor Space Length.

Record Number 53156

Door , Clear Floor Space : Front Approach Clear Floor Space Length



Door , Clear Floor Space : Front Approach Clear Floor Space Length



Doors - Basement : Door, Hardware

Basement 118 Exterior

Door , Hardware : Bottom Door Panel Height

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding 7.00 inches

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation At least 10.00 inches

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 53034

Doors - Basement : Door , Clear Floor Space

Basement 118 Exterior

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 53035



Door , Clear Floor Space : Floor Mat



Doors - Basement : Door , Hardware Height

Basement 118 from 117

Lever

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 49.00 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 48.00 inches

Costing Info (Estimated)

Replace door hardware \$280

Code Reference ADA 404, 404.2.7

Record Number 52929

Doors - Basement : Door , Hardware

Basement 118 from 117

Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 52930

Door , Hardware Height : Height



 $\hbox{Door , Hardware }: \hbox{ Door Lock}$



Doors - Basement : Door , Clear Floor Space

Basement 118 from 117

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 43.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Book Shelf Obstructs Clear Floor Space Length.

Record Number 52932

Doors - Basement : Door , Clear Floor Space

Basement 118 from 117

Pull Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface.

Code Reference ADA 403.2, 302.1

Notes: Book Shelf Obstructs Clear Floor Space Length.

Record Number 52933

Door , Clear Floor Space : Front Approach Clear Floor Space Length



Door , Clear Floor Space $\,:\,$ Floor Mat



Doors - Basement : Door , Clear Floor Space

Basement 118 from 117

Push Side

Finding

There is not enough clear floor space provided at the push side of the door .

On-Site Finding 7.50 inches

Recommendation

Provide the recommended clear floor space on the push side of the door.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install automatic door opener \$4,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Book Shelf Obstructs Clear Floor Space Length.

Record Number 52931

Door , Clear Floor Space : Front Approach Clear Floor Space Length



Doors - Basement : Door , Clear Floor Space

Basement Boys Restroom Next to 108 Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 54.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921

Code Reference MA 26.6, ADA 404, 404.2.4

Notes: Partition Obstructs Clear Floor Space Length.

Record Number 52775

Door , Clear Floor Space : Front Approach Clear Floor Space Length



Doors - Basement : Door , Clear Floor Space

Basement Boys Restroom Next to 108 Pull Side

Finding

There is no level landing at this door.

On-Site Finding 3.10 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Correct slopes \$1,500

Code Reference MA 26.6, ADA 302, 404, 305,

404.2.4.4

Notes: Partition Obstructs Clear Floor Space Length.

Record Number 52776



Basement Boys Restroom Next to 108

Push / Pull

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 51.00 inches

Recommendation

Mount the door hardware at the recommended height.

Recommendation 34.00 - 48.00 inches

Costing Info (Estimated)


Replace door hardware \$280

Code Reference ADA 404, 404.2.7

Record Number 52771

Door, Clear Floor Space: Floor Surface Slope



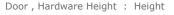



Doors - Basement : Door , Hardware

Basement Boys Restroom Next to 108 Push / Pull

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310 **Code Reference** ADA 404.2.7, 309.4

Record Number 52772

Doors - Basement: Door

Basement Boys Restroom Next to 108 Push / Pull

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)

Remove door stop \$50

Code Reference ADA 404, 404.2.10

Record Number 52773

Door, Hardware: Door Lock



Door : Door Hardware



Doors - Basement : Door , Clear Floor Space

Basement Boys Restroom Next to 108

Push Side

Finding

There is no level landing at this door.

On-Site Finding 3.60 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Correct slopes \$1,500

Code Reference MA 26.6, ADA 302, 404, 305,

404.2.4.4

Record Number 52774

Doors - Basement : Door , Hardware

Basement Entrance Next to 101

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding 7.00 inches

Recommendation

Finding

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation At least 10.00 inches

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 52986

Door , Clear Floor Space : Floor Surface Slope



Door , Hardware : Bottom Door Panel Height



Doors - Basement : Door , Clear Floor Space

Basement Entrance Next to 101

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 52987

Doors - Basement : Door, Hardware

Basement Entrance Next to 118

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding 7.00 inches

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation At least 10.00 inches

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 53096

Door, Clear Floor Space: Floor Mat



 $\hbox{Door , Hardware} \ : \ \hbox{Bottom Door Panel Height}$



Doors - Basement : Door , Clear Floor Space

Basement Entrance Next to 118

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 53097

Door , Clear Floor Space : Floor Mat



Doors - Basement : Door , Hardware Height

Basement Girls Restroom Next to 106

Push / Pull

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 50.50 inches

Recommendation

Mount the door hardware at the recommended height.


Recommendation 34.00 - 48.00 inches

Costing Info (Estimated)

Replace door hardware \$280

Code Reference ADA 404, 404.2.7

Record Number 52897

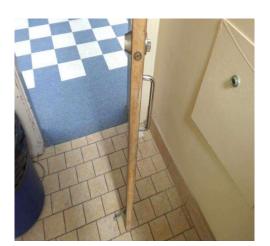

Door , Hardware Height : Height

Doors - Basement : Door , Hardware

Basement Girls Restroom Next to 106 Push / Pull

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 52898

Doors - Basement : Door

Basement Girls Restroom Next to 106 Push / Pull

,

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)

Remove door stop \$50

Code Reference ADA 404, 404.2.10

Record Number 52899

Door, Hardware: Door Lock



Door : Door Hardware



Doors - Basement : Door , Hardware

Basement Gymnasium Entrance from Ramp

Door , Hardware : Bottom Door Panel Height

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding 7.00 inches

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation At least 10.00 inches

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 52745

Doors - Basement : Door , Latch Side Clearance

Basement Gymnasium Entrance from Ramp Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 2.50 inches


Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

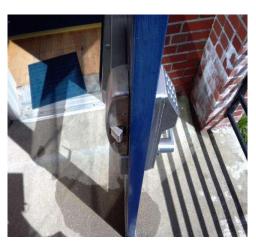





Doors - Basement : Door , Clear Floor Space

Basement Gymnasium Entrance from Ramp Push Side

Door, Clear Floor Space: Floor Mat

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 52747

Doors - Basement : Door , Hardware

Basement Gymnasium Entrance from Stairs



Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding 7.00 inches

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation At least 10.00 inches

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10





Doors - Basement : Door, Threshold

Basement Gymnasium Entrance from Stairs

Door , Threshold : Door Threshold

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 6.00 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Provide smooth transition \$436

Code Reference MA 26.10, ADA 404, 404.2.5

Record Number 52754



Doors - Basement : Door , Clear Floor Space

Basement Gymnasium Entrance from Stairs Pull Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 52755



Door, Clear Floor Space: Floor Mat

Doors - Basement : Door , Hardware

Basement Gymnasium Entrance Next to Stage Push Bar Only

Door , Hardware : Non-Accessible Hardware

Finding

The door opening hardware is not accessible.

On-Site Finding Not Accessible

Recommendation

Provide accessible hardware on the door.

Recommendation See Recommendation

Costing Info (Estimated)

Replace existing lock set with lever \$800 handled lock set

Code Reference ADA 404.2.7, 309.4

Record Number 52664

Doors - Basement : Door, Threshold

Basement Gymnasium Entrance Next to Stage

Door , Threshold : Door Threshold



The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 5.00 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Provide smooth transition \$436

Code Reference MA 26.10, ADA 404, 404.2.5



Doors - Basement : Door , Latch Side Clearance

Basement Gymnasium Entrance Next to Stage Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 5.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Stairs Obstructs Clear Floor Space Length.

Record Number 52667

Doors - Basement : Door , Clear Floor Space

Basement Gymnasium Entrance Next to Stage Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 51.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Stairs Obstructs Clear Floor Space Length.

Record Number 52668

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Door , Clear Floor Space : Front Approach Clear Floor Space Length



Doors - Basement : Door , Latch Side Clearance

Basement Gymnasium Entrance Next to Stage Push Side

Finding

There is less than the required latch side clearance on the push side of the door.

On-Site Finding 0.00 inches

Recommendation

Provide the recommended latch side clearance on the push side of the door. Otherwise, install an automatic door opening device.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 52666

Doors - Basement : Door

Basement Gymnasium Next to Ramp Push / Pull

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)

Remove door stop \$50

Code Reference ADA 404, 404.2.10

Record Number 52706

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Door : Door Hardware



Doors - Basement : Door , Clear Floor Space

Basement Gymnasium Next to Ramp

Push Side

Door , Clear Floor Space : Floor Surface Slope

Finding

There is no level landing at this door.

On-Site Finding 13.10 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Correct slopes \$1,500

Code Reference MA 26.6, ADA 302, 404, 305,

404.2.4.4

Record Number 52707



Doors - Basement : Door , Clear Floor Space

Basement Gymnasium Stage

Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 46.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.


Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Stair Obstructs Clear Floor Space Length.



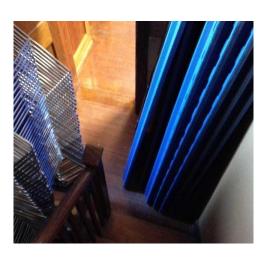

Doors - Basement : Door , Hardware

Basement Gymnasium Stage

Single Knob

Finding

The door opening hardware is not accessible.

On-Site Finding Not Accessible

Recommendation

Provide accessible hardware on the door.

Recommendation See Recommendation

Costing Info (Estimated)

Replace existing lock set with lever \$800 handled lock set

Code Reference ADA 404.2.7, 309.4

Record Number 53160 Door, Hardware: Non-Accessible Hardware



Doors - Basement : Door , Hardware Height

Basement Gymnasium Stage

Single Knob

Finding

Door hardware is not mounted at the correct height.

On-Site Finding 56.50 inches

Recommendation


Mount the door hardware at the recommended height.

Recommendation 34.00 - 48.00 inches

Costing Info (Estimated)

Replace door hardware \$280

Code Reference ADA 404, 404.2.7

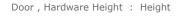



Doors - Basement : Door , Hardware

Basement Gymnasium Stage

Single Knob

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 53162

Doors - Basement : Door , Hardware

Basement Hallway Next to 101

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 52864

Door, Hardware: Door Lock



Door , Hardware : Door Opening Pressure



Doors - Basement : Door , Hardware

Basement Hallway Next to 101

Push Bar / Lever

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 52865

Doors - Basement : Door , Hardware

Basement Hallway Next to 111

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 52658

Door, Hardware: Bottom Door Panel







Doors - Basement : Door , Hardware

Basement Hallway Next to 111

Push Bar / Lever

Door , Hardware : Bottom Door Panel

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 52659

Doors - Basement : Door , Hardware

Basement Hallway Next to Elevator

Push Bar / Lever

Finding

The door opening force for this door is greater than allowed.

On-Site Finding 10.00 pounds

Recommendation

Adjust the closer on the door to meet the door opening force requirements.

Recommendation Up to 5.00 pounds

Costing Info (Estimated)

Adjust door closer pressure \$25

Code Reference MA 26.8, ADA 404, 404.2.9

Record Number 53164



 $\hbox{Door , Hardware} \ : \ \hbox{Door Opening Pressure}$



Doors - Basement : Door , Hardware

Basement Hallway Next to Elevator

Push Bar / Lever

Door, Hardware: Bottom Door Panel

Finding

The bottom of the door does not provide a smooth, uninterrupted surface, or panel to allow the door to be opened by a wheelchair footrest without creating a trap or hazardous condition.

On-Site Finding None Found

Recommendation

Install a panel or replace the door to provide a smooth, uninterrupted surface at the bottom of the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install compliant door \$2,000

Code Reference ADA 404, 404.2.10

Record Number 53165

Signage - Basement : Signage

Basement 002

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2



Signage $\,:\,$ No Room Identification



Signage - Basement : Signage

Basement 003

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 61.00 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52796

Signage - Basement : Signage

Basement 003 Exterior Next to Ramp

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52896



Signage : Highest Tactile Character Height





Signage - Basement : Signage

Basement 003 Exterior Next to Stairs

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52935

Signage - Basement : Signage

Basement 004

FindingHighest line of tactile characters are not at a compliant

height.

On-Site Finding 60.25 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 53802



Signage : Highest Tactile Character Height



Signage - Basement : Signage

Basement 004 Exterior

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 54044

Signage - Basement : Signage

Basement 009

Signage : Highest Tactile Character Height

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 61.00 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1





Signage - Basement : Signage

Basement 101

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 61.00 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52703

Signage - Basement : Signage

Basement 101 Exterior

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52734



Signage : Highest Tactile Character Height





Signage - Basement : Signage

Basement 102

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 61.25 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52672

Signage - Basement : Signage

Basement 102 Exterior

FindingThere is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53036

Signage : Highest Tactile Character Height



Signage $\,:\,$ No Room Identification



Signage - Basement : Signage

Basement 104

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 61.25 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52918

Signage - Basement : Signage

Basement 104 from 101

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.


Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52820

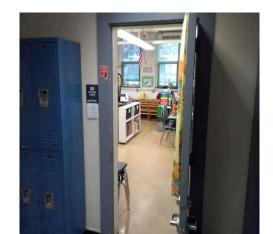

Signage : Highest Tactile Character Height

Signage $\,:\,$ No Room Identification



Signage - Basement : Signage

Basement 107 Cafeteria - Left

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52688

Signage - Basement : Signage

Basement 107 Cafeteria - Right

Highest line of tactile characters are not at a compliant height.

On-Site Finding 60.25 inches

Recommendation

Finding

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1







Signage - Basement : Signage

Basement 107 from 104

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52673

Signage - Basement : Signage

Basement 111

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 61.00 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1



Signage : Highest Tactile Character Height



Signage - Basement : Signage

Basement 111 Exterior

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52904

Signage - Basement : Signage

Basement 113

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 61.00 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1



Signage : Highest Tactile Character Height



Signage - Basement : Signage

Basement 117

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 60.25 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52980

Signage - Basement : Signage

Basement 117 Exterior

There is no room identification signage.

On-Site Finding None Found

Recommendation

Finding

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52779



Signage : Highest Tactile Character Height





Signage - Basement : Signage

Basement 118

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 60.25 inches

Recommendation

Provide compliant signage at the location.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 52871

Signage - Basement : Signage

Basement 118 Exterior

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2









Signage - Basement : Signage

Basement 118 from 117

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52653

Signage - Basement : Signage

Basement Entrance Next to 101



Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2





Signage - Basement : Signage , Signage

Basement Entrance Next to 110

Finding

There is no room signage.

On-Site Finding None Found

Recommendation

Install accessible room signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 216.2, 216.6

Record Number 52702

Signage - Basement : Signage

Basement Entrance Next to 118

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52789

Signage , Signage : No Accessible Element/Entrance Signage



Signage : No Room Identification



Signage - Basement : Signage

Basement Gymnasium 001 Next to 004

Signage : Clear Floor Space/Door Swing

Finding

Clear floor space of at least 18"x18" is not centered at the signage and/or is within the swing of the door.

On-Site Finding Not Compliant

Recommendation

Provide at least 18"x18" of clear floor space centered at the signage. Make sure it is not located within the door swing.

Recommendation See Recommendation

Costing Info (Estimated)

Unassigned

Code Reference ADA 703.4.2

Record Number 56306

Signage - Basement : Signage

Basement Gymnasium Entrance from Ramp

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2





Signage - Basement : Signage

Basement Gymnasium Entrance from Stairs

Signage: No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53074

Signage - Basement : Signage

Basement Gymnasium Entrance Next to Stage

Signage $\,:\,$ No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2





Signage - Basement : Signage

Basement Gymnasium Next to Ramp

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53098

Signage - Basement : Signage

Basement Gymnasium Stage

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2



Signage $\,:\,$ No Room Identification



Signage - Basement : Signage

Basement Hallway Next to 101

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52660

Signage - Basement : Signage

Basement Hallway Next to 111

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2



Signage - Basement : Signage

Basement Hallway Next to Elevator

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 52939



Basement 004 Childrens Unisex Restroom

Feminine Products

Restroom , Dispensers : Dispenser Operation

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 39.5, ADA 309, 205, 309.4



Restrooms - Basement : Restroom , Lavatory

Basement 004 Childrens Unisex Restroom Lavatory

Finding

The height of the counter surface of the lavatory designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 31.62 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation Up to 30.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.16.2, ADA 213, 606, 606.2

Record Number 53722

Restrooms - Basement : Restroom , Lavatory

Basement 004 Childrens Unisex Restroom Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Costing Info (Estimated)


Wrap supply lines \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 53723

Restroom , Lavatory : Lavatory Surface Height



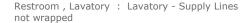



Restrooms - Basement : Restroom , Dispensers

Basement 004 Childrens Unisex Restroom

Paper Towel

Restroom , Dispensers : Dispenser Height

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 41.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 53720



Restrooms - Basement : Restroom , Dispensers

Basement 004 Childrens Unisex Restroom

Soap

Restroom , Dispensers : Dispenser Height

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 44.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1



Restrooms - Basement : Restroom , Mirror

Basement 004 Childrens Unisex Restroom

Restroom , Mirror : Mirror Bottom Edge Height

Finding

The bottom edge of the reflective surface of the mirror in the restroom is is not at a compliant height for the primary age group.

On-Site Finding 39.00 inches

Recommendation

Lower the mirror in the restroom so that the bottom edge of the reflective surface is no higher than recommended above the finish floor.

Recommendation Up to 31.00 inches

Costing Info (Estimated)

Lower mirror \$291

Code Reference MA 30.18, ADA 603, 213, 603.3

Record Number 53724

Restrooms - Basement : Restroom , Wall Signage

Basement 004 Childrens Unisex Restroom

Wall Sign

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.


Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.8



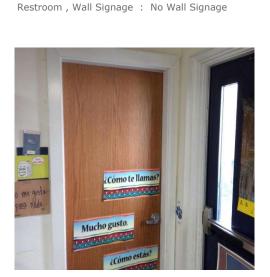

Restrooms - Basement : Restroom , Toilet

Basement 004 Childrens Unisex Restroom

Restroom , Toilet : Toilet Seat Height

Finding

The height of the toilet seat in the restroom is greater than the allowed maximum height for use by the primary age group.

On-Site Finding 18.25 inches

Recommendation

Adjust or modify the height of the toilet seat in the restroom to the required height for use by the primary age group.

Recommendation 11.00 - 17.00 inches

Costing Info (Estimated)

Modify fixture \$1,707

Code Reference MA 30.14.3, ADA 603, 604.9.3

Record Number 53732

Restrooms - Basement : Restroom , Grab Bars

Basement 004 Childrens Unisex Restroom

 $Restroom\ ,\ Grab\ Bars\ :\ Side\ Grab\ Bar\ Height$

Finding

The height of the side grab bar in the compartment designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 34.00 inches

Recommendation

Remount the side grab bar in the compartment designated to be accessible in the restroom at to the required height for use by the primary age group.

Recommendation 25.00 inches

Costing Info (Estimated)

Adjust grab bar height \$78

Code Reference MA 30.15.1, ADA 609, 604.9, 609.4





Restrooms - Basement : Restroom , Grab Bar

Basement 004 Childrens Unisex Restroom

Restroom , Grab Bar : Rear Grab Bar Location

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Costing Info (Estimated)

Provide a compliant back grab bar. \$267

Code Reference ADA 604.5.2

Record Number 53735



Restrooms - Basement : Restroom , Grab Bars

Basement 004 Childrens Unisex Restroom

Restroom , Grab Bars : Restroom - Grab Bar Height

Finding

The grab bar on the rear wall is not at the correct height.

On-Site Finding 33.50 inches

Recommendation

Remount the rear grab bar in the compartment designated to be accessible so the height of the gripping surface is at the correct height.

Recommendation 20.00 - 25.00 inches

Costing Info (Estimated)

Provide compliant grab bars \$231 **Code Reference** ADA 213, 604, 604.9



Restrooms - Basement : Restroom , Toilet Compartment

Basement 004 Childrens Unisex Restroom

Finding

The toilet paper dispenser interferes with the use of the grab bar.

On-Site Finding Interferes

Recommendation

Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.7.6, ADA 603, 609.3

Record Number 53737

Restrooms - Basement : Restroom

Basement 004 Childrens Unisex Restroom

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Costing Info (Estimated)

Replace existing lock set with lever \$804 handled lock set

Code Reference ADA 213, 213.2.1

Record Number 56308

Restroom , Toilet Compartment : Toilet Paper Dispenser Interferes with Grab Bar



Restroom : No Door Privacy Lock and Occupied Indicator



Restrooms - Basement : Restroom , Toilet Compartment

Basement 004 Childrens Unisex Restroom

Restroom , Toilet Compartment : No Coat Hook

Available

Finding

There is no required coat hook.

On-Site Finding None Found

Recommendation

Install a coat hook at the recommended height.

Recommendation See Recommendation

Costing Info (Estimated)

Install coat hook \$34 Code Reference MA 30.6.1,MA 30.6.2

Record Number 53731

Restrooms - Basement : Restroom , Toilet

Basement 008 Girls Locker Room

The height of the toilet seat in the restroom is greater than the allowed maximum height for use by the primary age group.

On-Site Finding 18.50 inches

Recommendation

Finding

Adjust or modify the height of the toilet seat in the restroom to the required height for use by the primary age group.

11.00 - 17.00 inches Recommendation

Costing Info (Estimated)

Modify fixture \$1,707

Code Reference MA 30.14.3, ADA 603, 604.9.3

Record Number 53812



Restroom , Toilet : Toilet Seat Height



Restrooms - Basement : Restroom , Toilet

Basement 008 Girls Locker Room

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 41.50 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Costing Info (Estimated)

Relocate fixture \$2,500 **Code Reference** MA 30.7.2, ADA 603, 604.2

Record Number 53814

Restrooms - Basement : Restroom , Grab Bars

Basement 008 Girls Locker Room

Finding

The distance from the rear wall to the side grab bar is greater than allowed.

On-Site Finding 13.00 inches

Recommendation

Remount the side grab bar so it meets the distance requirements from the back wall.

Recommendation Up to 12.00 inches

Costing Info (Estimated)

Provide compliant grab bar \$267

Code Reference MA 30.8.1, ADA 603, 609, 604.5.1

Record Number 53815

Restroom , Toilet : Toilet Minimum Distance From Any fixture







Restrooms - Basement : Restroom , Grab Bars

Basement 008 Girls Locker Room

Restroom , Grab Bars : Side Grab Bar Height

Finding

The height of the side grab bar in the compartment designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 33.25 inches

Recommendation

Remount the side grab bar in the compartment designated to be accessible in the restroom at to the required height for use by the primary age group.

Recommendation 25.00 inches

Costing Info (Estimated)

Adjust grab bar height \$78

Code Reference MA 30.15.1, ADA 609, 604.9, 609.4

Record Number 53816

Restrooms - Basement : Restroom , Grab Bar

Basement 008 Girls Locker Room

Restroom , Grab Bar : Rear Grab Bar Location

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Costing Info (Estimated)

Provide a compliant back grab bar. \$267

Code Reference ADA 604.5.2





Restrooms - Basement : Restroom , Grab Bars

Basement 008 Girls Locker Room

Restroom , Grab Bars : Restroom - Grab Bar Height

Finding

The grab bar on the rear wall is not at the correct height.

On-Site Finding 33.75 inches

Recommendation

Remount the rear grab bar in the compartment designated to be accessible so the height of the gripping surface is at the correct height.

Recommendation 20.00 - 25.00 inches

Costing Info (Estimated)

Provide compliant grab bars \$231 **Code Reference** ADA 213, 604, 604.9

Record Number 53818



Restrooms - Basement : Restroom , Compartment Door

Basement 008 Girls Locker Room

Restroom , Compartment Door : Compartment Door Handle

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Costing Info (Estimated)

Install accessible handle on stall door \$250

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 604.8.1.2, 604.8



Restrooms - Basement : Restroom , Compartment Door

Basement 008 Girls Locker Room

Restroom , Compartment Door : Compartment

Door

Finding

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

604.8.1.2, 604.8



Restrooms - Basement : Restroom , Compartment Door

Basement 008 Girls Locker Room

Finding

The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.

On-Site Finding Not Accessible

Recommendation

Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.

Recommendation See Recommendation

Costing Info (Estimated)

Add accessible hardware to existing \$289 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

404.2.7, 309.4, 604.8

Record Number 53821

Restroom , Compartment Door : Compartment Door Latch



Restrooms - Basement : Restroom , Compartment Door

Basement 008 Girls Locker Room

Finding

The compartment door hardware is not at a compliant height.

On-Site Finding 40.00 inches

Recommendation

Remove and relocate the door hardware.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 404.2.7, 604.8

Record Number 53822

Restrooms - Basement : Restroom

Basement 008 Girls Locker Room

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 11.25 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Provide clearance \$2,200

Code Reference ADA 404, 604.8.1.2, 604.8.2.2,

404.2.4.1

Record Number 53823

Restroom , Compartment Door : Compartment Door Handle Height



Restroom : Front Approach Latch Side Clearance



Restrooms - Basement : Restroom , Toilet Compartment

Basement 008 Girls Locker Room

Finding

The location of the toilet paper dispenser in the restroom primarily used by children is not within recommended values of the front edge of the toilet seat.

On-Site Finding 4.00 inches

Recommendation

Remount the toilet paper dispenser in the restroom so that it is within the recommended values from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.14.5, ADA 603, 604.9.6

Record Number 53824

Restrooms - Basement : Restroom , Toilet Compartment

Basement 008 Girls Locker Room

Finding

The toilet paper dispenser interferes with the use of the grab bar.

On-Site Finding Interferes

Recommendation

Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.

Recommendation See Recommendation


Costing Info (Estimated)

Provide compliant dispenser \$277 **Code Reference** MA 30.7.6, ADA 603, 609.3

Record Number 53825

Restroom , Toilet Compartment : Toilet Paper Dispenser Distance From Seat



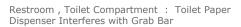



Restrooms - Basement : Restroom , Dispensers

Basement 008 Girls Locker Room

Feminine Products

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 40.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches


Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 54076

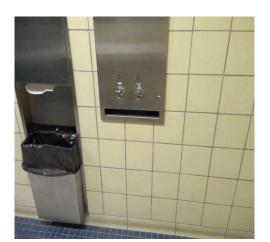

Restroom , Dispensers : Dispenser Height

Restrooms - Basement : Restroom , Dispensers

Basement 008 Girls Locker Room

Feminine Products

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 39.5, ADA 309, 205, 309.4

Record Number 54077



Restroom , Dispensers : Dispenser Operation

Restrooms - Basement : Restroom , Lavatory

Basement 008 Girls Locker Room

Lavatory

Finding

The height of the counter surface of the lavatory designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 32.00 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation Up to 30.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.16.2, ADA 213, 606, 606.2

Record Number 54080



Basement 008 Girls Locker Room

Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Costing Info (Estimated)


Wrap pipes \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 54081

Restroom , Lavatory : Lavatory Surface Height



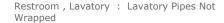



Restrooms - Basement : Restroom , Lavatory

Basement 008 Girls Locker Room

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap supply lines \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 54082

Restrooms - Basement : Restroom , Dispensers

Basement 008 Girls Locker Room

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 41.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 54079

Restroom , Lavatory : Lavatory - Supply Lines not wrapped





Restroom , Dispensers : Dispenser Height

Restrooms - Basement : Restroom , Dispensers

Basement 008 Girls Locker Room

Soap

Restroom , Dispensers : Dispenser Height

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 44.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 54078

Restrooms - Basement : Restroom , Mirror

Basement 008 Girls Locker Room

Restroom , Mirror : Mirror Bottom Edge Height

Finding

The bottom edge of the reflective surface of the mirror in the restroom is is not at a compliant height for the primary age group.

On-Site Finding 42.50 inches

Recommendation

Lower the mirror in the restroom so that the bottom edge of the reflective surface is no higher than recommended above the finish floor.

Recommendation Up to 31.00 inches

Costing Info (Estimated)

Lower mirror \$291

Code Reference MA 30.18, ADA 603, 213, 603.3



Restrooms - Basement : Restroom , Wall Signage

Basement 008 Girls Locker Room

Wall Sign

Finding

There is no signage with the International Symbol of Accessibility.

On-Site Finding None Found

Recommendation

Install signage that includes the International Symbol of Accessibility (ISA Symbol).

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.8,

703.7

Record Number 54084

Restroom , Wall Signage : International Symbol of Accessibility



Restrooms - Basement : Restroom , Toilet Compartment

Basement 008 Girls Locker Room

Finding

There is insufficient clear floor space in the compartment.

On-Site Finding 59.50 inches

Recommendation

Modify or replace the compartment to provide adequate clear floor space.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install accessible stall \$4,000

Code Reference MA 30.6.1, ADA 603, 213, 604,

604.8.1.1

Record Number 53809



Restroom , Toilet Compartment : Toilet

Compartment Width

Restrooms - Basement : Restroom , Toilet Compartment

Basement 008 Girls Locker Room

Finding

The toe clearance for the toilet compartment does not meet the required minimum height.

On-Site Finding 11.00 inches

Recommendation

In compartments provided primarily for children, the front partition and at least one side partition shall provide compliant toe clearance.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Add new toilet partition with 36 inch \$4,000 door

Code Reference ADA 603, 604.8.1.4

Record Number 53810

Restroom , Toilet Compartment : Toilet

Compartment Toe Clearance

Restrooms - Basement : Restroom , Toilet Compartment

Basement 008 Girls Locker Room

Finding

There is no required coat hook.

On-Site Finding None Found

Recommendation

Install a coat hook at the recommended height.

Recommendation See Recommendation

Costing Info (Estimated)

Install coat hook \$34 **Code Reference** MA 30.6.1,MA 30.6.2

Record Number 53811

Restroom , Toilet Compartment : No Coat Hook Available



Restrooms - Basement : Restroom , Toilet

Basement 010 Boys Locker Room

Restroom , Toilet : Toilet Seat Height

Finding

The height of the toilet seat in the restroom is greater than the allowed maximum height for use by the primary age group.

On-Site Finding 18.50 inches

Recommendation

Adjust or modify the height of the toilet seat in the restroom to the required height for use by the primary age group.

Recommendation 11.00 - 17.00 inches

Costing Info (Estimated)

Modify fixture \$1,707

Code Reference MA 30.14.3, ADA 603, 604.9.3

Record Number 53658

Restrooms - Basement : Restroom , Toilet

Basement 010 Boys Locker Room

Finding

The flush control on the toilet is not on the wide (approach) side of the toilet.

On-Site Finding Wrong Side of Toilet

Recommendation

Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be handoperated or automatic mechanisms.

Recommendation See Recommendation

Costing Info (Estimated)

Relocate flush valve \$127 **Code Reference** MA 30.7.5, ADA 603, 604.6

Record Number 53660



Restroom , Toilet : Toilet Flush Control not on Wide Side



Restrooms - Basement : Restroom , Toilet

Basement 010 Boys Locker Room

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 41.50 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Costing Info (Estimated)

Relocate fixture \$2,500 **Code Reference** MA 30.7.2, ADA 603, 604.2

Record Number 53661

Restrooms - Basement : Restroom , Grab Bars

Basement 010 Boys Locker Room

Finding

The distance from the rear wall to the side grab bar is greater than allowed.

On-Site Finding 12.75 inches

Recommendation

Remount the side grab bar so it meets the distance requirements from the back wall.

Recommendation Up to 12.00 inches

Costing Info (Estimated)

Provide compliant grab bar \$267

Code Reference MA 30.8.1, ADA 603, 609, 604.5.1

Record Number 53662

Restroom , Toilet : Toilet Minimum Distance From Any fixture



Restroom , Grab Bars $\,:\,$ Grab Bar Distance From Back Wall



Restrooms - Basement : Restroom , Grab Bars

Basement 010 Boys Locker Room

Restroom , Grab Bars : Side Grab Bar Height

Finding

The height of the side grab bar in the compartment designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 33.25 inches

Recommendation

Remount the side grab bar in the compartment designated to be accessible in the restroom at to the required height for use by the primary age group.

Recommendation 25.00 inches

Costing Info (Estimated)

Adjust grab bar height \$78

Code Reference MA 30.15.1, ADA 609, 604.9, 609.4

Record Number 53663

Restrooms - Basement : Restroom , Grab Bar

Basement 010 Boys Locker Room

Restroom , Grab Bar : Rear Grab Bar Location

Finding

Rear grab bar location is not compliant.

On-Site Finding Not Compliant

Recommendation

Remount the rear grab bar to provide a minimum of 12 inches of extension from the center line of the of the water closet on one side and 24 inches of extension on the side.

Recommendation See Recommendation

Costing Info (Estimated)

Provide a compliant back grab bar. \$267

Code Reference ADA 604.5.2





Restrooms - Basement : Restroom , Grab Bars

Basement 010 Boys Locker Room

Restroom , Grab Bars : Restroom - Grab Bar Height

Finding

The grab bar on the rear wall is not at the correct height.

On-Site Finding 33.75 inches

Recommendation

Remount the rear grab bar in the compartment designated to be accessible so the height of the gripping surface is at the correct height.

Recommendation 20.00 - 25.00 inches

Costing Info (Estimated)

Provide compliant grab bars \$231 **Code Reference** ADA 213, 604, 604.9

Record Number 53665



Restrooms - Basement : Restroom , Compartment Door

Basement 010 Boys Locker Room

Restroom , Compartment Door : Compartment Door Handle

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.


Recommendation See Recommendation

Costing Info (Estimated)

Install accessible handle on stall door \$250

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 604.8.1.2, 604.8

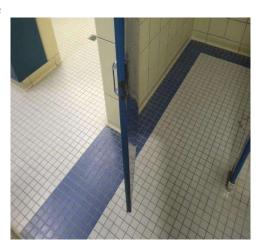

Restrooms - Basement : Restroom , Compartment Door

Basement 010 Boys Locker Room

Restroom , Compartment Door : Compartment

Finding

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

604.8.1.2, 604.8



Restrooms - Basement : Restroom , Compartment Door

Basement 010 Boys Locker Room

Finding

The door to the compartment designated to be accessible in the restroom does not have appropriate accessible hardware.

On-Site Finding Not Accessible

Recommendation

Install accessible hardware on the compartment door that does not require tight grasping, pinching, or twisting of the wrist.

Recommendation See Recommendation

Costing Info (Estimated)

Add accessible hardware to existing \$289 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

404.2.7, 309.4, 604.8

Record Number 53668

Restroom , Compartment Door : Compartment Door Latch



Restrooms - Basement : Restroom , Compartment Door

Basement 010 Boys Locker Room

Finding

The compartment door hardware is not at a compliant height.

On-Site Finding 41.00 inches

Recommendation

Remove and relocate the door hardware.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 404.2.7, 604.8

Record Number 53669

Restrooms - Basement : Restroom , Toilet Compartment

Basement 010 Boys Locker Room

Finding

The location of the toilet paper dispenser in the restroom primarily used by children is not within recommended values of the front edge of the toilet seat.

On-Site Finding 11.00 inches

Recommendation

Remount the toilet paper dispenser in the restroom so that it is within the recommended values from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches


Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.14.5, ADA 603, 604.9.6

Record Number 53670

Restroom , Compartment Door : Compartment Door Handle Height

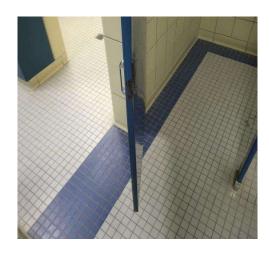





Restrooms - Basement : Restroom , Toilet Compartment

Basement 010 Boys Locker Room

Finding

The toilet paper dispenser interferes with the use of the grab bar.

On-Site Finding Interferes

Recommendation

Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.7.6, ADA 603, 609.3

Record Number 53671

Restrooms - Basement : Restroom , Lavatory

Basement 010 Boys Locker Room

Lavatory

Finding

The height of the counter surface of the lavatory designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 32.25 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation Up to 30.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.16.2, ADA 213, 606, 606.2

Record Number 53846

Restroom , Toilet Compartment : Toilet Paper Dispenser Interferes with Grab Bar



 $Restroom\ ,\ Lavatory\ :\ Lavatory\ Surface\ Height$



Restrooms - Basement : Restroom , Lavatory

Basement 010 Boys Locker Room

Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Restrooms - Basement : Restroom , Lavatory

Record Number 53847

Basement 010 Boys Locker Room

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap supply lines \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 53848

Restroom , Lavatory : Lavatory Pipes Not Wrapped







Restrooms - Basement : Restroom , Dispensers

Basement 010 Boys Locker Room

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 41.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 53844



Restroom , Dispensers : Dispenser Height

Restrooms - Basement : Restroom , Dispensers

Basement 010 Boys Locker Room

Soap

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 44.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 53845

Restroom , Dispensers : Dispenser Height



Restrooms - Basement : Restroom , Mirror

Basement 010 Boys Locker Room

Restroom , Mirror : Mirror Bottom Edge Height

Finding

The bottom edge of the reflective surface of the mirror in the restroom is is not at a compliant height for the primary age group.

On-Site Finding 42.50 inches

Recommendation

Lower the mirror in the restroom so that the bottom edge of the reflective surface is no higher than recommended above the finish floor.

Recommendation Up to 31.00 inches

Costing Info (Estimated)

Lower mirror \$291

Code Reference MA 30.18, ADA 603, 213, 603.3

Record Number 53849

Restrooms - Basement : Restroom , Urinal

Basement 010 Boys Locker Room



Finding

The height of the urinal rim in the restroom is greater than the allowed maximum height for use by the primary age group.

On-Site Finding 15.50 inches

Recommendation

Lower the urinal designated to be accessible in the restroom so that the rim height is not more than the allowed maximum height for use by the primary age group.

Recommendation Up to 15.00 inches

Costing Info (Estimated)

Lower urinal \$1,397 **Code Reference** MA 30.17.1, ADA 605, 605.2





Restrooms - Basement : Restroom , Wall Signage

Basement 010 Boys Locker Room

Wall Sign

Finding

There is no signage with the International Symbol of Accessibility.

On-Site Finding None Found

Recommendation

Install signage that includes the International Symbol of Accessibility (ISA Symbol).

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.8,

703.7

Record Number 53851

Restroom , Wall Signage : International Symbol of Accessibility



Restrooms - Basement : Restroom , Wall Sign

Basement 010 Boys Locker Room

Wall Sign

Finding

Highest line of tactile characters are not at a compliant height.

On-Site Finding 60.87 inches

Recommendation

Provide compliant signage.

Recommendation Up to 60.00 inches

Costing Info (Estimated)

\$158

Code Reference ADA 703.4.1

Record Number 53852



Restroom , Wall Sign : Highest Tactile Character

Height

Restrooms - Basement : Restroom , Toilet Compartment

Basement 010 Boys Locker Room

Restroom , Toilet Compartment : Toilet Compartment Width

Finding

There is insufficient clear floor space in the compartment.

On-Site Finding 59.50 inches

Recommendation

Modify or replace the compartment to provide adequate clear floor space.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install accessible stall \$4,000

Code Reference MA 30.6.1, ADA 603, 213, 604,

604.8.1.1

Record Number 53656



Restrooms - Basement : Restroom , Toilet Compartment

Basement 010 Boys Locker Room

Finding

There is no required coat hook.

On-Site Finding None Found

Recommendation

Install a coat hook at the recommended height.

Recommendation See Recommendation

Costing Info (Estimated)

Install coat hook \$34 **Code Reference** MA 30.6.1,MA 30.6.2

Record Number 53657



Restroom , Toilet Compartment : No Coat Hook

Available

Restrooms - Basement : Restroom , Lavatory

Basement 117 Childrens Unisex Restroom Lavatory

Finding

The height of the counter surface of the lavatory designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 31.62 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation Up to 30.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

MA 30.16.2, ADA 213, 606, 606.2 **Code Reference**

Record Number 52818

Restroom , Lavatory : Lavatory Surface Height



Restrooms - Basement : Restroom , Dispensers

Basement 117 Childrens Unisex Restroom

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 42.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 52817 Restroom , Dispensers : Dispenser Height



Restrooms - Basement : Restroom , Mirror

Basement 117 Childrens Unisex Restroom

Restroom , Mirror : Mirror Bottom Edge Height

Finding

The bottom edge of the reflective surface of the mirror in the restroom is is not at a compliant height for the primary age group.

On-Site Finding 39.00 inches

Recommendation

Lower the mirror in the restroom so that the bottom edge of the reflective surface is no higher than recommended above the finish floor.

Recommendation Up to 31.00 inches

Costing Info (Estimated)

Lower mirror \$291

Code Reference MA 30.18, ADA 603, 213, 603.3

Record Number 52819

Restrooms - Basement : Restroom , Toilet

Basement 117 Childrens Unisex Restroom

Restroom , Toilet : Toilet Seat Height

Finding

The height of the toilet seat in the restroom is greater than the allowed maximum height for use by the primary age group.

On-Site Finding 18.25 inches

Recommendation

Adjust or modify the height of the toilet seat in the restroom to the required height for use by the primary age group.

Recommendation 11.00 - 17.00 inches

Costing Info (Estimated)

Modify fixture \$1,707

Code Reference MA 30.14.3, ADA 603, 604.9.3





Restrooms - Basement : Restroom , Toilet

Basement 117 Childrens Unisex Restroom

Restroom , Toilet : Toilet Distance From Wall

Finding

The distance from the center line of the toilet to the nearest side wall in the restroom is not at the required distance.

On-Site Finding 19.00 inches on center

Recommendation

Relocate the toilet to provide a distance from the center line of the toilet to the nearest side that meets the required distance for use by the primary age group.

Recommendation 11.00 - 18.00 inches on

center

Costing Info (Estimated)

Relocate fixture \$1,143

Code Reference MA 30.14.2, ADA 603, 604.9.1

Record Number 53150

Restrooms - Basement : Restroom , Toilet

Basement 117 Childrens Unisex Restroom

Finding

The flush control on the toilet is not on the wide (approach) side of the toilet.

On-Site Finding Wrong Side of Toilet

Recommendation

Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be handoperated or automatic mechanisms.

Recommendation See Recommendation

Costing Info (Estimated)

Relocate flush valve \$127

Code Reference MA 30.7.5, ADA 603, 604.6

Record Number 53152



Restroom , Toilet : Toilet Flush Control not on Wide Side



Restrooms - Basement : Restroom, Grab Bars

Basement 117 Childrens Unisex Restroom

Restroom , Grab Bars : Side Grab Bar Height

Finding

The height of the side grab bar in the compartment designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 33.50 inches

Recommendation

Remount the side grab bar in the compartment designated to be accessible in the restroom at to the required height for use by the primary age group.

Recommendation 25.00 inches

Costing Info (Estimated)

Adjust grab bar height \$78

Code Reference MA 30.15.1, ADA 609, 604.9, 609.4

Record Number 53153



Restrooms - Basement : Restroom , Toilet Compartment

Basement 117 Childrens Unisex Restroom

Restroom , Toilet Compartment : Coat Hook Height

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 75.00 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 16.00 - 36.00 inches

Costing Info (Estimated)

Move coat hook \$50

Code Reference MA 30.20, ADA 308, 308.1



Restrooms - Basement : Restroom , Toilet Compartment

Basement 117 Childrens Unisex Restroom

Finding

The toilet paper dispenser interferes with the use of the grab bar.

On-Site Finding Interferes

Recommendation

Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.7.6, ADA 603, 609.3

Record Number 53155

Restrooms - Basement : Restroom

Basement 117 Childrens Unisex Restroom

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Costing Info (Estimated)

Replace existing lock set with lever \$804 handled lock set

Code Reference ADA 213, 213.2.1

Notes: Lavatory Obstructs Latch Side Clearance.

Record Number 52815

Restroom , Toilet Compartment : Toilet Paper Dispenser Interferes with Grab Bar



Restroom : No Door Privacy Lock and Occupied Indicator



Restrooms - Basement : Restroom

Basement 117 Childrens Unisex Restroom

Restroom : Circular Turning Space Diameter

Finding

There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.

On-Site Finding 48.25 inches

Recommendation

Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install single-use toilet room \$14,000

Code Reference ADA 603, 304, 304.3.1, 603.2.1,

304.3

Notes: Lavatory Obstructs Latch Side Clearance.

Record Number 52816

Restrooms - Basement : Restroom , Grab Bars

Basement 117 Childrens Unisex Restroom

Restroom , Grab Bars : No Back Wall Grab Bar

Finding

There is no back grab bar at the toilet compartment.

On-Site Finding None Found

Recommendation

Install the required grab bars in the toilet compartment.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant grab bar \$267

Code Reference MA 30.8, ADA 603, 604.5,

604.8.1.5





Restrooms - Basement : Restroom , Lavatory

Basement 118 Childrens Unisex Restroom Lavatory

Finding

The height of the counter surface of the lavatory designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 32.00 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation Up to 30.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.16.2, ADA 213, 606, 606.2

Record Number 52855

Restrooms - Basement : Restroom , Lavatory

Basement 118 Childrens Unisex Restroom Lavatory

Finding

There is not sufficient clear floor space provided to allow an accessible forward approach.

On-Site Finding 47.00 inches

Recommendation

Relocate the lavatory to provide clear floor space.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install new sink, faucet and handles \$2,261

Code Reference MA 6.4.1, ADA 213, 606, 606.2,

305.3

Record Number 52856

Restroom , Lavatory : Lavatory Surface Height



Restroom , Lavatory : Lavatory Clear Floor Space Length



Restrooms - Basement : Restroom , Dispensers

Basement 118 Childrens Unisex Restroom

Paper Towel

Restroom , Dispensers : Dispenser Height

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 42.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 52854

Restrooms - Basement : Restroom , Mirror

Basement 118 Childrens Unisex Restroom

Restroom , Mirror : Mirror Bottom Edge Height

Finding

The bottom edge of the reflective surface of the mirror in the restroom is is not at a compliant height for the primary age group.

On-Site Finding 39.00 inches

Recommendation

Lower the mirror in the restroom so that the bottom edge of the reflective surface is no higher than recommended above the finish floor.

Recommendation Up to 31.00 inches

Costing Info (Estimated)

Lower mirror \$291

Code Reference MA 30.18, ADA 603, 213, 603.3



Restrooms - Basement : Restroom , Wall Signage

Basement 118 Childrens Unisex RestroomWall Sign

Finding

There is no signage indicating accessibility on the latch side of the entry door of the restroom.

On-Site Finding None Found

Recommendation

Provide compliant signage on latch side of door.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.8

Record Number 52858

Restrooms - Basement : Restroom , Toilet

Basement 118 Childrens Unisex Restroom

Finding

The height of the toilet seat in the restroom is greater than the allowed maximum height for use by the primary age group.

On-Site Finding 18.50 inches

Recommendation

Adjust or modify the height of the toilet seat in the restroom to the required height for use by the primary age group.

Recommendation 11.00 - 17.00 inches

Costing Info (Estimated)


Modify fixture \$1,707

Code Reference MA 30.14.3, ADA 603, 604.9.3

Record Number 53100

Restroom , Wall Signage : No Wall Signage



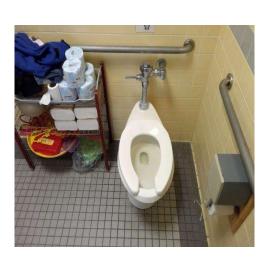

Restroom , Toilet : Toilet Seat Height

Restrooms - Basement : Restroom , Toilet

Basement 118 Childrens Unisex Restroom

Restroom , Toilet : Toilet Distance From Wall

Finding

The distance from the center line of the toilet to the nearest side wall in the restroom is not at the required distance.

On-Site Finding 19.00 inches on center

Recommendation

Relocate the toilet to provide a distance from the center line of the toilet to the nearest side that meets the required distance for use by the primary age group.

Recommendation 11.00 - 18.00 inches on

center

Costing Info (Estimated)

Relocate fixture \$1,143

Code Reference MA 30.14.2, ADA 603, 604.9.1

Record Number 53101

Restrooms - Basement : Restroom , Grab Bars

Basement 118 Childrens Unisex Restroom

Restroom , Grab Bars : Side Grab Bar Height

Finding

The height of the side grab bar in the compartment designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 32.75 inches

Recommendation

Remount the side grab bar in the compartment designated to be accessible in the restroom at to the required height for use by the primary age group.


Recommendation 25.00 inches

Costing Info (Estimated)

Adjust grab bar height \$78

Code Reference MA 30.15.1, ADA 609, 604.9, 609.4



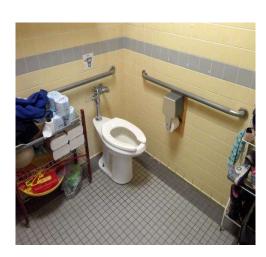

Restrooms - Basement : Restroom , Grab Bars

Basement 118 Childrens Unisex Restroom

Restroom , Grab Bars : Restroom - Grab Bar Height

Finding

The grab bar on the rear wall is not at the correct height.

On-Site Finding 32.50 inches

Recommendation

Remount the rear grab bar in the compartment designated to be accessible so the height of the gripping surface is at the correct height.

Recommendation 20.00 - 25.00 inches

Costing Info (Estimated)

Provide compliant grab bars \$231 **Code Reference** ADA 213, 604, 604.9

Record Number 53104



Restrooms - Basement : Restroom , Toilet Compartment

Basement 118 Childrens Unisex Restroom

Finding

The location of the toilet paper dispenser in the restroom primarily used by children is not within recommended values of the front edge of the toilet seat.

On-Site Finding 2.00 inches

Recommendation

Remount the toilet paper dispenser in the restroom so that it is within the recommended values from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.14.5, ADA 603, 604.9.6

Record Number 53105

Restroom , Toilet Compartment : Toilet Paper Dispenser Distance From Seat



Restrooms - Basement : Restroom , Toilet Compartment

Basement 118 Childrens Unisex Restroom

Finding

The toilet paper dispenser interferes with the use of the grab bar.

On-Site Finding Interferes

Recommendation

Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.7.6, ADA 603, 609.3

Record Number 53106

Restrooms - Basement : Restroom

Basement 118 Childrens Unisex Restroom

Finding

The restroom door does not provide a compliant privacy lock with occupancy indicator.

On-Site Finding None Found

Recommendation

Install a compliant privacy lock with occupancy indicator to the door.

Recommendation See Recommendation

Costing Info (Estimated)

Replace existing lock set with lever \$804 handled lock set

Code Reference ADA 213, 213.2.1

Notes: Lavatory Obstructs Turning Space Diameter.

Record Number 52852

Restroom , Toilet Compartment : Toilet Paper Dispenser Interferes with Grab Bar







Restrooms - Basement : Restroom

Basement 118 Childrens Unisex Restroom

Restroom : Circular Turning Space Diameter

Finding

There is not sufficient clear floor space in the restroom to accommodate an individual in a wheelchair.

On-Site Finding 47.00 inches

Recommendation

Modify the restroom to provide sufficient clear floor space for a turning radius in the restroom to accommodate an individual in a wheelchair.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install single-use toilet room \$14,000

Code Reference ADA 603, 304, 304.3.1, 603.2.1,

304.3

Notes: Lavatory Obstructs Turning Space Diameter.

Record Number 52853



Restrooms - Basement : Restroom , Toilet Compartment

Basement 118 Childrens Unisex Restroom

Finding

There is no required coat hook.

On-Site Finding None Found

Recommendation

Install a coat hook at the recommended height.

Recommendation See Recommendation

Costing Info (Estimated)

Install coat hook \$34 **Code Reference** MA 30.6.1,MA 30.6.2

Record Number 53099

 $\mbox{Restroom , Toilet Compartment} \ : \ \mbox{No Coat Hook} \\ \mbox{Available}$



Restrooms - Basement : Restroom , Lavatory

Basement Boys Restroom Next to 108 Lavatory

Finding

The height of the counter surface of the lavatory designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 32.50 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation Up to 30.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.16.2, ADA 213, 606, 606.2

Record Number 52908

Restrooms - Basement : Restroom , Lavatory

Basement Boys Restroom Next to 108

Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Costing Info (Estimated)


Wrap pipes \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 52909

Restroom , Lavatory : Lavatory Surface Height



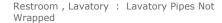



Restrooms - Basement : Restroom , Lavatory

Basement Boys Restroom Next to 108

Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap supply lines \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 52910

Restrooms - Basement : Restroom , Dispensers

Basement Boys Restroom Next to 108

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 47.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 52906

Restroom , Lavatory : Lavatory - Supply Lines not wrapped





Restroom , Dispensers : Dispenser Height

Restrooms - Basement : Restroom , Dispensers

Basement Boys Restroom Next to 108

Paper Towel

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 39.5, ADA 309, 205, 309.4

Record Number 52907



Restroom , Dispensers : Dispenser Operation

Restrooms - Basement : Restroom , Dispensers

Basement Boys Restroom Next to 108 Soap

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 42.50 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 52905



Restroom , Dispensers : Dispenser Height

Restrooms - Basement : Restroom , Mirror

Basement Boys Restroom Next to 108

Restroom , Mirror : Mirror Bottom Edge Height

Finding

The bottom edge of the reflective surface of the mirror in the restroom is is not at a compliant height for the primary age group.

On-Site Finding 46.50 inches

Recommendation

Lower the mirror in the restroom so that the bottom edge of the reflective surface is no higher than recommended above the finish floor.

Recommendation Up to 31.00 inches

Costing Info (Estimated)

Lower mirror \$291

Code Reference MA 30.18, ADA 603, 213, 603.3

Record Number 52911

Restrooms - Basement : Restroom , Toilet

Basement Boys Restroom Next to 108

Finding

The height of the toilet seat in the restroom is greater than the allowed maximum height for use by the primary age group.

On-Site Finding 18.00 inches

Recommendation

Adjust or modify the height of the toilet seat in the restroom to the required height for use by the primary age group.

Recommendation 11.00 - 17.00 inches

Costing Info (Estimated)

Modify fixture \$1,707

Code Reference MA 30.14.3, ADA 603, 604.9.3







Restrooms - Basement : Restroom , Toilet

Basement Boys Restroom Next to 108

Restroom , Toilet : Toilet Distance From Wall

Finding

The distance from the center line of the toilet to the nearest side wall in the restroom is not at the required distance.

On-Site Finding 20.50 inches on center

Recommendation

Relocate the toilet to provide a distance from the center line of the toilet to the nearest side that meets the required distance for use by the primary age group.

Recommendation 11.00 - 18.00 inches on

center

Costing Info (Estimated)

Relocate fixture \$1,143

Code Reference MA 30.14.2, ADA 603, 604.9.1

Record Number 53078

Restrooms - Basement : Restroom , Toilet

Basement Boys Restroom Next to 108

Finding

The toilet is not located in a space which provides the minimum required distance from a fixture or the minimum required clear space from a wall at the wide side.

On-Site Finding 41.00 inches

Recommendation

Locate the toilet in a space which provides the required clearances.

Recommendation At least 42.00 inches

Costing Info (Estimated)

Relocate fixture \$2,500 **Code Reference** MA 30.7.2, ADA 603, 604.2







Restrooms - Basement : Restroom , Toilet

Basement Boys Restroom Next to 108

Restroom , Toilet : Toilet Clear Floor Space

Finding

There is less than the required minimum space in front of the toilet.

On-Site Finding 35.00 inches

Recommendation

Create the required minimum clear space in front of the toilet.

Recommendation At least 42.00 inches

Costing Info (Estimated)

Modify space \$3,500

Code Reference MA 30.6.1, MA 30.7.1, ADA 603

Record Number 53082



Basement Boys Restroom Next to 108

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 49.50 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Costing Info (Estimated)

Provide compliant grab bar \$267

Code Reference MA 30.8, ADA 603, 609, 604.5.1







Restrooms - Basement : Restroom , Grab Bars

Basement Boys Restroom Next to 108

Restroom , Grab Bars : Side Grab Bar Height

Finding

The height of the side grab bar in the compartment designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 34.50 inches

Recommendation

Remount the side grab bar in the compartment designated to be accessible in the restroom at to the required height for use by the primary age group.

Recommendation 25.00 inches

Costing Info (Estimated)

Adjust grab bar height \$78

Code Reference MA 30.15.1, ADA 609, 604.9, 609.4

Record Number 53084

Restrooms - Basement : Restroom , Grab Bars

Basement Boys Restroom Next to 108

Restroom , Grab Bars : Restroom - Grab Bar Height

Finding

The grab bar on the rear wall is not at the correct height.

On-Site Finding 34.50 inches

Recommendation

Remount the rear grab bar in the compartment designated to be accessible so the height of the gripping surface is at the correct height.

Recommendation 20.00 - 25.00 inches

Costing Info (Estimated)

Provide compliant grab bars \$231 **Code Reference** ADA 213, 604, 604.9





Restrooms - Basement : Restroom , Compartment Door

Basement Boys Restroom Next to 108

Restroom , Compartment Door : Compartment Door Handle

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Costing Info (Estimated)

Install accessible handle on stall door \$250

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 604.8.1.2, 604.8

Record Number 53086

Restrooms - Basement : Restroom

Basement Boys Restroom Next to 108

Finding

The compartment door is located in front of the water closet.

On-Site Finding Not Located

Recommendation

Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.

Recommendation See Recommendation

Costing Info (Estimated)

\$4,000

Code Reference ADA 604.8.1.2

Record Number 53087



Restroom : Toilet Compartment Door



Restrooms - Basement : Restroom , Compartment Door

Basement Boys Restroom Next to 108

Finding

The door to the compartment swings inward into the minimum required compartment area.

On-Site Finding Swings In

Recommendation

Modify the swing of the door so that it does not swing into the minimum required compartment area.

Recommendation See Recommendation

Costing Info (Estimated)

Modify door swing \$269

Code Reference MA 30.6.1, MA 30.6.2, ADA 603,

604.8, 304.4

Record Number 53088

Restrooms - Basement : Restroom , Compartment Door

Basement Boys Restroom Next to 108

Door does not close automatically.

On-Site Finding Missing Hardware

Recommendation

Finding

Provide an automatic door closer, spring hinge, pull bar or accessible handle mounted on the inside of the compartment door to the compartment designated to be accessible in the restroom.

Recommendation See Recommendation

Costing Info (Estimated)

Install accessible hardware on stall \$269 door


Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

604.8.1.2, 604.8

Record Number 53089

Restroom , Compartment Door : Compartment Door Swings In



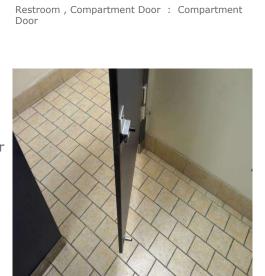

Restrooms - Basement : Restroom , Compartment Door

Basement Boys Restroom Next to 108

Finding

The compartment door hardware is not at a compliant height.

On-Site Finding 41.00 inches

Recommendation

Remove and relocate the door hardware.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 404.2.7, 604.8

Record Number 53090

Restrooms - Basement : Restroom , Toilet Compartment

Basement Boys Restroom Next to 108

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 53.50 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 16.00 - 36.00 inches

Costing Info (Estimated)

Move coat hook \$50

Code Reference MA 30.20, ADA 308, 308.1

Record Number 53091

Restroom , Compartment Door : Compartment Door Handle Height







Restrooms - Basement : Restroom , Toilet Compartment

Basement Boys Restroom Next to 108

Finding

The location of the toilet paper dispenser in the restroom primarily used by children is not within recommended values of the front edge of the toilet seat.

On-Site Finding 3.00 inches

Recommendation

Remount the toilet paper dispenser in the restroom so that it is within the recommended values from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.14.5, ADA 603, 604.9.6

Record Number 53092

Restrooms - Basement : Restroom , Toilet Compartment

Basement Boys Restroom Next to 108

Finding

The toilet paper dispenser interferes with the use of the grab bar.

On-Site Finding Interferes

Recommendation

Relocate the toilet paper dispenser so it does not interfere with the use of a grab bar. Toilet paper dispensers must allow continuous paper flow.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277 **Code Reference** MA 30.7.6, ADA 603, 609.3

Record Number 53093

Restroom , Toilet Compartment : Toilet Paper Dispenser Distance From Seat







Restrooms - Basement : Restroom , Toilet Compartment

Basement Boys Restroom Next to 108

Restroom , Toilet Compartment : Toilet Compartment Length

Finding

There is insufficient clear floor space in the compartment.

On-Site Finding 71.00 inches

Recommendation

Modify or replace the compartment to provide adequate clear floor space.

Recommendation At least 72.00 inches

Costing Info (Estimated)

Install accessible stall \$4,000

Code Reference MA 30.6.1, ADA 603, 213, 604,

604.8.1.1

Record Number 56307

Restrooms - Basement : Restroom , Toilet

Basement Girls Restroom Next to 106

Restroom , Toilet : Toilet Seat Height

Finding

The height of the toilet seat in the restroom is greater than the allowed maximum height for use by the primary age group.

On-Site Finding 18.00 inches

Recommendation

Adjust or modify the height of the toilet seat in the restroom to the required height for use by the primary age group.

Recommendation 11.00 - 17.00 inches

Costing Info (Estimated)

Modify fixture \$1,707

Code Reference MA 30.14.3, ADA 603, 604.9.3





Restrooms - Basement : Restroom , Toilet

Basement Girls Restroom Next to 106

Finding

The flush control on the toilet is not on the wide (approach) side of the toilet.

On-Site Finding Wrong Side of Toilet

Recommendation

Relocate the flush control so it is on the wide (approach) side of the toilet area. Flush controls shall be handoperated or automatic mechanisms.

Recommendation See Recommendation

Costing Info (Estimated)

Relocate flush valve \$127

Code Reference MA 30.7.5, ADA 603, 604.6

Record Number 52691

Restrooms - Basement : Restroom , Toilet

Basement Girls Restroom Next to 106

There is less than the required minimum space in front of the toilet.

On-Site Finding 36.00 inches

Recommendation

Finding

Create the required minimum clear space in front of the toilet.

Recommendation At least 42.00 inches

Costing Info (Estimated)

Modify space \$3,500

Code Reference MA 30.6.1, MA 30.7.1, ADA 603

Record Number 52692

Restroom , Toilet : Toilet Flush Control not on Wide Side







Restroom , Toilet : Toilet Clear Floor Space

Restrooms - Basement : Restroom , Grab Bars

Basement Girls Restroom Next to 106

Finding

The distance from the back wall to the front of the grab bar is less than required.

On-Site Finding 48.00 inches

Recommendation

Install or move the grab bar to create the required distance from the back wall to the front of the grab bar.

Recommendation At least 54.00 inches

Costing Info (Estimated)

Provide compliant grab bar \$267

Code Reference MA 30.8, ADA 603, 609, 604.5.1

Record Number 52693

Restrooms - Basement : Restroom , Grab Bars

Basement Girls Restroom Next to 106

Finding

The height of the side grab bar in the compartment designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 34.50 inches

Recommendation

Remount the side grab bar in the compartment designated to be accessible in the restroom at to the required height for use by the primary age group.

Recommendation 25.00 inches

Costing Info (Estimated)

Adjust grab bar height \$78

Code Reference MA 30.15.1, ADA 609, 604.9, 609.4

Record Number 52694

Restroom , Grab Bars : Distance from Back Wall to Front of Grab Bar





Restroom , Grab Bars : Side Grab Bar Height

Restrooms - Basement : Restroom , Grab Bars

Basement Girls Restroom Next to 106

Restroom , Grab Bars : Restroom - Grab Bar Height

Finding

The grab bar on the rear wall is not at the correct height.

On-Site Finding 34.50 inches

Recommendation


Remount the rear grab bar in the compartment designated to be accessible so the height of the gripping surface is at the correct height.

Recommendation 20.00 - 25.00 inches

Costing Info (Estimated)

Provide compliant grab bars \$231 **Code Reference** ADA 213, 604, 604.9

Record Number 52695

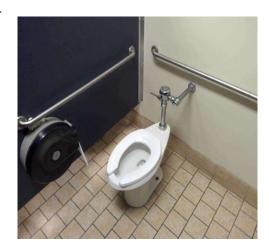

Restrooms - Basement : Restroom , Compartment Door

Basement Girls Restroom Next to 106

Restroom , Compartment Door : Compartment Door Handle

Finding

The door to the compartment does not have an accessible handle on both sides.

On-Site Finding Not on both sides.

Recommendation

Provide an accessible handle mounted on the door of the compartment near the latch.

Recommendation See Recommendation

Costing Info (Estimated)

Install accessible handle on stall door \$250

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 604.8.1.2, 604.8



Restrooms - Basement : Restroom

Basement Girls Restroom Next to 106

Restroom : Toilet Compartment Door

Finding

The compartment door is located in front of the water closet.

On-Site Finding Not Located

Recommendation

Reconfigure the toilet compartment to provide a compliant door that is located adjacent to the water closet.

Recommendation See Recommendation

Costing Info (Estimated)

\$4,000

Code Reference ADA 604.8.1.2

Record Number 52697

Restrooms - Basement : Restroom , Compartment Door

Basement Girls Restroom Next to 106

Finding

The door to the compartment swings inward into the minimum required compartment area.

On-Site Finding Swings In

Recommendation

Modify the swing of the door so that it does not swing into the minimum required compartment area.

Recommendation See Recommendation

Costing Info (Estimated)

Modify door swing \$269

Code Reference MA 30.6.1, MA 30.6.2, ADA 603,

604.8, 304.4

Record Number 52698





Restroom , Compartment Door : Compartment

Door Swings In

Restrooms - Basement : Restroom , Compartment Door

Basement Girls Restroom Next to 106

Finding

The compartment door hardware is not at a compliant height.

On-Site Finding 41.00 inches

Recommendation

Remove and relocate the door hardware.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Install accessible hardware on stall \$269 door

Code Reference MA 30.6.1, MA 30.6.2, ADA 404,

213, 604, 404.2.7, 604.8

Record Number 52699

Restrooms - Basement : Restroom , Toilet Compartment

Basement Girls Restroom Next to 106

Finding

The coat hook is not mounted at the correct height.

On-Site Finding 54.00 inches

Recommendation

Mount the coat hook at the recommended height.

Recommendation 16.00 - 36.00 inches

Costing Info (Estimated)

Move coat hook \$50

Code Reference MA 30.20, ADA 308, 308.1

Record Number 52700

Restroom , Compartment Door : Compartment Door Handle Height







Restrooms - Basement : Restroom , Toilet Compartment

Basement Girls Restroom Next to 106

Finding

The location of the toilet paper dispenser in the restroom primarily used by children is not within recommended values of the front edge of the toilet seat.

On-Site Finding 1.00 inches

Recommendation

Remount the toilet paper dispenser in the restroom so that it is within the recommended values from the front edge of the toilet seat. Toilet paper dispensers must allow continuous paper flow and not interfere with the use of the side grab bar.

Recommendation 7.00 - 9.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.14.5, ADA 603, 604.9.6

Record Number 52701

Restroom , Toilet Compartment : Toilet Paper Dispenser Distance From Seat



Restrooms - Basement : Restroom , Dispensers

Basement Girls Restroom Next to 106Feminine Products

Restroom , Dispensers : Dispenser Height

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 54.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1



Restrooms - Basement : Restroom , Dispensers

Basement Girls Restroom Next to 106Feminine Products

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 39.5, ADA 309, 205, 309.4

Record Number 52974



Restroom , Dispensers : Dispenser Operation

Restrooms - Basement : Restroom , Lavatory

Basement Girls Restroom Next to 106 Lavatory

Finding

The height of the counter surface of the lavatory designated to be accessible in the restroom is greater than the allowed maximum height for the primary age group.

On-Site Finding 31.50 inches

Recommendation

Raise or replace the lavatory to provide the minimum required knee clearance.

Recommendation Up to 30.00 inches

Costing Info (Estimated)

Provide compliant lavatory \$1,286

Code Reference MA 30.16.2, ADA 213, 606, 606.2

Record Number 52975



Restroom , Lavatory : Lavatory Surface Height

Restrooms - Basement : Restroom , Lavatory

Basement Girls Restroom Next to 106 Lavatory

Finding

The pipes under the lavatory do not provide protection against contact.

On-Site Finding Pipes not wrapped.

Recommendation

Insulate or otherwise configure pipes under the lavatory to protect against contact. Make certain there are no sharp or abrasive surfaces under the lavatory.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 52976

Restrooms - Basement : Restroom , Lavatory

Basement Girls Restroom Next to 106 Lavatory

Finding

Supply lines are not wrapped at the lavatory.

On-Site Finding Not Wrapped

Recommendation

Wrap the supply lines around lavatory according to compliance.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap supply lines \$149

Code Reference MA 30.9.5, ADA 213, 606, 606.5

Record Number 52977

Restroom , Lavatory : Lavatory Pipes Not Wrapped







Restrooms - Basement : Restroom , Dispensers

Basement Girls Restroom Next to 106

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 48.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 52970



Restroom , Dispensers : Dispenser Height

Restrooms - Basement : Restroom , Dispensers

Basement Girls Restroom Next to 106

Paper Towel

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding Not Accessible

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 39.5, ADA 309, 205, 309.4

Record Number 52971



Restroom , Dispensers : Dispenser Operation

Restrooms - Basement : Restroom , Dispensers

Basement Girls Restroom Next to 106 Soap

Restroom , Dispensers : Dispenser Height

Finding

The height of the controls and operating mechanisms for the dispenser in the restroom are greater than the allowed maximum height for the primary age group.

On-Site Finding 44.00 inches

Recommendation

Relocate the dispenser in the restroom to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

Provide compliant dispenser \$277

Code Reference MA 30.20, ADA 309, 205, 308,

606, 308.1

Record Number 52972

Restrooms - Basement : Restroom , Mirror

Basement Girls Restroom Next to 106

Restroom , Mirror : Mirror Bottom Edge Height

Finding

The bottom edge of the reflective surface of the mirror in the restroom is is not at a compliant height for the primary age group.

On-Site Finding 44.00 inches

Recommendation

Lower the mirror in the restroom so that the bottom edge of the reflective surface is no higher than recommended above the finish floor.

Recommendation Up to 31.00 inches

Costing Info (Estimated)

Lower mirror \$291

Code Reference MA 30.18, ADA 603, 213, 603.3



Drinking Fountains - Basement: Drinking Fountains

Basement Drinking Fountain Next to 108

Drinking Fountains : Protruding Object

Finding

The drinking fountain is a protruding object.

On-Site Finding None

Recommendation

Make sure that the fountain is not a protruding object.


Recommendation See Recommendation

Costing Info (Estimated)

Modify fountain \$550

Code Reference ADA 305, 306, 211, 602, 307.2

Record Number 52732

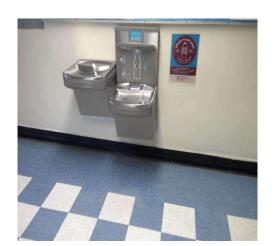

Drinking Fountains - Basement: Drinking Fountain

Basement Drinking Fountain Next to 108

Drinking Fountain : Spout Height

Finding

The spout height is greater than the required maximum height for the primary age group.

On-Site Finding 33.50 inches

Recommendation


The height of the spout outlet shall not exceed the maximum height for the primary age group.

Recommendation Up to 30.00 inches

Costing Info (Estimated)

Lower existing fountain \$627

Code Reference ADA 305, 306, 211, 602, 602.2

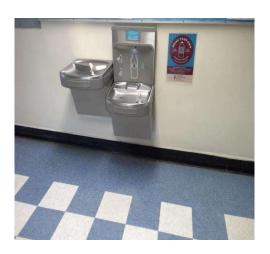

Drinking Fountains - Basement: Drinking Fountain

Basement Drinking Fountain Next to Gym Stage

Drinking Fountain : Fountain Type

Finding

The provided drinking fountain is not a Hi-Low fountain.

On-Site Finding Fountain Not Compliant

Recommendation

Replace the drinking fountain with a compliant Hi-Low fountain.

Recommendation See Recommendation

Costing Info (Estimated)

Install new high/low fountain \$2,500

Code Reference ADA 305, 602, 211.2

Record Number 52681



Drinking Fountains - Basement: Drinking Fountain

Basement Drinking Fountain Next to Gym Stage

Drinking Fountain : Spout Height

Finding

The spout height is greater than the required maximum height for the primary age group.

On-Site Finding 35.00 inches

Recommendation

The height of the spout outlet shall not exceed the maximum height for the primary age group.

Recommendation Up to 30.00 inches

Costing Info (Estimated)

Lower existing fountain \$627

Code Reference ADA 305, 306, 211, 602, 602.2



Food Service - Basement : Food Service , Counter/Condiments/Tableware

Basement 107 Cafeteria

Fruit Counter

Finding

The counter/tableware/condiment counter area is not at the required height.

On-Site Finding 35.00 inches

Recommendation

Provide a tableware/condiment counter at the required height.


Recommendation Up to 34.00 inches

Costing Info (Estimated)

Provide compliant counter \$2,500 **Code Reference** MA 35.6, ADA 902, 904.5

Record Number 52888

Food Service , Counter/Condiments/Tableware : Counter/Condiment/Tableware Height

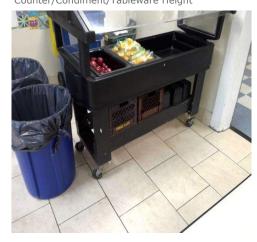

Food Service - Basement : Food Service , Food Service Line

Basement 107 Cafeteria

Queue Line at Service Counter

Finding

The width of the aisle at the food service line is less than required.

On-Site Finding 32.00 inches

Recommendation

Widen the aisle at the food service line to provide required width, or a preferred clear width to allow passage around an individual using a wheelchair.

Recommendation At least 36.00 inches

Costing Info (Estimated)

Widen food service line \$1,200 **Code Reference** MA 17.6.1, ADA 403, 904.2

Notes: Tray Slide Protrudes 10" Into the Path of Travel.

Record Number 52889

Food Service , Food Service Line : Food Service Line Width



Food Service - Basement : Food Service , Tray Slide

Basement 107 Cafeteria

Queue Line at Service Counter

Finding

Tray slide is a protruding object.

On-Site Finding Not Compliant

Recommendation

Make sure that the tray slide is not a protruding object.

Recommendation See Recommendation

Costing Info (Estimated)

\$545

Code Reference ADA 403, 307.2

Notes: Tray Slide Protrudes 10" Into the Path of Travel.

Record Number 52890

Food Service - Basement: Food Service, Tables and Seating

Basement 107 Cafeteria

Finding

The required minimum percentage of accessible tables and seating is not provided.

On-Site Finding None Found

Recommendation

Modify or replace one or more of the tables in the food service area to meet the required minimum accessible seating.

Recommendation At least 3.00 tables

Costing Info (Estimated)

Provide compliant seating \$2,500

Code Reference MA 35.1, ADA 206, 305, 902,

226.1

Record Number 52887



Food Service, Tray Slide: Is Protruding

Food Service , Tables and Seating : Minimum Required Seating



Assembly Areas - Basement : Assembly Area

Basement Gymnasium

Assembly Area : Less Than Minimum Required

Finding

There are not enough accessible seats at the location with respect to the total number of seats available.

On-Site Finding None Found

Recommendation

Provide compliant accessible seating at the location.


At least 4.00 seats Recommendation

Costing Info (Estimated)

Requires re-design \$600

Code Reference ADA 221.2, 802.1

Record Number 52680

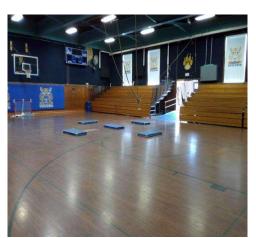

Locker Rooms - Basement : Locker Room , Bench

Basement 008 Girls Locker Room

Finding

The bench is not fixed to the wall along the longer dimension.

On-Site Finding Not Attached

Recommendation

Install a compliant bench in the locker room. Provide sufficient clear floor space alongside the the bench to allow a person using a wheelchair to transfer on to the bench.

Recommendation See Recommendation

Costing Info (Estimated)

Install bench \$500

Code Reference MA 33.6, ADA 222, 803, 903.4,

803.4

Record Number 54046



Locker Room , Bench : Bench Not Attached to

Accessible Seats

Locker Rooms - Basement : Locker Room , Bench

Basement 008 Girls Locker Room

Locker Room , Bench : Bench Width

Finding

The width of the bench is not compliant.

On-Site Finding 9.50 inches

Recommendation

Install a compliant bench in the locker room. Provide sufficient clear floor space alongside the the bench to allow a person using a wheelchair to transfer on to the bench.

Recommendation 24.00 inches

Costing Info (Estimated)

Install bench \$500

Code Reference MA 33.6, ADA 222, 803, 903.3,

803.4

Record Number 54047

Locker Rooms - Basement : Locker Room

Basement 008 Girls Locker Room

Locker Room : No Accessible Lockers Available

Finding

No accessible lockers were found.

On-Site Finding None Found

Recommendation

At least one locker or 5% of the lockers should be accessible.

Recommendation See Recommendation

Costing Info (Estimated)

Requires assembly or design \$1,840

Code Reference MA 19.2, ADA 222, 803, 225.2.1,

811, F222.1



Locker Rooms - Basement : Locker Room , Bench

Basement 010 Boys Locker Room

Locker Room , Bench : Bench Not Attached to

Finding

The bench is not fixed to the wall along the longer dimension.

On-Site Finding Not Attached

Recommendation

Install a compliant bench in the locker room. Provide sufficient clear floor space alongside the the bench to allow a person using a wheelchair to transfer on to the bench.

Recommendation See Recommendation

Costing Info (Estimated)

Install bench \$500

Code Reference MA 33.6, ADA 222, 803, 903.4,

803.4

Record Number 53882

Locker Rooms - Basement : Locker Room , Bench

Basement 010 Boys Locker Room

Locker Room , Bench : Bench Width

Finding

The width of the bench is not compliant.

On-Site Finding 9.50 inches

Recommendation

Install a compliant bench in the locker room. Provide sufficient clear floor space alongside the the bench to allow a person using a wheelchair to transfer on to the bench.

Recommendation 24.00 inches


Costing Info (Estimated)

Install bench \$500

Code Reference MA 33.6, ADA 222, 803, 903.3,

803.4



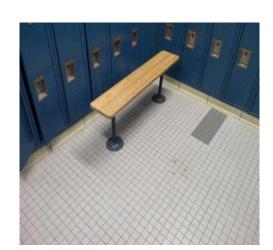

Locker Rooms - Basement : Locker Room

Basement 010 Boys Locker Room

Locker Room : No Accessible Lockers Available

Finding

No accessible lockers were found.

On-Site Finding None Found

Recommendation

At least one locker or 5% of the lockers should be accessible.

Recommendation See Recommendation

Costing Info (Estimated)

Requires assembly or design \$1,840

Code Reference MA 19.2, ADA 222, 803, 225.2.1,

811, F222.1

Record Number 53881



Break/Conference Room - Basement : Break Room

Basement 104

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser in the break/conference room are greater than the allowed maximum height for the primary age group.

On-Site Finding 51.00 inches

Recommendation

Relocate the dispenser in the break/conference room to meet the required height for the primary age group.

Recommendation Up to 36.00 inches

Costing Info (Estimated)

\$277

Code Reference MA 30.20, ADA 309, 205, 308, 606

Record Number 53141



Break Room : Break Room

Break/Conference Room - Basement : Break Room

Basement 104

Paper Towel

Finding

The operable parts of the dispenser require tight grasping, pinching, or twisting of the wrist.

On-Site Finding None Found

Recommendation

Replace dispenser with one that allows operation with one hand and does not require tight grasping, pinching, or twisting of the wrist. The force required to activate operable parts shall be 5 pounds. Consider installing automatic dispensers.

Recommendation See Recommendation

Costing Info (Estimated)

Replace dispenser \$220

Code Reference MA 39.5, ADA 205

Record Number 53142

Break/Conference Room - Basement : Break Room , Appliance

Basement 104

Refrigerator - Appliance

Finding

Appliance Reach Height in the break/conference room is not compliant.

On-Site Finding 49.00 inches

Recommendation

Make sure that the specified appliance reach height is compliant.

Recommendation Up to 48.00 inches

Costing Info (Estimated)

Adjust appliance height \$1,200

Code Reference ADA 309, 205, 308

Record Number 53140

Break Room : Break Room





Break Room, Appliance: Reach Height

Page 412 of 544

Break/Conference Room - Basement : Break Room

Basement 104

Sink

Break Room : Sink - Counter Height

Finding

Sink counter height does not meet the standards.

On-Site Finding 36.62 inches

Recommendation

Provide compliant sink.

Recommendation Up to 27.00 inches

Costing Info (Estimated)

Provide compliant sink \$1,800 **Code Reference** ADA 309, 205, 308, 228

Record Number 53134



Break/Conference Room - Basement : Break Room

Basement 104

Sink

Break Room : Pipes not Wrapped

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or otherwise configure the water supply and drain pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5



Break/Conference Room - Basement : Break Room

Basement 104

Sink

Finding

The cabinet door hardware is not accessible.

On-Site Finding None Found

Recommendation

Provide compliant hardware for the cabinet door.

See Recommendation Recommendation

Costing Info (Estimated)

\$1,000

Code Reference ADA 309, 205, 308, 228

Record Number 53136

Break/Conference Room - Basement : Break Room

Basement 104

Sink

Finding

The toe kick for the sink in break/conference room is not removed.

On-Site Finding Not Removed

Recommendation

Remove the toe kick for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

\$612

Code Reference ADA 305, 306, 606.2

Record Number 53137



Break Room : Cabinet Door Hardware





Break Room : Toe Kick Not Removed

Break/Conference Room - Basement : Break Room , Sink

Basement 104

Sink

Break Room , Sink : Clear Floor Space Width

Finding

There is not enough clear floor space at the sink.

On-Site Finding 25.50 inches

Recommendation

Provide enough clear floor space at the location.

Recommendation At least 30.00 inches

Costing Info (Estimated)

Unknown scope \$900 **Code Reference** ADA 309, 205, 308, 228

Record Number 53138



Break/Conference Room - Basement : Break Room , Sink

Basement 104

Sink

Break Room , Sink : Supply Lines

Finding

Supply lines are not wrapped for the break/conference room sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5



Break/Conference Room - Basement : Break Room

Basement 104

Table

Finding

The table height in the break/conference room is not compliant.

On-Site Finding 29.62 inches

Recommendation

Provide compliant table in the break/conference room.

Recommendation Up to 27.00 inches

Costing Info (Estimated)

\$500

Code Reference ADA 309, 205, 308, 228

Record Number 53133

Sinks - Basement : Sink

Basement Sink in 107 Cafeteria

Paper Towel

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 51.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 48.00 inches

Costing Info (Estimated)

Replace dispenser \$180

Code Reference MA 6.5, ADA 309, 205, 308, 606

Record Number 52787

Break Room : Table Height







Sinks - Basement : Sink

Basement Sink in 107 Cafeteria

Soap

Sink: Sink

Finding

The height of the controls and operating mechanisms for the dispenser is not at the correct height.

On-Site Finding 52.00 inches

Recommendation

Relocate the dispenser to the correct height.

Recommendation Up to 48.00 inches

Costing Info (Estimated)

Replace dispenser \$180

Code Reference MA 6.5, ADA 309, 205, 308, 606

Record Number 52788

Sinks - Basement : Sink

Basement Sink in 107 Cafeteria

FindingThe pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Record Number 52784





Sink : Pipes not Wrapped

Sinks - Basement : Sink

Basement Sink in 107 Cafeteria

Sink : Clear Floor Space Width

Finding

There is not enough clear floor space at the sink.

On-Site Finding 17.50 inches

Recommendation

Provide enough clear floor space at the location.

Recommendation At least 30.00 inches

Costing Info (Estimated)

Unknown scope \$900 **Code Reference** ADA 309, 205, 308, 228

Record Number 52785

Sinks - Basement : Sink

Basement Sink in 107 Cafeteria

FindingSupply lines are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5







Sinks - Basement : Sink

Basement Sink in 111

Sink : Pipes not Wrapped

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Record Number

Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

52669

Code Reference ADA 606.5

Sinks - Basement : Sink

Basement Sink in 111

The toe kick for the sink is not removed.

On-Site Finding Toe Kick Exists

Recommendation

Finding

Make sure there is no toe kick at the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Remove toe kick \$420

Code Reference ADA 305, 306, 606.2

Record Number 52670



Sink : Toe Kick Not Removed



Sinks - Basement : Sink

Basement Sink in 111

Sink : Supply Lines

Finding

Supply lines are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Record Number 52671

Sinks - Basement : Sink

Basement Sink in 113

Sink : Pipes not Wrapped

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation


Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

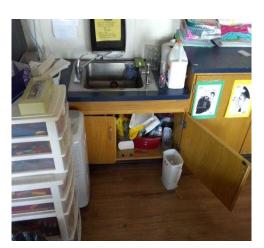

Sinks - Basement : Sink

Basement Sink in 113

Sink : Toe Kick Not Removed

Finding

The toe kick for the sink is not removed.

On-Site Finding Toe Kick Exists

Recommendation

Make sure there is no toe kick at the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Remove toe kick \$420

Code Reference ADA 305, 306, 606.2

Record Number 53158

Sinks - Basement : Sink

Basement Sink in 113

Finding

Supply lines are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Record Number 53159



Sink : Supply Lines



Sinks - Basement : Sink

Basement Sink in 117

Sink : Pipes not Wrapped

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Record Number 53045

Sinks - Basement : Sink

Basement Sink in 117

Sink : Toe Kick Not Removed

Finding

The toe kick for the sink is not removed.

On-Site Finding Toe Kick Exists

Recommendation

Make sure there is no toe kick at the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Remove toe kick \$420

Code Reference ADA 305, 306, 606.2





Sinks - Basement : Sink

Basement Sink in 117

Sink : Supply Lines

Finding

Supply lines are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Record Number 53047

Sinks - Basement : Sink



Sink : Pipes not Wrapped

Finding

The pipes are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Insulate or Otherwise configure pipes under the sink to protect against contact. Make certain there are no sharp or abrasive surfaces under the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Notes: Table Obstructs Clear Floor Space Length.





Sinks - Basement : Sink

Basement Sink in 118

Sink : Toe Kick Not Removed

Finding

The toe kick for the sink is not removed.

On-Site Finding Toe Kick Exists

Recommendation

Make sure there is no toe kick at the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Remove toe kick \$420

Code Reference ADA 305, 306, 606.2

Notes: Table Obstructs Clear Floor Space Length.

Record Number 52736

Sinks - Basement : Sink

Basement Sink in 118

FindingThere is not enough clear floor space at the sink.

On-Site Finding 35.00 inches

Recommendation

Provide enough clear floor space at the location.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Unknown scope \$900

Code Reference ADA 606.2

Notes: Table Obstructs Clear Floor Space Length.

Record Number 52737



Sink : Clear Floor Space Length



Sinks - Basement : Sink

Basement Sink in 118

Sink : Supply Lines

Finding

Supply lines are not wrapped for the sink.

On-Site Finding Not Wrapped

Recommendation

Make sure that the supply lines are fully wrapped and insulated for the sink.

Recommendation See Recommendation

Costing Info (Estimated)

Wrap pipes \$149

Code Reference ADA 606.5

Notes: Table Obstructs Clear Floor Space Length.

Record Number 52738

Lockers - Basement : Lockers

Basement Lockers Next to Gym

Lockers : No Accessible Lockers Available

Finding

No accessible lockers were found.

On-Site Finding Not Available

Recommendation

At least one locker or 5% of the lockers should be accessible.

Recommendation See Recommendation

Costing Info (Estimated)

Requires assembly or design \$1,840

Code Reference ADA 225.2.1, 811





Accessible Showers - Basement : Accessible Shower

Basement 008 Girls Locker Room

Accessible Shower : Twist Control on Hand held

Mount

Finding

The controls on the showers hand held mount are not accessible.

On-Site Finding Not Compliant

Recommendation

Provide accessible controls on the hand held mount.

Recommendation See Recommendation

Costing Info (Estimated)

\$540

Code Reference ADA 213, 608, 608.6

Record Number 53788



Accessible Showers - Basement : Accessible Shower, Grab Bars

Basement 008 Girls Locker Room

Accessible Shower, Grab Bars: Grab Bar Height

Finding

The grab bars in the accessible shower are not mounted at a compliant height.

On-Site Finding 42.50 inches

Recommendation

Remount the grab bars in the accessible shower to a compliant height and location.

Recommendation 33.00 - 36.00 inches

Costing Info (Estimated)

Adjust grab bar height \$78 **Code Reference** MA 31.7.5, ADA 608



Accessible Showers - Basement : Accessible Shower, Grab Bars

Basement 008 Girls Locker Room

 $\begin{tabular}{ll} Accessible Shower , Grab Bars : Grab Bar is over Seat \\ \end{tabular}$

Finding

The grab bar is mounted on walls over the seat.

On-Site Finding Over Seat

Recommendation

Move the grab bar so that it is mounted on walls opposite and adjacent to the front edge of the seat, but not extended to include that portion of wall over the seat.

Recommendation See Recommendation

Costing Info (Estimated)

Requires assembly or design \$1,840 **Code Reference** MA 31.7.5, ADA 608, 608.6

Record Number 53790



Accessible Showers - Basement : Accessible Shower, Seat

Basement 008 Girls Locker Room

Accessible Shower , Seat : Seat Length

Finding

Shower seat length is not compliant.

On-Site Finding Not Accessible

Recommendation

Provide a compliant seat that extends the full length of the shower.

Recommendation See Recommendation

Costing Info (Estimated)

Add a compliant fold-down seat to \$1,068 tiled shower wall

Code Reference MA 31.7.4, ADA 608



Accessible Showers - Basement : Accessible Shower, Seat

Basement 008 Girls Locker Room

Accessible Shower , Seat : Seat Width

Finding

Shower Seat Width is not compliant.

On-Site Finding 14.00 inches

Recommendation

Remount the folding seat at a height of 18 inches above the finished floor. Make certain that the distance between the folding seat and wall upon which it is hung is no greater than 1 1/2 inches and that it extends less than 6 inches from the mounting wall when folded.

Recommendation 15.00 - 22.00 inches

Costing Info (Estimated)

Add fold-down seat and grab bars to \$1,500 tiled shower wall

Code Reference MA 31.7.4, ADA 608



Accessible Showers - Basement : Accessible Shower, Seat

Basement 008 Girls Locker Room

Finding

The distance between the folding seat and the adjacent wall is greater than $1\ 1/2$ inches.

On-Site Finding 6.75 inches

Recommendation

Remount the folding seat at a height of 18 inches above the finished floor. Make certain that the distance between the folding seat and wall upon which it is hung is no greater than 1 1/2 inches and that it extends less than 6 inches from the mounting wall when folded.

Recommendation Up to 1.50 inches

Costing Info (Estimated)

Add fold-down seat and grab bars to \$1,500 tiled shower wall

Code Reference MA 31.7.4, ADA 608

Record Number 53793

 $\label{eq:conditional_section} \mbox{Accessible Shower , Seat } : \mbox{ Seat Distance From Wall}$



Accessible Showers - Basement : Accessible Shower, Seat

Basement 008 Girls Locker Room

Accessible Shower , Seat : Seat Height

Finding

The folding seat in the accessible shower is not mounted at a compliant height above the finished floor.

On-Site Finding 17.50 inches

Recommendation

Remount the folding seat to a compliant height above the finished floor.

Recommendation 18.00 inches

Costing Info (Estimated)

Add fold-down seat and grab bars to \$1,500 tiled shower wall

Code Reference MA 31.7.4, ADA 608, 610.3

Record Number 53794



Accessible Showers - Basement : Accessible Shower

Basement 010 Boys Locker Room

Finding

The controls on the showers hand held mount are not accessible.

On-Site Finding Not Compliant

Recommendation

Provide accessible controls on the hand held mount.

Recommendation See Recommendation

Costing Info (Estimated)

\$540

Code Reference ADA 213, 608, 608.6

Record Number 53968



Accessible Shower : Twist Control on Hand held

Accessible Showers - Basement : Accessible Shower, Grab Bars

Basement 010 Boys Locker Room

Accessible Shower , Grab Bars : Grab Bar Height

Finding

The grab bars in the accessible shower are not mounted at a compliant height.

On-Site Finding 42.50 inches

Recommendation

Remount the grab bars in the accessible shower to a compliant height and location.

Recommendation 33.00 - 36.00 inches

Costing Info (Estimated)

Adjust grab bar height \$78 **Code Reference** MA 31.7.5, ADA 608

Record Number 53969



Accessible Showers - Basement : Accessible Shower, Grab Bars

Basement 010 Boys Locker Room

Accessible Shower , Grab Bars : Grab Bar is over Seat

Finding

The grab bar is mounted on walls over the seat.

On-Site Finding Over Seat

Recommendation

Move the grab bar so that it is mounted on walls opposite and adjacent to the front edge of the seat, but not extended to include that portion of wall over the seat.

Recommendation See Recommendation

Costing Info (Estimated)

Requires assembly or design \$1,840 **Code Reference** MA 31.7.5, ADA 608, 608.6



Accessible Showers - Basement : Accessible Shower, Seat

Basement 010 Boys Locker Room

Accessible Shower , Seat : Seat Length

Finding

Shower seat length is not compliant.

On-Site Finding Not Accessible

Recommendation

Provide a compliant seat that extends the full length of the shower.

Recommendation See Recommendation

Costing Info (Estimated)

Add a compliant fold-down seat to \$1,068

tiled shower wall

Code Reference MA 31.7.4, ADA 608

Record Number 53971



Accessible Showers - Basement : Accessible Shower , Seat

Basement 010 Boys Locker Room

Accessible Shower , Seat : Seat Width

Finding

Shower Seat Width is not compliant.

On-Site Finding 14.00 inches

Recommendation

Remount the folding seat at a height of 18 inches above the finished floor. Make certain that the distance between the folding seat and wall upon which it is hung is no greater than 1 1/2 inches and that it extends less than 6 inches from the mounting wall when folded.

Recommendation 15.00 - 22.00 inches

Costing Info (Estimated)

Add fold-down seat and grab bars to \$1,500 tiled shower wall

Code Reference MA 31.7.4, ADA 608



Accessible Showers - Basement : Accessible Shower , Seat

Basement 010 Boys Locker Room

Accessible Shower , Seat : Seat Distance From Wall

Finding

The distance between the folding seat and the adjacent wall is greater than 1 1/2 inches.

On-Site Finding 5.50 inches

Recommendation

Remount the folding seat at a height of 18 inches above the finished floor. Make certain that the distance between the folding seat and wall upon which it is hung is no greater than 1 1/2 inches and that it extends less than 6 inches from the mounting wall when folded.

Recommendation Up to 1.50 inches

Costing Info (Estimated)

Add fold-down seat and grab bars to \$1,500 tiled shower wall

Code Reference MA 31.7.4, ADA 608

Record Number 53973



Accessible Showers - Basement : Accessible Shower , Water Valve

Basement 010 Boys Locker Room

Accessible Shower , Water Valve : Water Valve Distance From Seat Wall

Finding

The water valve distance from seat wall is not compliant.

On-Site Finding 23.00 inches

Recommendation

Provide a compliant water valve.

Recommendation At least 24.00 inches

Costing Info (Estimated)

Relocate controls \$1,500

Code Reference MA 31.7.3, ADA 213, 608, 608.6



Reach Ranges - Basement : Reach Range , Clear Floor Space Width

Basement 107 Cafeteria

Eyewash - Eye Washing Station

Finding

The clear floor space width is not compliant.

On-Site Finding 17.00 inches

Recommendation

Provide compliant clear floor space.

Recommendation At least 30.00 inches

Costing Info (Estimated)

Redesign space \$500

Code Reference ADA 304, 305.3

Record Number 52943

Reach Range , Clear Floor Space Width : Clear Floor Space Width



Reach Ranges - Basement : Reach Range , Clear Floor Space Slope

Basement Drinking Fountain Next to 108

Water Bottle Filling Dispenser - Water Bottle Filling Dispenser

Finding

The clear floor space slope is not compliant.

On-Site Finding 2.90 percent

Recommendation

Provide compliant clear floor space.

Recommendation Up to 2.00 percent

Costing Info (Estimated)

Redesign space \$500

Code Reference ADA 304

Record Number 52759



Reach Range , Clear Floor Space Slope : Clear

Floor Space Slope

Parking - Exterior : Parking Lot , Parking Space

Parking Lot Next to Main Entrance Left Accessible Space

Finding

The bottom edge of the post-mounted signage designating the accessible parking space is not at the required height.

On-Site Finding 15.00 inches

Recommendation

Modify the height or replace the post-mounted signage designating the accessible parking space. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Modify or replace post mounted sign \$158 **Code Reference** MA 23.6, ADA 502, 502.6

Record Number 54033

Parking - Exterior : Parking Lot , Parking Space

Parking Lot Next to Main Entrance

Left Accessible Space

Finding

There is no additional signage marked "van accessible" at the van accessible parking space.

On-Site Finding None Found

Recommendation

Van accessible parking spaces shall provide additional signage that states "van accessible" .

Recommendation See Recommendation

Costing Info (Estimated)

Install post mounted sign \$250 **Code Reference** MA 23.6, ADA 502, 502.6

Record Number 54034

Parking Lot , Parking Space : Parking Space Accessible Signage Height



Parking Lot , Parking Space : No Van Accessible Signage



Parking - Exterior: Parking Lot, Parking Space

Parking Lot Next to Main Entrance Left Accessible Space

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 6.60 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface to correct slope and \$3,800 re-stripe

Code Reference MA 23.4.3, ADA 502, 502.4

Record Number 54030

Parking Lot , Parking Space : Parking Space Slope



Parking - Exterior : Parking Lot , Parking Space

Parking Lot Next to Main Entrance Left Accessible Space

Finding

There is an accessible parking space designated in the parking lot. There is no access aisle located at the parking space.

On-Site Finding No Access Aisle

Recommendation

Provide a compliant access aisle at the parking space. Parking spaces shall each provide an access aisle that may be shared.

Recommendation See Recommendation

Costing Info (Estimated)

Paint ground markings and install a \$370 post mounted sign

Code Reference MA 23.4.6, ADA 502, 502.3.4,

502.3

Record Number 54031

Parking Lot , Parking Space : No Access Aisle



Parking - Exterior : Parking Lot , Parking Space

Parking Lot Next to Main Entrance Left Accessible Space

Finding

The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.

On-Site Finding See Above

Recommendation

Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$1,100

Code Reference ADA 502.3

Record Number 54032

Parking Lot , Parking Space : Must Travel Behind Parked Cars



Parking - Exterior : Parking Lot , Parking Space

Parking Lot Next to Main Entrance Right Accessible Space

Finding

The bottom edge of the post-mounted signage designating the accessible parking space is not at the required height.

On-Site Finding 16.00 inches

Recommendation

Modify the height or replace the post-mounted signage designating the accessible parking space. The sign shall be located so that it cannot be obscured by a vehicle parked in the space.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Modify or replace post mounted sign \$158 **Code Reference** MA 23.6, ADA 502, 502.6

Record Number 54029

Parking Lot , Parking Space : Parking Space Accessible Signage Height



Parking - Exterior: Parking Lot, Parking Space

Parking Lot Next to Main Entrance Right Accessible Space

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 4.40 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface to correct slope and \$3,800 re-stripe

Code Reference MA 23.4.3, ADA 502, 502.4

Record Number 54026

Parking Lot , Parking Space : Parking Space Slope



Parking - Exterior : Parking Lot , Parking Space

Parking Lot Next to Main Entrance

Right Accessible Space

Finding

There is an accessible parking space designated in the parking lot. There is no access aisle located at the parking space.

On-Site Finding No Access Aisle

Recommendation

Provide a compliant access aisle at the parking space. Parking spaces shall each provide an access aisle that may be shared.

Recommendation See Recommendation

Costing Info (Estimated)

Paint ground markings and install a \$370 post mounted sign

Code Reference MA 23.4.6, ADA 502, 502.3.4,

502.3

Record Number 54027

Parking Lot , Parking Space : No Access Aisle



Parking - Exterior : Parking Lot , Parking Space

Parking Lot Next to Main Entrance Right Accessible Space

Finding

The location of the accessible parking spaces requires individuals with disabilities to travel behind parked cars other than their own.

On-Site Finding See Above

Recommendation

Stripe an access aisle at the head of the accessible parking spaces, install a wheel stop at the head of the accessible parking spaces and at the general parking spaces. Wheel stops shall be used to prevent vehicles from encroaching into access aisles or walkways, but shall not present additional encroachment into those areas.

Recommendation See Recommendation

Costing Info (Estimated)

Install crosswalk \$1,100

Code Reference ADA 502.3

Record Number 54028

Parking Lot , Parking Space : Must Travel Behind Parked Cars



Parking - Exterior : Parking Lot , Parking Space

Staff Parking Lot Next to Litlle White House

Parking Lot , Parking Space : No Accessible Parking Spaces Available

Finding

There are not enough accessible parking spaces marked in the parking lot and therefore does not meet the minimum number required.

On-Site Finding None Found

Recommendation

Re-stripe any existing parking spaces marked accessible and create additional accessible parking spaces. Designate one parking space as "van-accessible".

Recommendation See Recommendation

Costing Info (Estimated)

Paint ground markings and install a \$370 post mounted sign

Code Reference MA 23.2, ADA 208, 208.2



Parking - Exterior : Parking Lot , Parking Space

Visitor Parking Lot

Accessible Space

Finding

The access aisle exceeds maximum slope.

On-Site Finding 4.10 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface to correct slope and \$3,800 re-stripe

Code Reference MA 23.4.6, ADA 502, 502.4

Record Number 52731



Parking Lot , Parking Space : Access Aisle Slope

Parking - Exterior : Parking Lot , Parking Space

Visitor Parking Lot

Accessible Space

Finding

The accessible parking space outline is faded, damaged, missing or otherwise not viewable.

On-Site Finding Faded or Damaged

Recommendation

Re-stripe the existing parking space marked as accessible to define the width of the space.

Recommendation See Recommendation

Costing Info (Estimated)

Re-stripe existing parking space \$350 **Code Reference** MA 23.4.5, ADA 502, 502.2

Record Number 52728

Parking Lot , Parking Space : Outline is Faded, Damaged or Missing



Parking - Exterior: Parking Lot, Parking Space

Visitor Parking Lot Accessible Space

Finding

The surface of the accessible parking space has a slope greater than allowed.

On-Site Finding 4.90 percent

Recommendation

Pave the parking lot to provide a level surface.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Repave surface to correct slope and \$3,800 re-stripe

Code Reference MA 23.4.3, ADA 502, 502.4

Record Number 52729

Parking Lot , Parking Space : Parking Space Slope



Parking - Exterior : Parking Lot , Parking Space

Visitor Parking Lot

Accessible Space

Finding

There is no vertically-mounted signage at the designated accessible parking space showing the International Symbol of Accessibility.

On-Site Finding None Found

Recommendation

Provide a permanently posted reflectorized sign that includes an International Symbol of Accessibility symbol at the head of the parking space. The "van-accessible" parking space shall provide an additional sign marked "van-accessible" mounted below the sign.

Recommendation See Recommendation

Costing Info (Estimated)

Install post mounted sign \$250

Code Reference MA 23.6, ADA 502, 502.6,

703.7.2.1

Record Number 52730

Parking Lot , Parking Space : No Accessible Signage



Parking - Exterior : Parking Lot

Visitor Parking Lot

Finding

There are not enough accessible parking spaces marked in the parking lot and therefore does not meet the minimum number required.

On-Site Finding 1.00 spaces

Recommendation

Re-stripe any existing parking spaces marked accessible and create additional accessible parking spaces. Designate one parking space as "van-accessible".

Recommendation At least 3.00 spaces

Costing Info (Estimated)

Paint ground markings and install a \$370 post mounted sign

Code Reference MA 23.2, ADA 208, 208.2

Record Number 52727

Parking Lot : Less Than Minimum Required Parking Spaces



Passenger Loading Zones - Exterior : Passenger Loading Zone

Passenger Loading Zone Next to Main Entrance

Passenger Loading Zone : No Access Aisle

Finding

There is no required striped access aisle adjacent to the passenger loading zone.

On-Site Finding None Found

Recommendation

Create an access aisle to meet the required minimum width and length adjacent and parallel to the vehicle pull-up space. The access aisle striping for the passenger loading zone shall provide immediate access to an adjacent curb ramp or primary path of travel.

Recommendation See Recommendation

Costing Info (Estimated)

Stripe vehicle space and install sign \$650

Code Reference MA 23.7, ADA 502, 503, 503.3



Passenger Loading Zones - Exterior : Passenger Loading Zone

Passenger Loading Zone Next to Main Entrance

Passenger Loading Zone : No Sign

Finding

Passenger loading zone has no sign.

On-Site Finding Not Marked

Recommendation

Mark the passenger loading zone with ISA symbol of accessibility.

Recommendation See Recommendation

Costing Info (Estimated)

Mark access aisle \$220

Code Reference ADA 503.3.3

Record Number 54019



Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path from Nurse Parking to Gymnasium Ramp

Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Provide smooth surface \$150

Code Reference MA 20.10, ADA 303, 403.4

Record Number 54065



Path Of Travel , Walking Surfaces : Change in

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path from the Public Right of Way at West William Street to Main Entrance Change in Level

Finding

There is a change in elevation greater than recommended value.

On-Site Finding 0.50 inches

Recommendation

Ensure that the change in elevation is within the recommended value.

Recommendation Up to 0.25 inches

Costing Info (Estimated)

Provide smooth surface \$150 **Code Reference** MA 20.10, ADA 303, 403.4

Record Number 53636

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path from the Public Right of Way at West William Street to Main Entrance Exterior Walkway

Finding

There are slopes greater than allowed maximum slope on the primary path of travel.

On-Site Finding 13.40 percent for 20.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 5.00 percent

Costing Info (Estimated)

Install pathway \$3,600 **Code Reference** MA 20.9, ADA 402, 403.3

Record Number 53633

Path Of Travel , Walking Surfaces : Change in Level





Path Of Travel , Walking Surfaces : Walking

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path from the Public Right of Way at West William Street to Main Entrance Exterior Walkway

Finding

There are cross slopes greater than allowed on the primary path of travel.

On-Site Finding 4.50 percent for 55.00 feet

Recommendation

Provide a compliant path of travel.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Install pathway \$3,600 **Code Reference** MA 20.9, ADA 402, 403.3

Record Number 53634

Path of Travel - Exterior : Path Of Travel

Path from the Public Right of Way at West William Street to Main Entrance Exterior Walkway

Finding

Walking surface has an opening that is not compliant.

On-Site Finding Not Compliant

Recommendation

Make sure that the walking surface opening does not allow passage of a sphere more than 1/2 inch in diameter.

Recommendation See Recommendation

Costing Info (Estimated)

Resurface the area \$185

Code Reference ADA 302.3

Record Number 53635







Path Of Travel : Opening

Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path from the Visitor Parking Lot Accessible Space Exterior Walkway

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Costing Info (Estimated)

Install pathway \$1,840

Code Reference MA 29.1, ADA 302, 303, 403.2

Record Number 53095

Path Of Travel , Walking Surfaces : Noncompliant Surface



Path of Travel - Exterior : Path Of Travel , Walking Surfaces

Path to School Garden

Exterior Walkway

Finding

The path of travel is grass, dirt, or gravel, preventing access to individuals with mobility impairments.

On-Site Finding Dirt, Grass or Gravel

Recommendation

Provide an accessible route.

Recommendation See Recommendation

Costing Info (Estimated)

Install pathway \$1,840

Code Reference MA 29.1, ADA 302, 303, 403.2

Record Number 53800

Path Of Travel , Walking Surfaces : Noncompliant Surface



Ramps - Exterior : Ramp, Ramp Run

Ramp Next to Music Room

Run 1

Finding

The width of the ramp is less than required.

On-Site Finding 47.75 inches

Recommendation

Widen the run of the ramp so that it has minimum required width.

Recommendation At least 48.00 inches

Costing Info (Estimated)

Install new ramp \$9,515 **Code Reference** MA 24.3, ADA 405, 405.5

Record Number 54003

Ramps - Exterior : Ramp , Landing

Ramp Next to Music Room

Run 1 Bottom Landing

Finding

The slope of the landing is greater than required.

On-Site Finding 5.80 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Modify ramp landing \$2,872 **Code Reference** MA 20.9, ADA 402, 405.7.1

Record Number 54004

Ramp , Ramp Run : Ramp Run Width



 ${\sf Ramp\ , \ Landing\ :\ \ Landing\ Slope}$



Ramps - Exterior : Ramp , Landing

Ramp Next to Music Room

Run 1 Bottom Landing

Finding

The distance between the latch side of the door and the edge of the landing does not meet the required minimum distance.

On-Site Finding 13.00 inches

Recommendation

Modify or replace the top landing on the ramp to provide a top landing with a level surface and provides the required minimum distance from the latch side of the door the edge of the landing.

Recommendation At least 42.00 inches

Costing Info (Estimated)

Modify ramp landing \$3,168 **Code Reference** MA 24.4.6, ADA 404, 405

Record Number 54005

Ramps - Exterior : Ramp , Landing

Ramp Next to Music Room

Run 1 Intermediate Landing

Finding

The slope of the landing is greater than required.

On-Site Finding 4.30 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Modify ramp landing \$2,872 **Code Reference** MA 20.9, ADA 402, 405.7.1

Record Number 54006

Ramp , Landing : Landing Edge to Door Clearance - Side Approach



Ramp, Landing: Landing Slope



Ramps - Exterior : Ramp , Handrail

Ramp Next to Music Room

Run 1 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 405.9.1, 505.10.1

Record Number 54012

Ramp , Handrail : Handrail Bottom Extension



Ramps - Exterior : Ramp , Handrail

Ramp Next to Music Room

Run 1 Left Handrail

Finding

There is not enough extension beyond the top or bottom of the ramp.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 405.9.1, 505.10.1

Record Number 54013

Ramp , Handrail : Handrail Bottom Extension



Ramps - Exterior : Ramp , Handrail

Ramp Next to Music Room

Run 1 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 54007

Ramp , Handrail : Handrail Extension not Parallel



Ramps - Exterior : Ramp , Handrail

Ramp Next to Music Room

Run 1 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 6.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 54008

Ramp , Handrail : Handrail Extension Length



Ramps - Exterior : Ramp, Handrail

Ramp Next to Music Room

Run 1 Right Handrail

Finding

The distance between the handrail and the adjacent wall is not compliant.

On-Site Finding 0.25 inches

Recommendation

Provide compliant handrails on each side.

Recommendation 1.50 inches


Costing Info (Estimated)

Provide compliant handrail with \$2,200

extensions

Code Reference MA 24.5.8, ADA 405, 405.8, 505.5

Record Number 54009

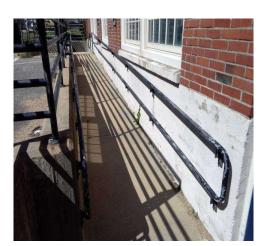

Ramp , Handrail : Handrail Distance from Wall

Ramps - Exterior : Ramp , Handrail

Ramp Next to Music Room

Run 1 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 54010

Ramp , Handrail : Handrail Extension not Parallel



Ramps - Exterior : Ramp , Handrail

Ramp Next to Music Room

Run 1 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 6.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 54011

Ramp , Handrail : Handrail Extension Length



Ramps - Exterior : Ramp, Handrail

Ramp Next to Music Room

Run 2 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

See Recommendation Recommendation

Costing Info (Estimated)


Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 505.10.1

Record Number 53999

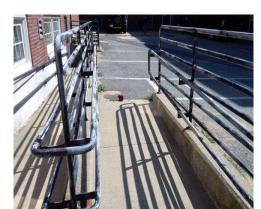

Ramp , Handrail : Handrail Top Extension

Ramps - Exterior : Ramp , Handrail

Ramp Next to Music Room

Run 2 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding Not Found

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, MA 24.5.9, ADA 405,

405.8, 505.10.1

Record Number 54002

Ramps - Exterior : Ramp , Landing

Ramp Next to Music Room

Run 2 Top Landing

Finding

The slope of the landing is greater than required.

On-Site Finding 5.40 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.


Recommendation Up to 2.08 percent

Costing Info (Estimated)

Modify ramp landing \$2,872 **Code Reference** MA 20.9, ADA 402, 405.7.1

Record Number 53997

Ramp, Handrail: Handrail Top Extension

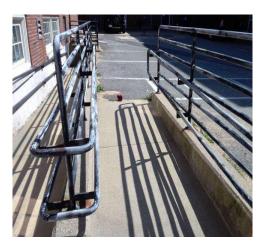

Ramp , Landing : Landing Slope



Ramps - Exterior : Ramp , Landing

Ramp Next to Music Room

Run 2 Top Landing

Ramp , Landing : Landing Change in Level

Finding

There is a change in elevation greater than allowed on the primary path of travel of the ramp that is not beveled.

On-Site Finding 0.62 inches

Recommendation

Bevel the area or resurface the area to provide a smooth and level path of travel.

Recommendation Up to 0.50 inches

Costing Info (Estimated)

Patch pathway \$1,840

Code Reference MA 20.10, ADA 302, 303, 405.7.1,

303.3

Record Number 53998



Ramp , Ramp Run : Ramp Run Edge Protection

Ramps - Exterior : Ramp , Ramp Run

Ramp to Gymnasium

Run 1

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding None Found

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation See Recommendation

Costing Info (Estimated)

Install edge protection on ramp \$470 **Code Reference** MA 24.8, ADA 405, 405.9



Ramps - Exterior : Ramp, Ramp Run

Ramp to Gymnasium

Run 1

Finding

The slope of the ramp is greater than the allowed slope.

On-Site Finding 10.10 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Correct ramp slope \$3,600 **Code Reference** MA 24.2, ADA 405, 405.2

Record Number 53753

Ramps - Exterior : Ramp , Ramp Run

Ramp to Gymnasium

Run 1

Finding

The cross slope of the ramp is greater than the allowed cross slope.

On-Site Finding 4.10 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Correct ramp slope \$3,600 **Code Reference** MA 24.6, ADA 403, 405.3





 ${\sf Ramp\ Ramp\ Run\ :\ Ramp\ Run\ Cross\ Slope}$



Ramps - Exterior : Ramp , Landing

Ramp to Gymnasium

Run 1 Intermediate Landing

Finding

The ramp changes direction. The width of the landing does not meet the minimum required width.

On-Site Finding 52.00 inches

Recommendation

Modify or replace the landing to provide the minimum required length and width.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Modify ramp landing \$2,872

Code Reference MA 24.4.5, ADA 405, 504.7.4

Record Number 53755

Ramps - Exterior : Ramp , Landing

Ramp to Gymnasium

Run 1 Intermediate Landing

Finding

The slope of the landing is greater than required.

On-Site Finding 3.10 percent

Recommendation

Modify the landing to create a slope in any direction not exceeding the required maximum value.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Modify ramp landing \$2,872 **Code Reference** MA 20.9, ADA 402, 405.7.1









Ramps - Exterior : Ramp, Handrail

Ramp to Gymnasium

Run 1 Left Handrail

Finding

The distance between the handrail and the adjacent wall is not compliant.

On-Site Finding 1.75 inches

Recommendation

Provide compliant handrails on each side.

Recommendation 1.50 inches

Costing Info (Estimated)

Provide compliant handrail with \$2,200

extensions

Code Reference MA 24.5.8, ADA 405, 405.8, 505.5

Record Number 53762



Ramp , Handrail : Handrail Distance from Wall

Ramps - Exterior : Ramp , Handrail

Ramp to Gymnasium

Run 1 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53758

Ramp , Handrail : Handrail Extension not Parallel



Ramps - Exterior : Ramp , Handrail

Ramp to Gymnasium

Run 1 Right Handrail

Finding

The distance between the handrail and the adjacent wall is not compliant.

On-Site Finding 0.37 inches

Recommendation

Provide compliant handrails on each side.

Recommendation 1.50 inches

Costing Info (Estimated)

Provide compliant handrail with \$2,200

extensions

Code Reference MA 24.5.8, ADA 405, 405.8, 505.5

Record Number 53759



Ramp , Handrail : Handrail Distance from Wall

Ramps - Exterior : Ramp , Handrail

Ramp to Gymnasium

Run 1 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53760

Ramp , Handrail : Handrail Extension not Parallel



Ramps - Exterior : Ramp , Handrail

Ramp to Gymnasium

Run 1 Right Handrail

Finding

The distance between the handrail and the adjacent wall is not compliant.

On-Site Finding 0.12 inches

Recommendation

Provide compliant handrails on each side.

Recommendation 1.50 inches

Costing Info (Estimated)

Provide compliant handrail with \$2,200

extensions

Code Reference MA 24.5.8, ADA 405, 405.8, 505.5

Record Number 53761

Ramps - Exterior : Ramp , Ramp Run

Ramp to Gymnasium

Run 2

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding None Found

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation See Recommendation

Costing Info (Estimated)

Install edge protection on ramp \$470 **Code Reference** MA 24.8, ADA 405, 405.9

Record Number 53763

Ramp , Handrail : Handrail Distance from Wall



Ramp , Ramp Run : Ramp Run Edge Protection



Ramps - Exterior : Ramp, Ramp Run

Ramp to Gymnasium

Run 2

Finding

The slope of the ramp is greater than the allowed slope.

On-Site Finding 9.10 percent

Recommendation

Modify the run of the ramp to provide the required slope and cross slope.

Recommendation Up to 8.33 percent

Costing Info (Estimated)

Correct ramp slope \$3,600 **Code Reference** MA 24.2, ADA 405, 405.2

Record Number 53764

Ramps - Exterior : Ramp , Handrail

Ramp to Gymnasium

Run 2 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400


extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53765

Ramp, Ramp Run: Ramp Run Slope

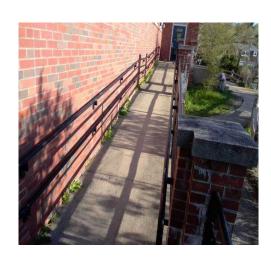

 $Ramp\ ,\ Handrail\ :\ Handrail\ Extension\ not\ Parallel$



Ramps - Exterior : Ramp , Handrail

Ramp to Gymnasium

Run 2 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 6.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53766

Ramp , Handrail : Handrail Extension Length



Ramps - Exterior : Ramp, Handrail

Ramp to Gymnasium

Run 2 Right Handrail

Finding

The distance between the handrail and the adjacent wall is not compliant.

On-Site Finding 2.00 inches

Recommendation

Provide compliant handrails on each side.

Recommendation 1.50 inches


Costing Info (Estimated)

Provide compliant handrail with \$2,200

extensions

Code Reference MA 24.5.8, ADA 405, 405.8, 505.5

Record Number 53767

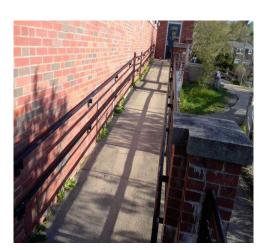

Ramp , Handrail : Handrail Distance from Wall

Ramps - Exterior : Ramp , Handrail

Ramp to Gymnasium

Run 2 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53768

Ramp , Handrail : Handrail Extension not Parallel



Ramps - Exterior : Ramp , Handrail

Ramp to Gymnasium

Run 2 Right Handrail

Finding

There is not enough extension beyond the top or bottom of the rail.

On-Site Finding 6.00 inches

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Provide compliant handrail \$2,400

extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53769

Ramp , Handrail : Handrail Extension Length



Ramps - Exterior : Ramp, Handrail

Ramp to Gymnasium

Run 2 Right Handrail

Finding

The distance between the handrail and the adjacent wall is not compliant.

On-Site Finding 2.00 inches

Recommendation

Provide compliant handrails on each side.

Recommendation 1.50 inches

Costing Info (Estimated)

Provide compliant handrail with \$2,200

extensions

Code Reference MA 24.5.8, ADA 405, 405.8, 505.5

Record Number 53770

Ramps - Exterior : Ramp , Ramp Run

Ramp to Gymnasium

Run 3

Finding

The ramp run does not provide adequate edge protection to prevent individuals from slipping off the ramp.

On-Site Finding None Found

Recommendation

Install compliant edge protection on each side of the ramp run.

Recommendation See Recommendation

Costing Info (Estimated)

Install edge protection on ramp \$470 **Code Reference** MA 24.8, ADA 405, 405.9

Record Number 53745

Ramp , Handrail : Handrail Distance from Wall







Ramps - Exterior : Ramp, Handrail

Ramp to Gymnasium

Run 3 Left Handrail

Finding

The distance between the handrail and the adjacent wall is not compliant.

On-Site Finding 1.75 inches

Recommendation

Provide compliant handrails on each side.

Recommendation 1.50 inches

Costing Info (Estimated)

Provide compliant handrail with \$2,200

extensions

Code Reference MA 24.5.8, ADA 405, 405.8, 505.5

Record Number 53746

Ramps - Exterior : Ramp, Handrail

Ramp to Gymnasium

Run 3 Left Handrail

Finding

The distance between the handrail and the adjacent wall is not compliant.

On-Site Finding 1.75 inches

Recommendation

Provide compliant handrails on each side.

Recommendation 1.50 inches

Costing Info (Estimated)

Provide compliant handrail with \$2,200

extensions

Code Reference MA 24.5.8, ADA 405, 405.8, 505.5

Record Number 53751

Ramp , Handrail : Handrail Distance from Wall







Ramps - Exterior : Ramp , Handrail

Ramp to Gymnasium

Run 3 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400


extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53747

Ramp , Handrail : Handrail Extension not Parallel

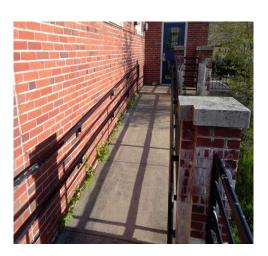

Ramps - Exterior : Ramp, Handrail

Ramp to Gymnasium

Run 3 Right Handrail

Finding

The distance between the handrail and the adjacent wall is not compliant.

On-Site Finding 1.75 inches

Recommendation

Provide compliant handrails on each side.

Recommendation 1.50 inches

Costing Info (Estimated)

Provide compliant handrail with \$2,200

extensions

Code Reference MA 24.5.8, ADA 405, 405.8, 505.5

Record Number 53748



Ramp , Handrail : Handrail Distance from Wall

Ramps - Exterior : Ramp , Handrail

Ramp to Gymnasium

Run 3 Right Handrail

Finding

The handrail extension is not parallel to the floor or ground surface.

On-Site Finding Not Parallel

Recommendation

The handrails shall provide extensions that are parallel to the floor or ground surface extending beyond the top and bottom of the ramp and return smoothly to the post or wall.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant handrail \$2,400


extensions

Code Reference MA 24.5.4, ADA 405, 405.8,

505.10.1

Record Number 53749

Ramp , Handrail : Handrail Extension not Parallel

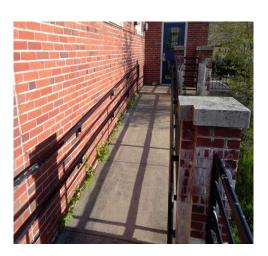

Ramps - Exterior : Ramp, Handrail

Ramp to Gymnasium

Run 3 Right Handrail

Finding

The distance between the handrail and the adjacent wall is not compliant.

On-Site Finding 2.00 inches

Recommendation

Provide compliant handrails on each side.

Recommendation 1.50 inches


Costing Info (Estimated)

Provide compliant handrail with \$2,200

extensions

Code Reference MA 24.5.8, ADA 405, 405.8, 505.5

Record Number 53750

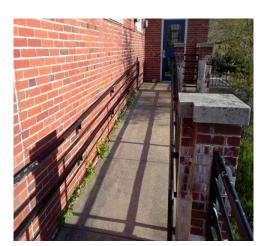

Ramp , Handrail : Handrail Distance from Wall

Stairs - Exterior : Stairway , Handrails

Stairs from the Public Right of Way at Spring Street Run 1 Left Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.3,

504.6

Record Number 53689

Stairs - Exterior : Stairway , Handrails

Stairs from the Public Right of Way at Spring Street

Run 1 Left Handrail

Stairway , Handrails : Handrail Extension

Finding

The ends of the handrails are not rounded or returned smoothly to the wall or post.

On-Site Finding None Found

Recommendation

Install handrail extensions that are rounded or returned smoothly to the wall post.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant handrail \$1,916

Code Reference MA 27.4.8, ADA 504, 504.6, 505.10

Record Number 53690



Stairway , Handrails : No Bottom Handrail

Extension



Stairs - Exterior : Stairway , Handrails

Stairs from the Public Right of Way at Spring Street Run 1 Left Handrail

Stairway , Handrails : Handrail Extension Length

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 10.00 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53691



Stairs - Exterior : Stairway , Handrails

Stairs from the Public Right of Way at Spring Street Run 1 Left Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53692

Stairway , Handrails : Handrail Extension not Parallel



Stairs - Exterior : Stairway , Handrails

Stairs from the Public Right of Way at Spring Street Run 1 Left Handrail

Stairway , Handrails : Handrail Height

Finding

The handrails are not mounted at the required height.

On-Site Finding 29.50 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53693

Stairs - Exterior : Stairway , Handrails

Stairs from the Public Right of Way at Spring Street

Run 1 Right Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Costing Info (Estimated)


Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.3,

504.6

Record Number 53694



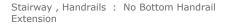



Stairs - Exterior : Stairway , Handrails

Stairs from the Public Right of Way at Spring Street

Run 1 Right Handrail

Stairway , Handrails : Handrail Extension

Finding

The ends of the handrails are not rounded or returned smoothly to the wall or post.

On-Site Finding None Found

Recommendation

Install handrail extensions that are rounded or returned smoothly to the wall post.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant handrail \$1,916

Code Reference MA 27.4.8, ADA 504, 504.6, 505.10

Record Number 53695

Stairs - Exterior : Stairway , Handrails

Stairs from the Public Right of Way at Spring Street

Run 1 Right Handrail

Stairway , Handrails : Handrail Extension Length

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 10.00 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53696





Stairs - Exterior : Stairway , Handrails

Stairs from the Public Right of Way at Spring Street

Run 1 Right Handrail

Parallel

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53697

Stairs - Exterior : Stairway , Handrails

Stairs from the Public Right of Way at Spring Street

Run 1 Right Handrail

Stairway , Handrails : Handrail Height

Finding

The handrails are not mounted at the required height.

On-Site Finding 31.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53698



Stairway , Handrails : Handrail Extension not



Stairs - Exterior : Stairway

Stairs from the Public Right of Way at Spring Street

Stairway

Finding

Stairway is marked as primary access. There is no other means of vertical access.

On-Site Finding No Access

Recommendation

Provide a compliant means of vertical access.

Recommendation See Recommendation

Costing Info (Estimated)

Modify stairway \$4,816

Code Reference MA 20.12.3, ADA 210, 504, 206.2,

402.2

Record Number 53688

Stairs - Exterior : Stairway , Handrails

Stairs from the Visitor Parking Lot

Run 1 Left Handrail

Finding

The gripping surface of the handrail is interrupted.

On-Site Finding Interrupted

Recommendation

Remount the handrails so they are not interrupted. Otherwise, replace the handrails with ones that provide a smooth, uninterrupted gripping surface.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant handrail \$1,840

Code Reference MA 27.4.6, ADA 504, 505.6, 504.6

Record Number 52954



Stairway , Handrails : Handrail Interrupted



Stairs - Exterior : Stairway , Handrail

Stairs from the Visitor Parking Lot

Run 1 Left Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 52955

Stairs - Exterior : Stairway , Handrails

Stairs from the Visitor Parking Lot

Run 1 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 29.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52956

Stairway , Handrail : Handrail Bottom Extension



Stairway , Handrails : Handrail Height



Stairs - Exterior : Stairway , Handrails

Stairs from the Visitor Parking Lot

Run 1 Middle Handrail

Finding

The gripping surface of the handrail is interrupted.

On-Site Finding Interrupted

Recommendation

Remount the handrails so they are not interrupted. Otherwise, replace the handrails with ones that provide a smooth, uninterrupted gripping surface.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant handrail \$1,840

Code Reference MA 27.4.6, ADA 504, 505.6, 504.6

Record Number 52952

Stairs - Exterior : Stairway , Handrails

Stairs from the Visitor Parking Lot

Run 1 Middle Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 29.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528


Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52953

Stairway , Handrails : Handrail Interrupted



Stairway , Handrails : Handrail Height

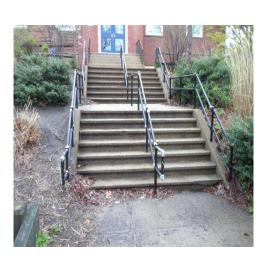

Stairs - Exterior : Stairway , Handrails

Stairs from the Visitor Parking Lot

Run 1 Right Handrail

Finding

The gripping surface of the handrail is interrupted.

On-Site Finding Interrupted

Recommendation

Remount the handrails so they are not interrupted. Otherwise, replace the handrails with ones that provide a smooth, uninterrupted gripping surface.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant handrail \$1,840

Code Reference MA 27.4.6, ADA 504, 505.6, 504.6

Record Number 52957

Stairs - Exterior : Stairway , Handrail

Stairs from the Visitor Parking Lot

Run 1 Right Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 52958

Stairway , Handrails : Handrail Interrupted



Stairway , Handrail : Handrail Bottom Extension



Stairs - Exterior : Stairway , Handrails

Stairs from the Visitor Parking Lot Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 29.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52959

Stairs - Exterior : Stairway , Handrails

Stairs from the Visitor Parking Lot

Run 2 Left Handrail

Finding

The gripping surface of the handrail is interrupted.

On-Site Finding Interrupted

Recommendation

Remount the handrails so they are not interrupted. Otherwise, replace the handrails with ones that provide a smooth, uninterrupted gripping surface.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant handrail \$1,840


Code Reference MA 27.4.6, ADA 504, 505.6, 504.6

Record Number 52960

Stairway , Handrails : Handrail Height



Stairway , Handrails : Handrail Interrupted

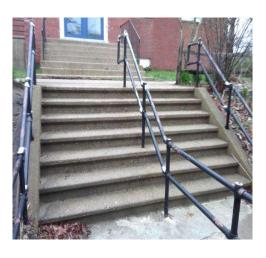

Stairs - Exterior : Stairway , Handrail

Stairs from the Visitor Parking Lot

Run 2 Left Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 52961

Stairs - Exterior : Stairway , Handrails

Stairs from the Visitor Parking Lot Run 2 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 28.00 inches

Recommendation

Provide handrails on the stairway at the required height.


Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)


Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52962 Stairway , Handrail : Handrail Bottom Extension

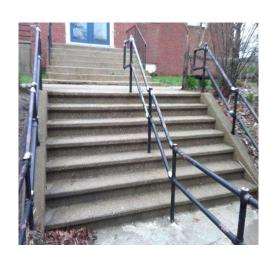

Stairway , Handrails : Handrail Height

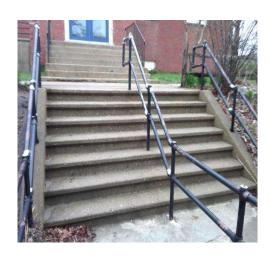

Stairs - Exterior : Stairway , Handrails

Stairs from the Visitor Parking Lot

Run 2 Middle Handrail

Finding

The gripping surface of the handrail is interrupted.

On-Site Finding Interrupted

Recommendation

Remount the handrails so they are not interrupted. Otherwise, replace the handrails with ones that provide a smooth, uninterrupted gripping surface.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant handrail \$1,840

Code Reference MA 27.4.6, ADA 504, 505.6, 504.6

Record Number 52963

Stairs - Exterior : Stairway , Handrail

Stairs from the Visitor Parking Lot

Run 2 Middle Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 52964

Stairway , Handrails : Handrail Interrupted



Stairway , Handrail : Handrail Bottom Extension



Stairs - Exterior : Stairway , Handrails

Stairs from the Visitor Parking Lot

Run 2 Middle Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 27.50 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52965

Stairs - Exterior : Stairway , Handrails

Stairs from the Visitor Parking Lot

Run 2 Right Handrail

Finding

The gripping surface of the handrail is interrupted.

On-Site Finding Interrupted

Recommendation

Remount the handrails so they are not interrupted. Otherwise, replace the handrails with ones that provide a smooth, uninterrupted gripping surface.

Recommendation See Recommendation


Costing Info (Estimated)

Add compliant handrail \$1,840


Code Reference MA 27.4.6, ADA 504, 505.6, 504.6

Record Number 52966

Stairway , Handrails : Handrail Height

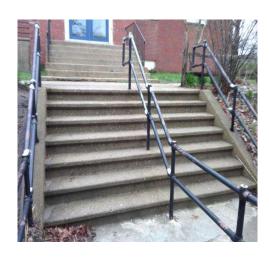

Stairway , Handrails : Handrail Interrupted

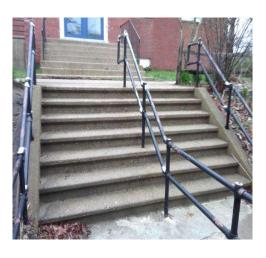

Stairs - Exterior : Stairway , Handrail

Stairs from the Visitor Parking Lot Run 2 Right Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 52967

Stairs - Exterior : Stairway , Handrails

Stairs from the Visitor Parking Lot Run 2 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 28.75 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528


Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 52968

Stairway , Handrail : Handrail Bottom Extension



Stairway , Handrails : Handrail Height

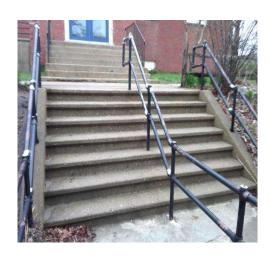

Stairs - Exterior : Stairway

Stairs from the Visitor Parking Lot

Stairway

Finding

Stairway is marked as primary access. There is no other means of vertical access.

On-Site Finding No Access

Recommendation

Provide a compliant means of vertical access.

Recommendation See Recommendation

Costing Info (Estimated)

Modify stairway \$4,816

Code Reference MA 20.12.3, ADA 210, 504, 206.2,

402.2

Record Number 52951

Stairs - Exterior : Stairway , Handrails

Stairs Next to Little White House

Run 1 Left Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 54098



Stairway , Handrails : Handrail Extension not Parallel



Stairs - Exterior : Stairway , Handrail

Stairs Next to Little White House

Run 1 Left Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 54099

Stairs - Exterior : Stairway , Handrails

Stairs Next to Little White House

Run 1 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 31.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 54100

Stairway , Handrail : Handrail Bottom Extension



Stairway , Handrails : Handrail Height



Stairs - Exterior : Stairway , Handrails

Stairs Next to Little White House Run 1 Right Handrail

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 11.00 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 54094

Stairway , Handrails : Handrail Extension Length



Stairs - Exterior : Stairway , Handrails

Stairs Next to Little White House Run 1 Right Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 54095

Stairway , Handrails : Handrail Extension not Parallel



Stairs - Exterior : Stairway , Handrail

Stairs Next to Little White House

Run 1 Right Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 54096

Stairs - Exterior : Stairway , Handrails

Stairs Next to Little White House

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 30.50 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 54097

Stairway , Handrail : Handrail Bottom Extension



Stairway , Handrails : Handrail Height



Stairs - Exterior : Stairway

Stairs Next to Little White House

Stairway

Finding

Stairway is marked as primary access. There is no other means of vertical access.

On-Site Finding No Access

Recommendation

Provide a compliant means of vertical access.

Recommendation See Recommendation

Costing Info (Estimated)

Modify stairway \$4,816

Code Reference MA 20.12.3, ADA 210, 504, 206.2,

402.2

Record Number 54093

Stairs - Exterior : Stairway

Stairs Next to Swings

Run 1

Finding

The risers on the stairway are not a compliant height.

On-Site Finding 1.00 inches

Recommendation

Modify or replace the stairs to provide compliant riser height.

Recommendation 4.00 - 7.00 inches

Costing Info (Estimated)

Unassigned

Code Reference ADA 504.2

Record Number 53778



Stairway : Risers Height



Stairs - Exterior : Stairway , Risers

Stairs Next to Swings

Run 1

Finding

The height of the risers are not uniform.

On-Site Finding Not Uniform

Recommendation

Modify or replace the stairs to provide uniform riser height.

Recommendation See Recommendation

Costing Info (Estimated)

Install stairway \$8,520

Code Reference MA 27.2, ADA 504

Record Number 53779

Stairs - Exterior : Stairway , Handrails

Stairs Next to Swings

Run 1 Left Handrail

Finding

The ends of the handrails are not rounded or returned smoothly to the wall or post.

On-Site Finding None Found

Recommendation

Install handrail extensions that are rounded or returned smoothly to the wall post.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant handrail \$1,916

Code Reference MA 27.4.8, ADA 504, 504.6, 505.10

Record Number 53780

Stairway , Risers : Risers Height



Stairway , Handrails $\,:\,$ Handrail Extension



Stairs - Exterior : Stairway , Handrails

Stairs Next to Swings

Run 1 Left Handrail

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 1.00 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53781

Stairway , Handrails : Handrail Extension Length



Stairs - Exterior : Stairway , Handrails

Stairs Next to Swings Run 1 Left Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53782

Stairway , Handrails : Handrail Extension not Parallel



Stairs - Exterior : Stairway , Handrails

Stairs Next to Swings

Run 1 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 31.75 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53783

Stairs - Exterior : Stairway , Handrails

Stairs Next to Swings

Run 1 Right Handrail

Finding

The ends of the handrails are not rounded or returned smoothly to the wall or post.

On-Site Finding None Found

Recommendation

Install handrail extensions that are rounded or returned smoothly to the wall post.

Recommendation See Recommendation

Costing Info (Estimated)


Add compliant handrail \$1,916

Code Reference MA 27.4.8, ADA 504, 504.6, 505.10

Record Number 53784

Stairway , Handrails : Handrail Height



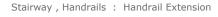



Stairs - Exterior : Stairway , Handrails

Stairs Next to Swings

Run 1 Right Handrail

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 1.00 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53785

Stairway , Handrails : Handrail Extension Length



Stairs - Exterior : Stairway , Handrails

Stairs Next to Swings Run 1 Right Handrail

Finding

The top handrail extension of the stairway is not parallel with the floor surface at the top landing.

On-Site Finding Not Parallel

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53786

Stairway , Handrails : Handrail Extension not Parallel



Stairs - Exterior : Stairway , Handrails

Stairs Next to Swings

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 31.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 53787

Stairs - Exterior : Stairway

Stairs Next to Swings

Finding

Stairway is marked as primary access. There is no other means of vertical access.

On-Site Finding No Access

Recommendation

Provide a compliant means of vertical access.

Recommendation See Recommendation

Costing Info (Estimated)

Modify stairway \$4,816

Code Reference MA 20.12.3, ADA 210, 504, 206.2,

402.2

Record Number 53777

Stairway , Handrails : Handrail Height



Stairway



Stairs - Exterior : Stairway , Risers

Stairs to Gymnasium

Run 1

Finding

The height of the risers are not uniform.

On-Site Finding Not Uniform

Recommendation

Modify or replace the stairs to provide uniform riser height.

Recommendation See Recommendation

Costing Info (Estimated)

Install stairway \$8,520

Code Reference MA 27.2, ADA 504

Record Number 54039

Stairs - Exterior : Stairway , Handrails

Stairs to Gymnasium

Run 1 Left Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.3,

504.6

Record Number 54042

Stairway , Risers : Risers Height



Stairway , Handrails : No Bottom Handrail Extension



Stairs - Exterior : Stairway , Handrails

Stairs to Gymnasium

Run 1 Left Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 30.00 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 54043

Stairs - Exterior : Stairway , Handrails

Stairs to Gymnasium

Run 1 Right Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.3,

504.6

Record Number 54040

Stairway , Handrails : Handrail Height



Stairway , Handrails : No Bottom Handrail Extension



Stairs - Exterior : Stairway , Handrails

Stairs to Gymnasium

Run 1 Right Handrail

Finding

The handrails are not mounted at the required height.

On-Site Finding 29.75 inches

Recommendation

Provide handrails on the stairway at the required height.

Recommendation 34.00 - 38.00 inches

Costing Info (Estimated)

Add compliant handrail \$1,528

Code Reference MA 27.4.2, ADA 504, 504.6, 505.4

Record Number 54041

Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1 Left Handrail

Finding

The diameter of the handrails is not within the required range.

On-Site Finding 2.25 inches

Recommendation

Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.

Recommendation 1.25 - 2.00 inches

Costing Info (Estimated)

Attach pipe railing to wall \$2,320

Code Reference MA 27.4.4, ADA 505, 504.6,

505.7.1

Record Number 53648

Stairway , Handrails : Handrail Height



Stairway , Handrails : Handrail Diameter



Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1 Left Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.3,

504.6

Record Number 53649

Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1 Right Handrail

Finding

The diameter of the handrails is not within the required range.

On-Site Finding 2.25 inches

Recommendation

Replace the handrails on each side to provide a smooth and continuous gripping surface diameter within the required range.

Recommendation 1.25 - 2.00 inches

Costing Info (Estimated)

Attach pipe railing to wall \$2,320

Code Reference MA 27.4.4, ADA 505, 504.6,

505.7.1

Record Number 53650

Stairway , Handrails : No Bottom Handrail Extension



Stairway , Handrails : Handrail Diameter



Stairs - Exterior : Stairway , Handrails

Stairs to Main Entrance

Run 1 Right Handrail

Finding

There are no bottom handrail extensions provided.

On-Site Finding None Found

Recommendation

Install handrail extension to the bottom of the handrail that extends beyond the bottom riser at least one tread depth.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.3,

504.6

Record Number 53653

Stairs - Exterior : Stairway

Stairs to Main Entrance

Finding

Stairway is marked as primary access. There is no other means of vertical access.

On-Site Finding No Access

Recommendation

Provide a compliant means of vertical access.

Recommendation See Recommendation

Costing Info (Estimated)

Modify stairway \$4,816

Code Reference MA 20.12.3, ADA 210, 504, 206.2,

402.2

Record Number 55923

Stairway , Handrails : No Bottom Handrail Extension



Stairway



Stairs - Exterior : Stairway , Handrails

Stairs to Music Room

Run 1 Left Handrail

Finding

The top handrail extension is not the required length beyond the top riser.

On-Site Finding 8.00 inches

Recommendation

Install a compliant handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface of the landing.

Recommendation At least 12.00 inches

Costing Info (Estimated)


Add compliant extension to existing \$800 railing

Code Reference MA 27.4.3, ADA 504, 504.6,

505.10.2

Record Number 53774

Stairway , Handrails : Handrail Extension Length

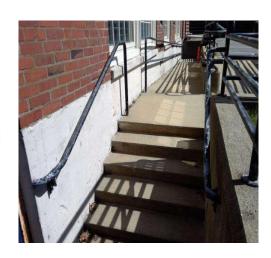

Stairs - Exterior : Stairway , Handrails

Stairs to Music Room Run 1 Right Handrail

Finding

There are no top handrail extensions provided on the stairway.

On-Site Finding None Found

Recommendation

Install handrail extension to the top of the handrail that extends beyond the top riser and is parallel to the floor surface at the top landing.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference MA 27.4.3, ADA 504, 505.10.1,

504.6, 505.10.2

Record Number 53772

Stairway , Handrails : No Top Handrail Extension



Stairs - Exterior : Stairway , Handrail

Stairs to Music Room

Run 1 Right Handrail

Finding

The bottom handrail does not extend the depth of one stair tread beyond the bottom step.

On-Site Finding None Found

Recommendation

Provide a compliant handrail extension.

Recommendation See Recommendation

Costing Info (Estimated)

Add compliant extension to existing \$1,425 railing

Code Reference ADA 504, 505.10.3, 504.6

Record Number 53773



Directional Signage from Gymnasium Stairs to Accessible Route

Signage , Direction/Informational : Character

Size



There is signage suspended or projected overhead. The size of the lettering is less than required or cannot be viewed at a practical distance.

On-Site Finding 2.00 inches

Recommendation

Install accessible signage with lettering sized according to viewing distance.

Recommendation At least 3.00 inches


Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.4, ADA 703, 216, 703.5.5,

703.2.5

Record Number 53887

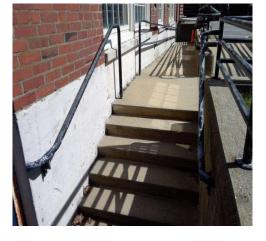

Stairway , Handrail : Handrail Bottom Extension



Signage - Exterior : Signage , Signage

Directional Signage from Stairs Next to Little White House

Signage , Signage : No Directional or Information Signage

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.3,

703.5

Record Number 54015

Signage - Exterior : Signage , Signage

Directional Signage from the Public Right of Way at West William Street

Signage , Signage : No Directional or Information Signage

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.3,

703.5





Signage - Exterior : Signage , Signage

Directional Signage from the Stairs at the Public Right of Way at Spring Street

Finding

There is no directional signage.

On-Site Finding None Found

Recommendation

Install directional signage to each accessible element or room.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.3,

703.5

Record Number 53926



Signage , Signage : No Directional or

Information Signage

Outdoor Sports Areas - Exterior : Outdoor Sports Area

Baseball Field Next to Visitor Parking Lot

Finding

There are not enough accessible seats at the location with respect to the total number of seats available.

On-Site Finding None Found

Recommendation

Provide compliant accessible seating at the location.

Recommendation At least 4.00 seats

Costing Info (Estimated)

Requires re-design \$600

Code Reference ADA 221.2, 802.1





Play Area - Exterior : Play Area , Equipment

Large Play Area

Elevated Equipment - Fibar

Finding

The transfer platform height is not compliant.

On-Site Finding 24.00 inches

Recommendation

Provide compliant platform with recommended value at the transfer point.

Recommendation 11.00 - 18.00 inches

Costing Info (Estimated)

Provide platform \$320 **Code Reference** ADA 1008, 1008.3.1.2

Record Number 53897

Play Area - Exterior : Play Area

Large Play Area

Finding

The play area is not located on an accessible route.

On-Site Finding Not Accessible

Recommendation

Provide a compliant accessible route to the play area.

Recommendation See Recommendation

Costing Info (Estimated)

Provide accessible route \$1,440

Code Reference ADA 1008, 240, 402.1, 1008.2

Record Number 53892

Play Area , Equipment : Platform Height



Play Area : Accessibility



Play Area - Exterior : Play Area

Large Play Area

Play Area : Point of Access

Finding

The play area provides no accessible point of access.

On-Site Finding Not Found

Recommendation

Provide compliant access to the play area.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400

Code Reference ADA 1008, 240, 1008.2

Record Number 53893

Play Area - Exterior : Play Area

Large Play Area

Play Area : Different Types of Ground Level Play Components

Finding

There are not enough different types of ground level play components on an accessible route with respect to the number of elevated play components provided.

On-Site Finding None Found

Recommendation

Provide enough different types of ground level play components on an accessible route.

Recommendation At least 2.00 features

Costing Info (Estimated)

Provide enough equipment \$110

Code Reference ADA 240, 1008.2.3, 240.2.1





Play Area - Exterior : Play Area

Large Play Area

Finding

There are not enough ground level play components on an accessible route with respect to the number of elevated play components provided.

On-Site Finding None Found

Recommendation

Provide enough ground level play components on an accessible route.

Recommendation At least 2.00 features

Costing Info (Estimated)

\$1,000

Code Reference ADA 240, 1008.2.3, 240.2.1

Record Number 53895

Play Area - Exterior : Play Area

Large Play Area

Finding

Clear space around stationary equipment is not compliant.

On-Site Finding 50.00 inches

Recommendation

Provide compliant clear space around stationary equipment for the play area.

Recommendation At least 72.00 inches

Costing Info (Estimated)

\$1,840

Code Reference ADA 1008.2.6.2

Record Number 53896



Play Area : Ground Level Play Components

Play Area : Clear Space Around Stationary Equipment



Play Area - Exterior : Play Area , Equipment

Small Play Area

Elevated Equipment - Fibar

Finding

Transfer platform depth is not compliant.

On-Site Finding 10.25 inches

Recommendation

Provide compliant platform with recommended value at the transfer point.

Recommendation At least 14.00 inches

Costing Info (Estimated)

Provide platform \$320 **Code Reference** ADA 1008, 1008.3.1.1

Record Number 53742

Play Area - Exterior : Play Area , Equipment

Small Play Area

Elevated Equipment - Fibar

Finding

The tread depth of the steps is not compliant.

On-Site Finding 10.25 inches

Recommendation

Provide steps with compliant tread depth.

Recommendation At least 14.00 inches


Costing Info (Estimated)

\$35

Code Reference ADA 1008, 1008.3.2.1





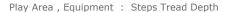



Play Area - Exterior : Play Area , Equipment

Small Play Area

Elevated Equipment - Fibar

Finding

All risers are not closed.

On-Site Finding Not Closed

Recommendation

All risers shall be closed.

Recommendation See Recommendation

Costing Info (Estimated)

Close risers \$320

Code Reference ADA 1008

Record Number 53744

Play Area - Exterior : Play Area

Small Play Area

Finding

The play area is not located on an accessible route.

On-Site Finding Not Accessible

Recommendation

Provide a compliant accessible route to the play area.

Recommendation See Recommendation

Costing Info (Estimated)

Provide accessible route \$1,440

Code Reference ADA 1008, 240, 402.1, 1008.2

Record Number 53739

Play Area , Equipment : Risers Not Closed



Play Area : Accessibility



Play Area - Exterior : Play Area

Small Play Area

Finding

The play area provides no accessible point of access.

On-Site Finding Not Found

Recommendation

Provide compliant access to the play area.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400

Code Reference ADA 1008, 240, 1008.2

Record Number 53740

Play Area - Exterior : Play Area

Small Play Area

Finding

Clear space around stationary equipment is not compliant.

On-Site Finding 46.00 inches

Recommendation

Provide compliant clear space around stationary equipment for the play area.

Recommendation At least 72.00 inches

Costing Info (Estimated)

\$1,840

Code Reference ADA 1008.2.6.2

Record Number 53741

Play Area : Point of Access

Play Area : Clear Space Around Stationary Equipment



Play Area - Exterior : Play Area

Swings Next to the Little White House

Finding

The play area is not located on an accessible route.

On-Site Finding Not Accessible

Recommendation

Provide a compliant accessible route to the play area.

Recommendation See Recommendation

Costing Info (Estimated)

Provide accessible route \$1,440

Code Reference ADA 1008, 240, 402.1, 1008.2

Record Number 54035

Play Area - Exterior : Play Area

Swings Next to the Little White House

Finding

The play area provides no accessible point of access.

On-Site Finding Not Found

Recommendation

Provide compliant access to the play area.


Recommendation See Recommendation

Costing Info (Estimated)

\$2,400

Code Reference ADA 1008, 240, 1008.2

Record Number 54036

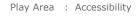



Play Area : Point of Access



Play Area - Exterior : Play Area

Swings Next to Visitor Parking Lot

Finding

The play area is not located on an accessible route.

On-Site Finding Not Accessible

Recommendation

Provide a compliant accessible route to the play area.

Recommendation See Recommendation

Costing Info (Estimated)

Provide accessible route \$1,440

Code Reference ADA 1008, 240, 402.1, 1008.2

Notes: Thin Layer of Fibar. **Record Number** 53858

Play Area - Exterior : Play Area

Swings Next to Visitor Parking Lot

Finding

The play area provides no accessible point of access.

On-Site Finding Not Found

Recommendation

Provide compliant access to the play area.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400

Code Reference ADA 1008, 240, 1008.2

Notes: Thin Layer of Fibar. **Record Number** 53859





Play Area : Accessibility



Play Area - Exterior : Play Area

Swings Next to Visitor Parking Lot

Finding

The average depth of the surface material for the play area is not compliant.

On-Site Finding 5.00 inches

Recommendation

Provide compliant surface material at the play area.

Recommendation At least 12.00 inches

Costing Info (Estimated)

\$11

Code Reference ADA 1008.2.6

Notes: Thin Layer of Fibar. **Record Number** 53860



Play Area : Average Depth of Surface Material

Play Area - Exterior : Play Area , Equipment

Wooden Play Area

Elevated Equipment - Fibar

Finding

The transfer platform height is not compliant.

On-Site Finding 5.00 inches

Recommendation

Provide compliant platform with recommended value at the transfer point.

Recommendation 11.00 - 18.00 inches

Costing Info (Estimated)

Provide platform \$320 **Code Reference** ADA 1008, 1008.3.1.2





Play Area - Exterior : Play Area , Equipment

Wooden Play Area

Elevated Equipment - Fibar

Finding

Transfer platform depth is not compliant.

On-Site Finding 9.00 inches

Recommendation

Provide compliant platform with recommended value at the transfer point.

Recommendation At least 14.00 inches

Costing Info (Estimated)

Provide platform \$320 **Code Reference** ADA 1008, 1008.3.1.1

Record Number 53915

Play Area - Exterior : Play Area , Equipment

Wooden Play Area

Elevated Equipment - Fibar

Finding

At least one means of support for transferring to the transfer platform is not provided at the steps.

On-Site Finding Not Provided

Recommendation

Provide at least one means of support for transferring to assist when transferring.

Recommendation See Recommendation

Costing Info (Estimated)

\$1,500

Code Reference ADA 1008, 1008.3.1.4

Record Number 53916

Play Area , Equipment : Platform Depth







Play Area - Exterior : Play Area

Wooden Play Area

Finding

The play area is not located on an accessible route.

On-Site Finding Not Accessible

Recommendation

Provide a compliant accessible route to the play area.

Recommendation See Recommendation

Costing Info (Estimated)

Provide accessible route \$1,440

Code Reference ADA 1008, 240, 402.1, 1008.2

Record Number 53909

Play Area - Exterior : Play Area

Wooden Play Area

The play area provides no accessible point of access.

On-Site Finding Not Found

Recommendation

Finding

Provide compliant access to the play area.

Recommendation See Recommendation

Costing Info (Estimated)

\$2,400

Code Reference ADA 1008, 240, 1008.2

Record Number 53910

Play Area : Accessibility



Play Area : Point of Access



Play Area - Exterior : Play Area

Wooden Play Area

Finding

There are not enough different types of ground level play components on an accessible route with respect to the number of elevated play components provided.

On-Site Finding None Found

Recommendation

Provide enough different types of ground level play components on an accessible route.

Recommendation At least 2.00 features

Costing Info (Estimated)

Provide enough equipment \$110

Code Reference ADA 240, 1008.2.3, 240.2.1

Record Number 53911

Play Area - Exterior : Play Area

Wooden Play Area

Finding

There are not enough ground level play components on an accessible route with respect to the number of elevated play components provided.

On-Site Finding None Found

Recommendation

Provide enough ground level play components on an accessible route.

Recommendation At least 2.00 features

Costing Info (Estimated)

\$1,000

Code Reference ADA 240, 1008.2.3, 240.2.1









Play Area - Exterior : Play Area

Wooden Play Area

Finding

Clear space around stationary equipment is not compliant.

On-Site Finding 57.00 inches

Recommendation

Provide compliant clear space around stationary equipment for the play area.

Recommendation At least 72.00 inches

Costing Info (Estimated)

\$1,840

Code Reference ADA 1008.2.6.2

Record Number 53913

Picnic Areas - Exterior : Picnic Tables

Picnic Tables Next to Gymnasium Entrance

Finding

There is no accessible route to the picnic tables.

On-Site Finding None Found

Recommendation

Provide an accessible route to the picnic tables.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant route \$1,440

Code Reference ADA 402, 403, 309, 205, 308, 226,

228

Record Number 54066

Play Area : Clear Space Around Stationary Equipment





Picnic Tables : Not on Accessible Route

Picnic Areas - Exterior : Picnic Tables

Picnic Tables Next to Gymnasium Entrance

Picnic Tables : At least 5% not Accessible

Finding

At least 5% of the provided tables are not accessible.

On-Site Finding None Found

Recommendation

Provide enough compliant Accessible Tables (At least 5% of the total Tables).

Recommendation At least 1.00 tables

Costing Info (Estimated)

Accessible table (each) \$500

Code Reference ADA 309, 305, 205, 306, 308, 902,

228, 226.1

Record Number 54067

Picnic Areas - Exterior : Picnic Tables

Picnic Tables Next to Large Play Area

Finding

There is no accessible route to the picnic tables.

On-Site Finding None Found

Recommendation

Provide an accessible route to the picnic tables.

Recommendation See Recommendation


Costing Info (Estimated)

Provide compliant route \$1,440

Code Reference ADA 402, 403, 309, 205, 308, 226,

228



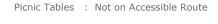



Picnic Areas - Exterior : Picnic Tables

Picnic Tables Next to Large Play Area

Picnic Tables : At least 5% not Accessible

Finding

At least 5% of the provided tables are not accessible.

On-Site Finding None Found

Recommendation

Provide enough compliant Accessible Tables (At least 5% of the total Tables).

Recommendation At least 1.00 tables

Costing Info (Estimated)

Accessible table (each) \$500

Code Reference ADA 309, 305, 205, 306, 308, 902,

228, 226.1

Record Number 54092

Benches - Exterior : Bench

Baseball Field Dugouts Next to Visitor Parking Lot

Bench : On Accessible Route

Finding

The bench is not on an accessible route.

On-Site Finding Not Accessible

Recommendation

Provide a compliant accessible route to the benches.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant route \$1,840

Code Reference ADA 309, 903, 305, 205, 308, 228





Benches - Exterior : Bench

Bench Next to Gymnasium Entrance

Bench : On Accessible Route

Finding

The bench is not on an accessible route.

On-Site Finding Not Accessible

Recommendation

Provide a compliant accessible route to the benches.

Recommendation See Recommendation

Costing Info (Estimated)

Provide compliant route \$1,840

Code Reference ADA 309, 903, 305, 205, 308, 228

Record Number 53655

Doors - Little White House : Door

Little White House Classroom from Main Entrance

Lever

Door : Door Hardware

Finding

Has a door stop.

On-Site Finding Found

Recommendation

Remove the door stop.

Recommendation See Recommendation

Costing Info (Estimated)

Remove door stop \$250

Code Reference ADA 404, 404.2.10





Doors - Little White House : Door , Latch Side Clearance

Little White House Classroom from Main Entrance Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 6.50 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$20,000 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Cabinet Obstructs Clear Floor Space Length.

Record Number 53920

Doors - Little White House : Door , Clear Floor Space

Little White House Classroom from Main Entrance Pull Side

Finding

There is not enough clear floor space provided at the pull side of the door.

On-Site Finding 29.00 inches

Recommendation

Provide the recommended clear floor space on the pull side of the door.

Recommendation At least 60.00 inches

Costing Info (Estimated)

Install automatic door opener \$14,605 **Code Reference** MA 26.6, ADA 404, 404.2.4

Notes: Cabinet Obstructs Clear Floor Space Length.

Record Number 53922

Door , Latch Side Clearance : Front Approach Latch Side Clearance







Doors - Little White House : Door , Clear Floor Space

Little White House Classroom from Main Entrance **Pull Side**

Door, Clear Floor Space: Floor Mat

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$630 surface

Code Reference ADA 403.2, 302.1

Notes: Cabinet Obstructs Clear Floor Space Length.

Record Number 53923



Doors - Little White House : Door , Clear Floor Space

Little White House Classroom from Main Entrance **Push Side**

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$630 surface

Code Reference ADA 403.2, 302.1

Record Number 53921



Door , Clear Floor Space : Floor Mat

Doors - Little White House : Door, Hardware

Little White House ELL Student Support Single Knob

Finding

The door opening hardware is not accessible.

On-Site Finding Not Accessible

Recommendation

Provide accessible hardware on the door.

Recommendation See Recommendation

Costing Info (Estimated)

Replace existing lock set with lever \$800 handled lock set

Code Reference ADA 404.2.7, 309.4

Record Number 53857

Doors - Little White House : Door , Threshold

Little White House Main Entrance

Finding

The height of the threshold at the entrance door is greater than allowed.

On-Site Finding 3.50 inches

Recommendation

Modify or replace the threshold to provide the recommended height.

Up to 0.50 inches Recommendation

Costing Info (Estimated)

Provide smooth transition \$436

Code Reference MA 26.10, ADA 404, 404.2.5

Record Number 53642



Door, Hardware: Non-Accessible Hardware



Door, Threshold: Door Threshold



Doors - Little White House : Door , Latch Side Clearance

Little White House Main Entrance Pull Side

Finding

There is less than the required latch side clearance on the pull side of the door.

On-Site Finding 12.00 inches

Recommendation

Provide required latch side clearance on the pull side of the door.

Recommendation At least 18.00 inches

Costing Info (Estimated)

Install automatic door opener \$2,921 **Code Reference** MA 26.6, ADA 404, 404.2.4

Record Number 53643

Door , Latch Side Clearance : Front Approach Latch Side Clearance



Doors - Little White House : Door , Clear Floor Space

Little White House Main Entrance Pull Side

Finding

There is no level landing at this door.

On-Site Finding 2.80 percent

Recommendation

Provide a level landing.

Recommendation Up to 2.08 percent

Costing Info (Estimated)

Correct slopes \$1,500

Code Reference MA 26.6, ADA 302, 404, 305,

404.2.4.4

Record Number 53645



Door , Clear Floor Space : Floor Surface Slope

Doors - Little White House : Door, Clear Floor Space

Little White House Main Entrance Pull Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126

surface

Code Reference ADA 403.2, 302.1

Record Number 53646

Doors - Little White House : Door, Hardware

Little White House Main Entrance

Push Bar / Lever

Finding

The door lock requires tight grasping, pinching, or twisting of the wrist to operate.

On-Site Finding Not Accessible

Recommendation

Provide a compliant door lock for the door that does not require tight grasping, pinching, or twisting of the wrist to operate.

Recommendation See Recommendation

Costing Info (Estimated)

Provide door lock \$310

Code Reference ADA 404.2.7, 309.4

Record Number 53641

Door , Clear Floor Space : Floor Mat



Door , Hardware : Door Lock



Doors - Little White House : Door , Clear Floor Space

Little White House Main Entrance

Push Side

Finding

An unstable floor mat is provided at the door landing.

On-Site Finding Not Compliant

Recommendation

Provide a compliant floor mat for the door.

Recommendation See Recommendation

Costing Info (Estimated)

Install mat that grips to the floor \$126 surface

Code Reference ADA 403.2, 302.1

Record Number 53644

Doors - Little White House : Door

Little White House Main Entrance

Finding

The door closing device limits the required headroom clearance.

On-Site Finding 77.50 inches

Recommendation

Replace the door closing device with a device that fits above the door casing and does not protrude into the primary path of travel.

Recommendation At least 78.00 inches

Costing Info (Estimated)

Install new door opener \$250

Code Reference MA 20.7, ADA 404, 404.2.3

Record Number 53640

Door, Clear Floor Space: Floor Mat



Door : Door Closer Vertical Clearance



Signage - Little White House : Signage

Little White House Classroom from Main Entrance

Signage: No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$316

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53637

Signage - Little White House : Signage

Little White House ELL Student Support

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.


Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2



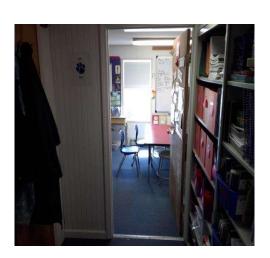

Signage - Little White House : Signage

Little White House ELL Student Support Next to Special Education

Signage : No Room Identification

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2

Record Number 53932

Signage - Little White House : Signage

Little White House Main Entrance

Finding

There is no room identification signage.

On-Site Finding None Found

Recommendation

Install room identification signage.

Recommendation See Recommendation

Costing Info (Estimated)

Install signage \$158

Code Reference MA 41.1, ADA 703, 216, 216.2



Signage $\,:\,$ No Room Identification





School

40 West Williams Street Vineyard Haven, MA 02568

Date of Inspection 5/6/2019

*Estimated Facility Total: \$1,255,949

*Estimated facility total is for estimating purposes only and does not represent total construction, repair totals or design fees.

Prepared Using